

Start Point: Fleetwood Ct / Claridge Drive South

End Point: Claridge Dr South Fairbank Lane

Direction of Increasing Station: Right Page 1 of 2

Reason Codes for NON-COMPLIANCE:


Inspector Name: J.T.
Date: 3-31-14 Mon.

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways:

20

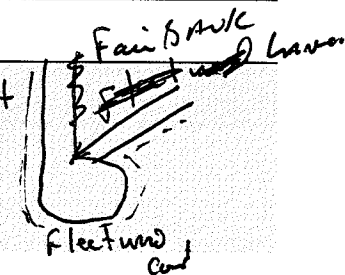

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Claridge Dr S.	0+00	1+40	1+40		VC	7 1/2" lip @ 9654
	1+40		1+52	1+77	CS	
			1+77		DS	1/2' 1/2" Driveway (note)
	1+77	2+06	2+06		VC	7 1/2" lip @ 9658
	2+06	2+13	2+13		VC	" "
	2+13	2+40	2+40	2+44	CS	
	2+44	3+58	3+58	3+75	CS	
Fleetwood Ct	3+93	4+13				end @ 9666
			4+13		VC	> 1/2" lip @ 9666
			4+39	4+68	CS	
			4+44		DS	@ 9668
	4+68	4+90	4+90	4+90	DS	@ 9670
	4		4+90	5+16	CS	
	5+16	5+21	5+21	5+35	CS	

Start Point: Fleetwood Ct / Claridge Dr. South / Fleetwood Ct

858

End Point: Fairbanks LA

300sb

Direction of Increasing Station:

Right page 2 of 2

Reason Codes for NON-COMPLIANCE:

Inspector Name: J.T

Date: 3-31-14 Mon.

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Fleetwood Ct			5+35		DS	@ 9672
			5+35	5+40	CS	
	5+40	5+95	5+95	6+01	CS	
	6+01	6+37	6+37	6+42	DS	CS @ 9675
	6+42		6+42	6+58	CS	
	6+58	6+68	6+68		VC	7 1/2" lip @ 9673
	6+68	6+95	6+95		VC	" " " "
	6+95	7+03	6+95	7+03	VC	" " " 9671
	7+03	7+86	7+86		VC	water meter lid in sidewalk
	7+86	7+87	7+87	8+02	DS	CS @ 9667
			8+02	8+49	DS	CS @ 9665
Fairbanks LA			8+49	8+58	CS	

300sb

Start Point: Ashbury Pl / Claridge Dr North
 End Point: Claridge Dr North
 Direction of Increasing Station: Right

Sidewalk Inventory

(Circle) Right

864

2995

Reason Codes for NON-COMPLIANCE:

Inspector Name: JT
 Date: 3-31-14 Mon.

VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object

DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

Total Number of Driveways:

10

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Claridge Dr N			0+00	0+04		
	0+04	4+47	4+47	4+76	CS	@ 9509
			4+55	4+76	DS	@ 9509
	4+76	4+89	4+89		CS	
			5+07	5+11	DS	@ 9507
	5+11	7+15	7+15		VC	> 1/2" lip @ 9503
	7+28		7+28		VC	" " " "
Claridge Dr N.	7+28	8+64	7+83		VC	
8+64	(7+28)					

2995

Bannister Dr ^{CT} ~~Inventory~~ ^{Sidewalk Inventory} (Circle) Right
 Start Point: ~~Fleetwood Way~~ Bannister Ct
 End Point: ~~Fleetwood Way~~ 2985
 Direction of Increasing Station: Right

Reason Codes for NON-COMPLIANCE:

Inspector Name: J.T
 Date: 3-31-14 Monday
 VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object
 DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

Total Number of Driveways: 8

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Bannister Dr	0+00	0+26	0+26	3+22	CS	1+67 to 1+76 PO Bus 4 (@ 6455)
			2+90		VC	> 1/2" lip @ Between 6455 & 6457
	3+22	3+22	3+22	3+27	CS	
	3+27	4+17	4+17	4+89	CS	> 1/2" lip @ 6454 ?
			4+89		VC	> 1/2" lip @ Between 6450 & 6452
	4+89	5+80	5+80			5+22 @ 6450 Rock hanging over walk
			5+80		VC	> 1/2" lip @ stop sign
Fleetwood Way	5+80					

2985

(Left) ~~3119~~

page 1 of 2

Start Point: Saddlebrook LA / Clardge Dr. Neth.

End Point: ~~Spring Forest Rd~~ Bannister Dr (see sheet 2)

Direction of Increasing Station: Left

2975a

Reason Codes for NON-COMPLIANCE:

Inspector Name: J.T.

Date: 3-31-14 Mon.

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

4

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
^{Clardge Dr N} Saddlebrook LA	0+00	1+36				
Saddlebrook Ct.	1+36	3+17				
Spring Forest Rd	3+17	4+72	4+72	*	VC	> 1/2" @ 6458
			4+88	4+92	VC	" "
	4+92	5+50	5+50		VC	> 1/2" @ 6460
			5+68		VC	" "
	5+68	5+86	5+86		PO	manhole & > 1/2" lip
	5+86	6+54	6+54		VC	> 1/2" @ 6462 storm water 1 1/2' above 6+56
	6+54	7+16	7+16	7+16	VC	" " @ 6464
7+16	7+16	7+16	7+49	7+49	VC	
	7+49	7+97	7+86	7+97	VC	storm water intent. 1' between 7+97
	7+97	8+42	8+42		VC	> 1/2" @ 6464 6+30
	8+42	8+70	8+70	8+82	VC	@ 6430 storm water intent > 1"
	8+70	8+95	8+95		VC	> 1/2" lip

2975a

10+19

(Left)

1273

Start Point: Saddlebrook LA / Claridge Dr N.

End Point: Bannister Dr

Direction of Increasing Station: Left

297sb

Reason Codes for NON-COMPLIANCE:

Inspector Name: ST
Date: 3-31-14

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways:

~~1~~ 1

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Saddlebrook LA ^{Spring Forested}	8+95	9+39	9+39			
Dresden PL	9+39	9+39	9+39	9+59	CS	6431
	9+59	9+99	9+99	10+40	CS	
	10+40	10+40	10+40		DS	6470
			10+40	10+69	CS	
	10+69	10+86	10+86		VC	7 1/2" @ 6470
	10+86	12+73				
Bannister Dr	12+73					

297sb

Left

Start Point: Bridgewater Ct West / Fairbanks LA

333

End Point: Claridge Dr South

2965

Direction of Increasing Station: Left

Reason Codes for NON-COMPLIANCE:

Inspector Name: T. J

Date: 3-31-14 Mon.

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: (8)

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Fairbanks LA			0+00	0+07	DS	@ 9414
	0+07	1+45	1+45	1+58	CS	
	1+58	1+66	1+66	1+71	DS	@ 9406
			1+71 1+66	1+88	CS	
Claridge Drs.	1+88	3+12	3+12	3+33	CS	
3+33						

2965

Left

2955

Start Point: Fairbanks LA / Fleetwood Ct

End Point: Bridgewater Ct. West

Direction of Increasing Station: Left

Reason Codes for NON-COMPLIANCE:

Inspector Name: T.J.
Date: 3-31-14 Mon.VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding ObjectDS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways:

3

Street Name: Compliant Non-Compliant
From To From To Code Comments

Fleetwood Ct			0+00	0+08	CS	
	0+08	0+60	0+60	0+80	CS	
	0+80	0+90	0+90	1+56	CS	
			1+56	1+56	DS	@6405
	1+56	2+24	2+24	2+27	CS	cleanout pipe $7\frac{1}{2}$ " lip
	2+27	2+65	2+65	2+93	CS	
Bridgewater Ct. West						

2955

Start Point: Birchwood Court East / Newport Drive East

Sidewalk Inventory

(Circle)

(Rt.)

486

2945

End Point: Newport Drive East

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

DS Driveway Cross Slope

PP Pinch Point

CS Panel Cross Slope

PZ Passing Zone

WP Width of Panel

PO Protruding Object

Inspector Name: T/w

Date: 3/31/14

Total Number of Driveways: 1

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Newport Dr. East	0+00	1+41	1+41	1+55	CS	
	1+55	2+32	2+32		VC	
	2+32	2+52	2+52		VC	
	2+52	2+73	2+73		VC	
	2+73	3+15	3+15		VC	
	3+15	3+38	3+38	3+46	CS	
	3+46	4+82	4+82	4+86	CS	
Newport Dr. East	4+86					

294-S

2935

Start Point: Newport Drive East / Claridge Dr. South (left)End Point: DEAD END

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: T/W
Date: 3/31/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 11 ⁽²⁾

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Claridge Dr. S.	0+00	1+06	1+06		VC	hole
	1+06	2+90	2+90		VC	
	2+90	3+16	3+16		VC	large gap
	3+16	4+34				
Birchwood Ct.	0+00	0+20	0+20		VC	busted up concrete
East	0+20	0+77	0+77	1+18	CS	
	1+18	1+66				
Dead End	1+66					

2935

2925a

Start Point: Newport Drive East / ~~Glendora Drive~~ South ^{Sidewalk Inventory} ~~Newport~~ DEAD END (Left)

End Point: Chridge Dr. South

pg 1 of 2

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: T/W
Date: 3/31/14

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: _____

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Glendora Dr S.	0+00	0+11				
Newport Terrace			0+00	0+11	CS	
	0+11	0+98	0+98		VC	
	0+98	2+56	2+56		VC	
	2+56	3+04				
Newport Lane	0+00		0+00	0+08	CS	
	0+08	0+22	0+22		VC	
	0+22	1+06	1+06	1+18	CS	
Berkley Lane	0+00		0+00	0+38	CS	
	0+38	0+93	0+93		VC	
	0+93	1+86	1+86	2+02	CS	
	2+02	2+18	2+18	2+30	CS	
	2+30	2+63	2+63		VC	
	2+63	2+83	2+83		VC	

2925a

Start Point: Newport Drive EAST / DEAD END (LF)
 End Point: Claridge Dr. South

292sb
pg 2 of 2

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: T/W
 Date: 3/31/14

VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object

DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

Total Number of Driveways: _____

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
	2+83	3+03	3+03	3+19	CS	
	3+19	3+50	3+50		VC	
	3+50	3+53				
Berkley Lane	0+00	0+00	0+00		VC	
	0+00	5+00				
Birchwood Ct. West	0+00	0+82	0+82	1+02	CS	
	1+02	1+53	1+53	1+82	CS	
	1+82	3+63	3+63		PO	Light Pole
	3+63	4+04	4+04		PO	Sign
	4+04	4+43	4+43		VC	
	4+43	4+45	4+45		VC	Gas Valve
	4+45	4+63	4+63		VC	
	4+63	4+74				
Claridge Dr. S	4+74					

292sb

Start Point: Bridgewater Ct. East / Claridge Drive South
 End Point: Claridge Dr South

(Circle)
(Rt.)

pg. 1 of 2
29150

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: T/W
 Date: 3/31/17

VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object

DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

Total Number of Driveways: 4 4 4 4 1

(21)

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Claridge Dr. South	0+00	1+99	1+99		VC	
	1+99	2+78	2+78	2+82	CS	
	2+82	2+90	2+90	3+27	CS	
	3+27	6+23	6+23		VC	
	6+23	6+69	6+69		DS	9521
			6+69	6+83	CS	
	6+83	7+31	7+31		VC	
	7+31	7+86	7+86		VC	
	7+86	8+12	8+12		VC	
	8+12	8+30	8+30		VC	
	8+30	10+92	10+92		VC	
	10+92	11+55	11+55	11+67	CS	
	11+67	12+61	12+61		VC	
	12+61	13+95	13+95	13+99	CS	

{ 4 of C-D-S
7+68 }

13+99 14+15 14+15 VC
 14+15 14+28 14+28 VC
~~14+28~~

2915

Sidewalk Inventory
 Start Point: Bridgewater Ct. East / Claridge Dr. S.
 End Point: Claridge Ridge Dr. S.

(Rt.)

Pg. 2 of 2
 2915b

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: T/W
 Date: 3-31-14

VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object
 DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

Total Number of Driveways: _____

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
	14+28	14+63	14+63		VC	
	14+63	14+74	14+74		VC	
	14+74	14+82	14+82		VC	
	14+82	16+01	16+01		VC	
	16+01	16+48				
Claridge Dr.	16+48					
Dr. South						

2915b

Start Point: Fleetwood Way / Bannister Court (1300)

End Point: Claridge Drive South

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: T/w

Date: 3/31/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: |||| ||| ||| |||

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Bannister Ct.			0+00	0+11	CS	Bushes 0+19 to 0+94
	0+11	1+46	1+46	1+86	CS	
	1+86	2+31	2+31		VC	
	2+31	2+56	2+56		VC	
	2+56	3+47	3+47		VC	
	3+47	4+09	4+09		DS	9730
	4+09	5+70	5+70		VC	
	5+70	6+98	6+98	7+02	CS	
	7+02	7+89	7+89		VC	
	7+89	8+74	8+74		VC	
	8+74	9+18	9+18		VC	
	9+18	12+72	12+72		VC	Gas Valve
	12+72	13+00				
Claridge Dr. South	13+00					

2905

Start Point: Fleetwood Ct. 1 Claridge Dr South

End Point: Fairbanks LA

Direction of Increasing Station: Left

left

337 2865

Reason Codes for NON-COMPLIANCE:

Inspector Name: J.T

Date: 3-31-14 Monday

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

6

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Claridge DrS.			0+00	0+04	CS	
	0+04	0+14	0+14	0+35	CS	
			0+25		DS	@9641
	0+35	0+46	0+46	0+68	CS	
	0+68	1+74	1+74	1+81	CS	
	1+81	2+35	2+35	2+56	CS	
	2+56	2+72				
	2+72	3+37				
Fairbanks LA		3+37	3+37			

2865

(Circle)

607

Start Point: Saddlebrook Ct. / Saddlebrook Lane

2795

End Point: Saddlebrook Lane

Direction of Increasing Station: Rt.

Reason Codes for NON-COMPLIANCE:

Inspector Name: JTW
Date: 3/31/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 8

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Saddlebrook Ln.	0+00	1+59	1+59	1+68	CS	
			1+68	1+68	DS	9424
			1+68	1+76	CS	
Saddlebrook LA	1+76	6+07			CS	
607						

2795

Sidewalk Inventory
Start Point: HANNOVER DR @ BALLENGER CREEK PK

278Sa

End Point: MERCANTILE DR WEST

Direction of Increasing Station: LT

Reason Codes for NON-COMPLIANCE:

Inspector Name: JASC CM

Date: 3/31/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 0

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
BALLENGER CREEK PK	0+00	0+00	0+00	0+70	CS	
	0+70	0+94	0+94	-	VC	
TARPING, TON CT	0+94	1+44	1+44	2+05	CS	
	0+00	0+04	0+04	0+20	CS	
KIRKLAND DR	0+20	1+40	1+40	1+75	CS	
	0+00	0+04	0+04	-	VC	
KEELY CT	0+04	1+99				
NEW HAVEN CT	0+00	2+87				
	0+00	0+29	0+29	-	VC	
NEW HAVEN CT	0+29	1+90	1+90	2+00	CS	
	0+00	0+00	0+00	0+30	CS	
	0+30	1+26	1+26	1+41	CS	
ALYSHA BEA DR	1+41	2+55				

20F3

Start Point: HANNOVER DR @ BAUENGER CREEK PK

278sb

End Point: MERCHANTILE DR WESTDirection of Increasing Station: LT

Reason Codes for NON-COMPLIANCE:

Inspector Name: HSC, CMDate: 3/31/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
ALY SHEBAWAY	0+00	3+01	3+01	3+37	CS	
TOWNCREST CT WEST	3+37					
	0+00	0+35	0+35		PO	TRIM TREES
	0+35	0+58	0+58	1+02	CS	
	1+02	1+02	1+02		PO	TREE LIMBS
	1+02	1+71	1+71	2+04	CS	NO PZ
	2+04	2+40	2+40	2+57	CS	
MERCHANTILE DR WEST	2+57	3+27				
MERCHANTILE DR WEST	0+00	0+17	0+17	0+33	CS	
CRISTEIDGE AT	0+33	3+93				NO PZ
	0+00	6+02				
MILL RUN PL	6+02					
	0+00	0+19	0+19	0+39	CS	
	0+39	2+51	2+51		VC	

2+51 6+39 6+39 6+55 CS

ORCHARD GROVE 6+55 11+03
ECON ENTRANCE

278sb

27850

Start Point: WISTERIA WAY @ BURNING BUSH DR

277Sa

End Point: BURNING BUSH DR

Direction of Increasing Station: LT

Reason Codes for NON-COMPLIANCE:

Inspector Name: JA SC CM

Date: 3/3/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 0

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
BURNING BUSH	0+00	2+09				NO HE RAMP
CARNATION CR	2+09					
	0+00	2+82				NO HE RAMP
ACACIA CT	2+82					
	0+00	1+86				
LARKSPUR DR	1+86					
	0+00	1+58	1+58	1+69	CS	
KATSURACT	1+69	1+94				
	0+00	1+89	1+89		PO	TRIM TREE LIMBS
FRINGTREE CT	1+89	2+30				
	0+00	0+49	0+49	0+97	CS	
	0+97	1+75	1+75		PO	TRIM TREE LIMBS
ROCKSPRAY CT	1+75	2+47	2+47		PO	" " "

277Sa

Sidewalk Inventory

27756

Direction of Increasing Station: 17

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

277sb

Start Point: WISTERIA WAY @ BURNING BUSH DREnd Point: BURNING BUSH DRDirection of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: HSE CMDate: 3/31/11

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 0

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
BURNING BUSH	0+00	0+00	0+00	0+23	CS	NO PE NO HO RAMP
	0+23	4+07	4+07	—	VC	
	4+07	4+65	4+65	—	VC	WATER VALVE BOX
CANTANA CIR	4+65	4+72	4+72	5+15	CS	NO HO RAMP
	0+00	0+00	0+00	0+13	CS	
	0+13	0+29	0+29	—	VC	
	0+29	0+45	0+45	0+81	CS	MANHOLE IN SIDEWALK
	0+81	1+34	1+34	—	VC	MANHOLE IN SIDEWALK
SWEET BAY WAY	1+34	1+65				
	0+00	0+10	0+10	0+35	CS	
	0+35	1+03	1+03	1+19	CS	
	1+19	1+52	1+52	—	PO	
	1+52	2+38	2+38	2+50	CS	NO PE
	2+50	3+25	3+25	—	VC	

SWEET BAY CT 3+25 3+73

20FZ

Start Point: W/STEDIA WAY @ BURNING BUSH DR

276sb

End Point: BURNING BUSH DR

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: JSC CM

Date: 3/31/11

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
SWEET BAY CT	0+00	0+08	0+08	—	VC	4/5/11 DENIAL
	0+08	0+16	0+16	—	VC	
PURPLE LEAF CT	0+16	2+29				NO PZ
ANDROMEDA CT	0+00	3+23				
	0+00	0+45	0+45	—	VC	
BURNING BUSH DR	0+45	0+80				

276sb

571-237-6024

1 of 3

Start Point: NEW DESIGN RD @ CORPORATEDR

2755a

End Point: ROUTE 70 BRIDGE

Direction of Increasing Station: LT

Reason Codes for NON-COMPLIANCE:

Inspector Name: JASCCM

Date: 3/31/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 0

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
CORPORATEDR	0+00	2+89	2+89	2+99	CS	5' SIDEWALKS
	2+99	3+53	3+53	3+63	CS	
	3+63	4+71	4+71	4+96	CS	
KINGSBROOK CROSSING CENTER ENTRANCE	4+96	7+21	7+21	7+30	CS	
	0+00	0+00	0+00	3+70	CS	
BACK ENTRANCE TO KINGSBROOK CROSSING	3+70	3+90	3+90	4+66	CS	
	0+00	0+00	0+00	5+53	CS	
ARBOR DR	5+53	5+79	5+79	10+29	CS	
	0+00	0+51	0+51	0+76	CS	
	0+76	2+95	2+95	3+22	CS	
	3+22	3+44	3+44	4+30	CS	
	4+30	5+02	5+02	5+13	CS	
NO NAME	5+13	6+32				
ENTRANCE						

2755a

Start Point: NEW DESIGN RD @ CORPORATE DR.

2755b

End Point: ROCK 70 BRIDGEDirection of Increasing Station: LT

Reason Codes for NON-COMPLIANCE:

Inspector Name: JH, SC CM
Date: 3/31/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
NO NAME ENTRANCE	0+00	0+07	0+07	0+86	DS	5614 5' SIDEWALK
	0+86	0+86	0+86	1+08	CS	
	1+08	2+14	2+14	2+42	CS	
	2+42	3+10	3+10	-	PO	HONEY SUCKLE
	3+10	3+36	3+36	3+61	CS	
	3+61	4+01	4+01	4+35	CS	
	4+35	5+13	5+13	6+13	CS	
CRESTWOOD BLVD	6+13	7+09	7+09	7+34	CS	
	0+00	0+00	0+00	2+08	PO	
ENTRANCE TO CRESTWOOD PARK			2+08	4+36	CS	
ENTRANCE TO CRESTWOOD PARK	0+00	0+00	0+00	1+92	CS	
FOX CROFT DR	1+92	2+14				
FOX CROFT DR	0+00	0+00	0+00	0+43	CS	4' WIDE SIDEWALK
	0+43	1+69	1+69	2+46	CS	

2755b



Sidewalk Inventory

Start Point: NEW DESIGNED @ CORPORA TE DR

275 Sc

End Point: ROUTE 70 BRIDGEDirection of Increasing Station: LT

Reason Codes for NON-COMPLIANCE:

Inspector Name: JH SC, CMDate: 3/31/11

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
	2+46	2+46	2+46	2+71	CS	4' SIDEWALK
	2+71	3+37	3+37	5+06	CS	NO PZ
	5+06	5+62	5+62		VC	
			5+68		VC	
			9+38		VC	
	9+38	10+41	10+41	11+09	CS	9+59 5' SIDEWALK
	11+09	12+92	12+92	13+19	CS	
	13+19	13+49	13+49		VC	
	13+49	15+01	15+01	15+14	CS	13+79 4' SIDEWALK
	15+14	17+16	17+16	17+32	CS	
GUILFORD DR	17+32	18+39				
	18+00	18+39	18+39		VC	
RT 70 BRIDGE	18+39	2+08				

275 Sc

2745

End Point: NORTH OF 270 WEST UNDERPASS 270 WEST

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 9

2745

1 of 3

273 Sa

Start Point: CRESTWOOD BLVD @ NEWDESIGN RDEnd Point: BARLENGER CREEK PKDirection of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: JH, CM, SC
Date: 3/31/14VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding ObjectDS Driveway Cross Slope
CS Panel Cross Slope
WP Width of PanelTotal Number of Driveways: 0

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
NEWDESIGN	0+00	0+00	0+00	0+36	CS	5' SIDEWALK
	0+36	2+12	2+12	2+24	CS	
ENTRANCE TO CRESTWOOD PLAZA	2+24					
	0+00	0+00	0+00	0+14	CS	
BURNING BUSH DRIVE	0+14	3+76				
	0+00	5+13	5+13	5+34	CS	4' SIDEWALK @ 4+82
	5+34	5+74	5+74	5+90	CS	
	5+90	6+82	6+82	-	VC	NO PZ -
	6+82	8+11	8+11	-	VC	
	8+11	8+23	8+23	-	VC	
BURNING BUSH DRIVE	8+23	8+68				
RAMP	0+00	6+20				
RAMP =	0+00	1+17	1+17	1+43	CS	
	1+43	6+04	6+04		VC	

273 S

2053

2735b

Sidewalk Inventory

Start Point: CRESTWOOD BLVD @ NORTHERN RD

End Point: BALLENGEE CREEK PK

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: JH, CM, SC

Date: 3/31/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
HOBBS BLVD	6+04	6+36	6+36	7+89	CS	NO PZ 4' SIDEWALK
	0+00	0+92	0+92	1+43	CS	
	1+43	2+67	2+67	-	VC	
	2+67	3+09	3+09	3+41	CS	
	3+41	4+79	4+79	-	VC	
	4+79	4+99	4+99	-	VC	
	4+99	5+43	5+43	-	VC	
	5+43	6+85	6+85	7+16	CS	
ROSEBAY DR	7+16	7+28				
	0+00	0+00	0+00	-	VC	
	0+00	0+10	0+10	-	VC	
	0+10	0+19	0+19	-	VC	
	0+19	1+31	1+31	-	VC	
	1+31	1+45	1+45	-	PO	

2735b

Sidewalk Inventory

Start Point: CRESTWOOD BLVD @ NEW DESIGN RD

273Sc

End Point: BALLANTRAE CREEK PIKEDirection of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: JH CM SCDate: 3/31/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
	1+45	2+21	2+21	2+45	CS	NO PR 4' SIDEWALK
	2+45	2+71	2+71	-	VC	
	2+71	2+99	2+99		VC	
	2+99	3+20	3+20	3+59	CS	5' SIDEWALK
EDENTON CT	3+59	7+79				
ENTRANCE TO SHOPPING CT	0+00	0+00	0+00	2+04	CS	
ENTRANCE TO SHOPPING CT						
	0+00	1+54	1+54	1+69	CS	
	1+69	2+42	2+42	2+49	CS	
	2+49	2+69	2+69	-	VC	
BALLANTRAE CREEK PIKE	2+69	2+75				

Start Point: EDENTON CT @ CRESTWOOD BLVD

2715

End Point: ENTRANCE TO EDENTON RETIREMENT COMMUNITY ENDS

Direction of Increasing Station: *KT*



Reason Codes for NON-COMPLIANCE:

Inspector Name: JH CM, SC
Date: 3/21/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 0

Compliant

Non-Compliant

Street Name: _____

From

To

From

To

Code

Comments

[illegible]

2715

Start Point: Fleetwood Way / Claridge Dr. South (RT.)
 End Point: Bannister Drive

2895

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: T/W
 Date: 3/31/14

VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object

DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

Total Number of Driveways: HHH HHH HHH (B)

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Claridge Dr. South	0+00	1+57	1+57	1+65	CS	
	1+65					
Kingston Place	0+00	4+34	4+34		VC	
	4+34	4+51	4+51		VC	
	4+51	4+75	4+75		VC	
	4+75	5+20	5+20		VC	
	5+20	5+98	5+98		VC	
	5+98	6+90	6+90	6+98	CS	
Oakley Terrace	0+60	0+64	0+64	0+79	CS	
	0+79	1+69	1+69		VC	
	1+69	2+85	2+85		VC	
	2+85	3+05				
Bannister Dr.	3+05					

2895

Start Point: Kingston Place / Fleetwood Way (Rt.)

End Point: _____

Direction of Increasing Station: Rt

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Inspector Name: T/W

Date: 3/31/14

Total Number of Driveways: |||||

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Fleetwood Way			0+00	0+16	CS	
	0+16	1+60	1+60		VC	
	1+60	2+63	2+63		DS	9539
			2+63	2+73	CS	
	2+73	5+30	5+30		VC	
	5+30	5+69	5+69		VC	
	5+69	7+78	7+78		VC	
	7+78	8+79	8+79		VC	
	8+79	8+99	8+99		VC	
	8+99	9+68	9+68		VC	
	9+68	10+58	10+58	10+80	CS	
			10+80		DS	9536
			10+80	10+85	CS	
	10+85	12+10	12+10	12+59	CS	
	12+59	13+16	13+16	13+20	CS	
Fleetwood Way	13+20					

(25)

288-5

Start Point:

Saddlebrook Lane / Claridge Dr. North

Sidewalk Inventory

(Rt.)

99/062

12+45

2855a

End Point:

Bannister Drive

Direction of Increasing Station:

Rt

Inspector Name:

T/W

Date:

3/31/14

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

111 111 111

13

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Claridge Dr. N.	0+00	1+63	1+63		VC	
	1+63	2+03	2+03	2+07	CS	
	2+07	3+96	3+96		VC	
	3+96	4+09	4+09	4+17	CS	
	4+17	4+49	4+49	4+57	CS	
	4+57	4+69	4+69		VC	
	4+69	5+36	5+36		VC	
	5+36	6+26	6+26	6+50	CS	
			6+50		DS	6463
	6+50	6+59	6+59		VC	M/H
	6+59	6+88	6+88		VC	w/v
	6+88	7+51	7+51		VC	
	7+51	7+70	7+70		VC	
	7+70	8+50	8+50	8+58	CS	

8+58

DS

8+58

8+82

8+82

8+93

CS

2855a

285sb

Start Point: Saddlebrook Lane / Bridge Drive N.

Sidewalk Inventory

End Point: Bannister Drive

Direction of Increasing Station: _____

Inspector Name: T/WDate: 3/31/14

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: ~~1~~

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
	8+93	10+11	10+11		VC	
	10+11	10+55	10+55		VC	
	10+55	10+90	10+90		VC	
	10+90	11+11	11+11		VC	
	11+11	11+60	11+60		VC	
	11+60	12+45				
Bannister Drive	12+45					

285sb

282

2845

Start Point: Bannister Drive / Saddlebrook Ln. (Rt.) 630

End Point: Fleetwood Way

2825

Direction of Increasing Station: Rt

Reason Codes for NON-COMPLIANCE:

Inspector Name: T/W
Date: 3/31/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: |||| 6

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Saddlebrook Ln.	0+00	1+97				
Chridge Dr. N.	0+00	1+56	1+56		VC	
	1+56	1+76	1+76		VC	
	1+76	4+22	4+22		VC	
	4+22	5+11	5+11		PO	tree
	5+11	5+41	5+41		DS	6358
			5+41	5+52	CS	
Fleetwood Way	5+52	6+30				
↓	6+30					

282-S

Start Point: Bannister Drive / Fleetwood Way (Rt.) 974
 End Point: Saddlebrook Lane 2815

Direction of Increasing Station: Rt

Inspector Name: T/w
 Date: 3/31/14

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object

DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

Total Number of Driveways: 12 11

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Fleetwood Way			0+00	0+40	CS	
	0+40	1+04	1+04		VC	
	1+04	1+14	1+14		VC	
	1+14	2+43	2+43		VC	
	2+43	3+63	3+63		DS	6359
			3+63	4+62	CS	
	4+62	5+16	5+16		VC	
	5+16	5+90	5+90		VC	
	5+90	6+04	6+04		VC	gas valve
	6+04	6+64	6+64	6+68	CS	
	6+68	7+62	7+62		DS	6349
	7+62		7+62	7+83	CS	
	7+83	9+54	9+54		VC	
	9+54	9+74				

Saddlebrook Lane 9+74

2815

(Circle) Right

Start Point: Saddlebrook Pl / Claridge Dr North

412

End Point: Claridge Dr N

2805

Direction of Increasing Station: Right

Reason Codes for NON-COMPLIANCE:

Inspector Name: TJW
Date: 3-31-14 Mon

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 3

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Claridge Dr N	0+00	2+27	2+27	2+27	VC	7 1/2"
	2+27	4+12				
" "	4+12					

2805

Sidewalk Inventory

R

2705a

Start Point: New Design @ Corporate

End Point: _____

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: DZ, KA, CB
Date: 3/31/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 0

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Corporate	0+00	1+19	1+19	3+15	CS	
	3+15	4+54	4+54	4+54	VC	
	4+54	4+60	4+60	_____	VC	
	4+60	5+16	5+16	6+15	CS	
	6+15	7+81	7+81	7+92	CS	
			7+92	7+92	VC	
	7+92	8+01				
Kingsbrook Cr. Rd.	0+00	1+33	1+33	1+97	CS	
	1+97	4+37	4+37	4+52	CS	
	4+52	5+08	5+08	5+12	CS	
Westview Station	0+00	3+20	3+20	3+30	CS	
	3+30	3+71	3+71		VC	
	3+71	4+68	4+68	4+74	CS	

2705a

2705b

Sidewalk Inventory

Start Point: New Design @ Corporate

End Point: _____

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: D. LA. CODate: 3/31/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 1

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Westview Station	4+74	4+94	4+94	_____	VC	
	4+94	4+94	4+94	5+31	CS	
	5+31	5+75	5+75	6+73	CS	
	6+73	7+87	7+87	7+97	CS	
	7+97	8+32	8+32	8+93	CS	
	8+93	10+59	10+59	_____	PO	tree
	10+59	11+08	11+08	11+70	CS	end
Ladd Ln.	0+00	0+24	0+24	5+05	CS	
	5+05	6+01	6+01	6+55	CS	
	6+83	6+83	6+83	_____	DS	5665
	6+83	8+90	8+90	_____	PO	tree
	8+90	11+23	11+23	11+37	CS	
	11+37	12+13	12+13	_____	VC	
	12+13	12+57	12+57	12+62	CS	

2705b

End Point: Crestwood Blvd

Reason Codes for NON-COMPLIANCE:

WP Width of Panel

Total Number of Driveways:

27050

2645

Sidewalk Inventory

Start Point: Foxcroft Drive @ New Design - Right

End Point: Burning Bush Dr.

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: D2 VACB
Date: 3/31/14VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding ObjectDS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 0

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
New Design	0+00	0+00	0+00	0+22	CS	
	0+22	0+38	0+38	0+59	CS	
	0+59	0+95				end
entrance of Crestwood Middle School	0+00	1+18				end
entrance 2	0+00	0+00	0+00	0+09	CS	
	0+09	0+96	0+96	—	VC	
	0+96	2+33	2+33	2+33	VC	
	2+33	2+38	2+38	—		end
entrance 3	0+00	0+72	0+72	0+84	CS	
	0+84	1+92				end @ Burning Bush Dr.

2695

Sidewalk Inventory

Start Point: Crestwood Blvd @ New Design

- Left

2685

End Point: Crabapple Dr

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: GZ/KALCB
Date: 3/31/2011

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 0

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
New Design	0+00	0+00	0+00	0+11	CS	
	0+11	2+17	2+17	—	VC	
	2+17	2+62	2+62	—	VC	
	2+62	7+04				
Tamarack Ave	0+00	2+01	2+01	—	PO	Tree
	2+01	6+62	6+62	6+82	VC	
	6+82	9+23				End @ Crabapple Dr.

2685

2675a

Sidewalk Inventory

Start Point: Hannover Dr. @ Ballenger Creek Pike - Right

End Point: _____

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: SL KA CB
Date: 3/31/14

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 0

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Ballenger Creek Pike</u>	<u>0+00</u>	<u>2+16</u>				
<u>Denton Ct.</u>	<u>0+00</u>	<u>1+82</u>				
<u>Kirkland Dr.</u>	<u>0+00</u>	<u>1+96</u>				
<u>Kara Cir.</u>	<u>0+00</u>	<u>2+66</u>	<u>2+66</u>	<u>2+71</u>	<u>CS</u>	
<u>Devonshire Ln</u>	<u>0+00</u>	<u>0+03</u>	<u>0+03</u>	<u>0+03</u>	<u>CS</u>	
	<u>0+03</u>	<u>4+79</u>	<u>4+79</u>	<u>4+88</u>	<u>CS</u>	
<u>Hastings Ct.</u>	<u>0+00</u>	<u>3+00</u>				
<u>Towncrest Ct.</u>	<u>0+00</u>	<u>5+49</u>				
<u>Viewpoint Ct.</u>	<u>0+00</u>	<u>2+22</u>	<u>2+22</u>	<u>-</u>	<u>VC</u>	
	<u>2+22</u>	<u>4+43</u>	<u>4+43</u>	<u>-</u>	<u>VC</u>	
	<u>4+43</u>	<u>4+95</u>				
<u>Kirkland Dr.</u>	<u>0+00</u>	<u>0+04</u>	<u>0+04</u>	<u>0+04</u>	<u>CS</u>	
	<u>0+04</u>	<u>2+02</u>				
<u>Rockledge Ct.</u>	<u>0+00</u>	<u>0+34</u>	<u>0+34</u>	<u>-</u>	<u>VC</u>	

2675a

Sidewalk Inventory

Sidewalk Inventory

Start Point: Hannover Dr @ Boulenger Creek Pike - Right

End Point: Crestwood Blvd

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: 07, Y.A. CB

Date: 3/31/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 0

[illegible]

266-

Sidewalk Inventory

Start Point: Foxcroft Dr @ New Design - Left

End Point: Burning Bush Dr.

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: OZ KA, CB
Date: 5/31/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 0

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
New Design	0+00	0+65	0+65	1+09	CS	
Shopping Ctr	0+00	0+18	0+18	0+50	CS	
	0+50	1+22	1+22	1+34	CS	
	1+34	1+70	1+70	2+35	CS	
	2+35	2+40				
Ent 2	0+00	0+19	0+19	0+19	CS	
	0+19	0+35	0+35	0+55	CS	
	0+55	1+07	1+07	1+96	CS	
	1+96	3+21	3+21	3+41	CS	
	3+41	3+61	3+61	3+73	CS	
	3+73	4+39				End

266S

Sidewalk Inventory

 Start Point: Burning Bush @ Crestwood Blvd - Right

 End Point: Crestwood Blvd.

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

 Inspector Name: DLKA, CB
 Date: 3/31/14

 VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object

 DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

 Total Number of Driveways: 0

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Crestwood Blvd	0+00	2+57				
Hlex Court	0+00	1+11				
5811 Ent 1	0+00	0+74				
5811 Ent 2	0+00	1+15				
Turnberry Ct	0+00	2+78	2+78	2+78	VC	
	2+78	8+72				
Foxcroft Dr	0+00	0+53	0+53	0+53	PO	Tree
	0+53	3+40	3+40	3+40	PO	Tree
	3+40	4+57				
Trailview Ct	0+00	2+65	2+65	—	VC	
	2+65	2+78	2+78	—	VC	End

 Bridging
 ENTERED

7

DR

1+22

2

2645

Sidewalk Inventory

Start Point: Manal Borough Turn / Hillsborough

R+ (CP)

End Point: Manal Borough

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: _____
Date: _____

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: TH 1 (6)

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Hillsborough.	0+00	2+43 43	186		VC	greater than 1/2"
CP Manal Box	6451		0+5		VC	
CP Manal Box ⁶⁴⁵¹	6451					
	0+00	2+45	0+5		VC	" " 1/2"
			0+46		VC	" " " "
			0+64		VC	" " " 1/2 inch
			1+41		VC	" " " " "
			2+45		VC	" " " " " Ramp
Hillsboro Dr.						

2645

2635

111 (3)

2635

Sidewalk Inventory

Start Point: Brambleton way / Remington Ct. Rt. 345

End Point: Hillsborough Dr. 2625

Inspector Name: TS
Date: 3/23/14

Total Number of Driveways: 1

262-S

9A

Start Point: Bannington Dr. / Spring Forest Rd.

Sidewalk Inventory

End Point: Hillsborough Dr.Direction of Increasing Station: Left

2615

Inspector Name: J.T.
Date: 3/28/14

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding ObjectDS Driveway Cross Slope
CS Panel Cross Slope
WP Width of PanelTotal Number of Driveways: 12

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Spring Forest Rd	0+00	10+23	0+19		VC	Gas meter/valve
			2+78		VC	greater than 1/2" Lip.
			3+59		VC	" " " "
			4+45		VC	" " " "
			5+45		VC	" " " "
			5+62		VC	" " " "
			7+54		VC	" " " "
			8+21		VC	open joint more than 1"
			8+40		VC	greater than 1/2" Lip.
			10+23	10+44	DS	Entire Driveway 4% >
	10+44	12+44	12+44	12+52	CS	
	12+52	12+64				
Hillsborough Dr.						

2615

4446

End of 9th

10

Start Point: Dressen Pl. / Saddle Brook Lane

Sidewalk Inventory

2605

End Point: End of sidewalk.

Direction of Increasing Station: Right.

Reason Codes for NON-COMPLIANCE:

Inspector Name: TS

Date: 3/28/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 111

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Saddle Brook Ln			0+00	0+54	CS	
	0+54	1+51	1+51	1+74		
			1+61	1+74	DS	6433
	1+74	2+04	2+04	2+11	CS	
	2+11	2+47	2+47	3+12	CS	
	3+12		3+33	4+46	VC	greater than 1/2" dip
End of sidewalk					CS	

2605

2595

2595

13

CP 9408.

Start Point: Inglewood Ct / Hillsborough Ter.

394

2585

End Point:

403

Direction of Increasing Station:

R+

797

Reason Codes for NON-COMPLIANCE:

Inspector Name: TJDate: 3/28/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

9

11111111

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Hillsborough Ter	0+00	3+94	3+67		VC	greater than 1/2" lip.
			3+79		VC	" " " "
M B. 9408						
MB 9408.	0+00	4+03				

2585

12A

Start Point: Corrnt Hills Ct. / Hillsborough Dr.
 End Point: Hillsborough Dr.

Sidewalk Inventory

CP
mail

7+59

2575

RT

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: _____
 Date: _____

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

111 (18)

~~THX~~ ~~THX~~ THX

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Hillsboro Dr.						
Mailboxes 6474b						Greater than a
6476 CP	0+00	6+14	2+21		VC	1/2 Lip a sidewalks
			2+49		VC	" " " "
			2+80		VC	" " " "
			3+00		VC	" " " "
			3+29		VC	" " " "
			4+29		VC	" " " "
			4+47		VC	" " " "
			4+89		VC	" " " "
			5+23		VC	greater than 1/2" Lip
			5+42		VC	" " " "
			6+14	6+22	CS	
	6+22	7+59	6+42		VC	MAN hole

Hillsborough Dr. circle.
 7+59

2575

12

Start Point: Forest Hills Ct / Hillsborough Dr

Sidewalk Inventory

Can to Point Nri 1
circle
6474 to 6476

End Point:

2565

7428

Direction of Increasing Station:

Rt

Inspector Name:

T: J

Date:

3/28/14

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 111

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Hillsborough Dr.	0+00	4+86	1+52		VC	greater than 1/2" Lip
			3+87		VC	" " " "
			4+43		VC	" " " "
			4+86	5+01	DS	
	5+01	6+70	5+17		VC	" " " "
			5+60		VC	MAN hole
			5+77		VC	greater than 1/2" Lip
			5+82		VC	" " " "
			6+70		VC	" " " "
			6+70	6+91	CS	
	6+91	7+28				
6474 to 6476	CP					

2565

11

Sidewalk Inventory

Start Point: Banning Ln cto / Hillsborough Dr RT

3471
4480
851

2555

End Point: Hillsborough Dr Circle Center Point

Direction of Increasing Station: RT

Mailboxes 9361/9356

Reason Codes for NON-COMPLIANCE:

Inspector Name: _____
Date: _____

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways:

HH 1111 (9)

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Hillsborough	0+00	2+28	1+46		VC	Greater than 1/2" Lip
			2+28	2+32	CS	
	2+32	3+89	3+71		VC	" " "
CP	Mailbox	9361/9356				
9361/9356	0+00	2+18	0+76		VC	MAN hole
			2+18		DS	9355
			2+18	2+26	CS	
	2+26	2+52	2+52	2+56	CS	
	2+56	4+30	2+69		VC	MAN hole
			3+62		VC	< 1/2" Lip -
			3+70		VC	" "
			4+28		VC	MAN hole
Hillsborough Dr	4+30					

2555

(1)

Sidewalk Inventory

254Sa

Start Point: New Design Rd @ 4959 (Porterline)End Point: Corporate Dr @ 5099Direction of Increasing Station: right

Reason Codes for NON-COMPLIANCE:

Inspector Name: CM SCDate: 3/28/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 2

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Parts Place</u> New Design Rd	0+00	0+33	0+33	0+33	VC	
	0+33	2+14	2+14	2+24	CS	
	2+24	5+29	end			Wedgehead Rd
<u>Wedgehead Rd</u>	0+00	4+29	4+29	4+29	DS	4931
	4+29	5+00	end			across from Robin Drive E
<u>across from Robin Drive E</u>	0+00	2+30	2+30	2+60	CS	
	2+60	8+17	8+17	8+33	CS	695
<u>Exposition Way</u>			0+00	0+10	CS	near 695
	0+10	1+30	1+30	1+48	CS	
	1+48	1+93	1+93	2+27	CS	
	2+27	3+50	3+50	3+50	DS	(open field)
	3+50	4+29	4+29	4+67	CS	
	4+67	5+90	5+90	6+27	CS	
	6+27	8+74	8+74	9+48	CS	

254a

Sidewalk Inventory

Start Point: Wm. Dwyer Rd @ 4959

End Point: Corporate Drive 5099

Direction of Increasing Station: North

Reason Codes for NON-COMPLIANCE:

Inspector Name: CM SC
Date: 3/28/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 4

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
	9+48	10+16	10+16	10+36	CS	open area
			10+36	13+67	CS	5203
	13+67	14+03	14+03	14+03	DS	near 5203
	14+03	14+54	14+54	15+03	CS	
	15+03	15+64	15+64	15+64	DS	5217
	15+64	17+17	17+17	17+17	DS	"
	17+17	17+81	17+81	18+15	CS	5229
	18+15	18+52	18+52	18+52	DS	"
	18+52	20+19	20+19	21+19	CS	before bridge
	21+19	23+56	23+56	23+56	VC	
	23+56	23+76	23+76	24+11	CS	
	24+11	24+56	24+56	24+56	CS	
	24+56	26+15	end @	Corporate Drive (5099)		

254sb

Sidewalk Inventory

26

Start Point: Fellingwood CT @ Fellingwood Dr

End Point: Fellingwood Dr

Direction of Increasing Station: UD

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF 302
Date: 3-23-14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel



Total Number of Driveways: 7

Street Name: <u>Fellingwood CT</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Fellingwood Dr</u>	<u>0+00</u>	<u>1+00</u>	<u>1+00</u>	<u>—</u>	<u>VC</u>	
	<u>1+00</u>	<u>1+97</u>	<u>1+97</u>	<u>—</u>	<u>DS</u>	<u>0.595</u>
	<u>1+97</u>	<u>2+56</u>	<u>2+56</u>	<u>—</u>	<u>VC</u>	
	<u>2+56</u>	<u>3+32</u>	<u>3+32</u>	<u>—</u>	<u>VC</u>	
	<u>2+32</u>	<u>4+85</u>	<u>4+85</u>	<u>—</u>	<u>VC</u>	<u>END @ Fellingwood Dr</u>

2535

2525

Sidewalk Inventory

Start Point: Fellingwood Dr @ Crestwood Blvd

End Point: Farmbrook Dr

Direction of Increasing Station: 118

Reason Codes for NON-COMPLIANCE:

Inspector Name: RS302
Date: 3-28-14

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 1

Street Name: <u>Fellingwood Dr</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Crestwood Blvd	0+00	1+24				
Whetstone Dr	0+00	0+19	0+19	0+31	CS	
	0+31	2+37				No Dr
Fellingwood Dr	0+20	0+17	0+17		VC	
	0+17	1+68	1+68	1+88	CS	-
	1+88	2+08	2+08	2+21	CS	No Dr
	2+21	2+50				
Whetstone Dr	0+00	1+11				END @ Farmbrook Dr
Crestwood Blvd	0+00	0+15	0+15		VC	
	0+15	0+39	0+39		VC	
	0+39	1+39				END @ Spokesville CT

2525

2515

Sidewalk Inventory

Start Point: Whetstone Dr @ Fellingwood DrEnd Point: Fellingwood DrDirection of Increasing Station: 110

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF 302

Date: _____

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 17

Street Name: <u>Whetstone Dr</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Fellingwood Dr: R	0+00	2+36	2+36	2+46	CS	
Fellingwood	2+46	3+13	3+13	—	VC	
	3+13	3+25	3+25	—	VC	
	3+25	3+30	3+30	3+38	CS	
	3+38	3+62	3+62	—	DS	6590
	3+62	4+42	4+42	—	VC	
	4+42	4+50	4+50	—	DS	6586
	4+50	5+60	5+60	—	PO	Bush row
	5+60	7+62	7+62	—	VC	
	7+62	8+22	8+22	—	VC	
	8+22	8+73	8+73	—	DS	6572
	8+73	9+97	9+97	—	VC	
	9+97	10+17	10+17	—	VC	
	10+17	10+54	10+54	—	PP	Storm Drain Invert

10+54

12+31

12+31

12+47

CS

12+47

12+55

END @ Fellingwood Dr

2515

Sidewalk Inventory

Start Point: New Design Rd @ English Muffin Way

End Point: Corporate Dr

Direction of Increasing Station: 112

10-2
2505a

Reason Codes for NON-COMPLIANCE:

Inspector Name: TF 302
Date: 3-28-14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 7

Street Name: <u>New Design Rd</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
English Muffin Way	0+00	0+65	0+05	1+05	CS	
	1+05	1+45	1+48	2+35	CS	
	2+35	4+52	4+52	4+67	CS	
	4+67	6+44	6+44	6+83	CS	
	6+83	13+46	13+46	13+74	CS	
	13+74	15+37	15+37	15+90	CS	
Robin Dr W			0+00	0+90	CS	
			0+30	—	VC	
			0+40	—	VC	
	0+90	2+10	2+10	3+30	CS	
	3+30	6+50	6+50	8+70	CS	
	8+70	11+20	11+20	11+20	CS	
	11+20	14+35				
Robin Dr E			0+00	0+71	CS	

2505a

Sidewalk Inventory

2
250sb

Start Point: New Design Rd @ English Muffin Dr

End Point: Corporate Dr

Direction of Increasing Station: UP

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Inspector Name: BF30Z
Date: 3-28-14

Total Number of Driveways:

Street Name: <u>New Design Rd</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
	0+71	14+50	14+50	24+70	CS	
	24+70	13+10	13+10	13+95	CS	
	13+95	16+60	16+60	17+41	CS	
	17+41	24+97	24+97	25+52	CS	Ramp to Neighbor 11%+
	25+52	27+10	27+10	29+53	CS	
	29+53	30+33	30+33		VC	@ Bridge
	30+33	30+53	30+53		CS	
	31+75	32+68	32+68		VC	
	32+68	33+71	33+71	33+76	CS	
	33+76	34+11	34+11	34+70	CS	
	34+70	34+95				IMP @ Corporate Dr

250sb

Start Point: Knollwood Dr/ Danville Court (Rt.)

End Point: Spring Ridge Pkwy BRIAR CLIFF LA. EAST

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: JOYT
Date: 3/28

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 3

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Danville Court	0400	2+18	2+18	2+18	VC	GREATER THAN 1/2"
	2+18	2+31	2+31	2+31	DS	@ 6324
	2+31	2+57	2+57	2+69	CS	
	2+69	3+15	3+15	3+43	CS	
BRIARCLIFF LA. 3+43						
BRIARCLIFF LA. 3+43						
2+18 2+18						

Start Point: KNOLLWOOD CT / BRIARCLIFF LN

Sidewalk Inventory

End Point: See Sheet 2. Spring Ridge Parkway

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: JH JTS DF

Date: 3/28/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 12

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
BRIARCLIFF LN	0+00	0+00	0+00	0+25	CS	
	0+25	0+79	0+79		DS	6318
	0+79	0+79	0+79	1+04	CS	PO @ 0+92 Trim Tree Note
	1+04	2+23	2+23		DS	6312 No PZ
	2+23	2+55	2+55	3+36	CS	
	3+36	3+36	3+36		DS	6310
			3+36	4+04	DS CS	
			4+04		DS	6308
			4+04	4+33	CS	
	4+33	4+33	4+33	4+72	CS	
			4+72		DS	6306
	4+72		4+72	4+84	CS	
	4+84	5+03	5+03	5+25	CS	
	5+25	5+45	5+45		DS	6304

2485a

2072

2485b

Sidewalk Inventory

Start Point: KNOLLWOOD DR / BRIARCLIFF LA

End Point: Spring Ridge Pkway

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: _____

Date: 3/28/12

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 12

SPRING RIDGE Pkwy
BRIARCLIFF

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Corki Dr			5445		DS	on last sheet
Brimfield Ln			5445	5454	CS	
	5454	5472	5472	6416	CS	
			6416	6416	DS	6302
BRIARCLIFF RD			6416	6475	CS	
	0400	0400	0400	1489	CS	
	1489	2434	2434		PO	TREE TRIM
SPRINGWOOD PARKWAY	2434	2441				

2485b

Sidewalk Inventory

3

2475

Start Point: KNOLLWOOD DR / SPAIN RIDGE PARKWAY

End Point: BRADFORD WAY

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: TSJH STDF
Date: 3/28/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 5

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
SPAIN WOOD PARKWAY	0+68	0+00	0+00	0+70	CS	
	0+70	1+01	1+01			MANHOLE
	1+01	1+37	1+37		VC	ASPHALT TO CONC
	1+37	1+53	1+53	1+68	CS	
	1+68	4+67	4+67		VC	
BRADFORD WAY	4+67	5+89				
	0+00					

2475

Start Point: BRIARCLIFF LA @ KNOLLWOOD DR

End Point: _____

Direction of Increasing Station: LF

Reason Codes for NON-COMPLIANCE:

Inspector Name: DE JTT SJH

Date: 3/28/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 0

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
KNOLLWOOD DR	0+00	0+08	0+08	0+08	CS	
	0+08	0+68	0+68	1+21	CS	
	1+21	1+41	1+41		VC	MONITOR IN SIDEWALK
NO NAME	1+41	1+77	1+77	2+53	CS	ENTRANCE TO TOWNHOUSE @ 8818
NO NAME	0+00	0+87	0+87		VC	
	0+87	0+95	0+95		VC	
NO NAME	0+95	1+63	1+63	2+12	CS	ENTRANCE TO TOWNHOUSE @ 8842
NO NAME	0+00	0+00	0+00	0+17	CS	
	0+17	0+45	0+45		VC	
	0+45	0+65	0+65	0+93	CS	
	0+93	1+01				HC RAMP
CLIFFSIDE TERR		0+00	0+00	0+28	CS	

12465a

Sidewalk Inventory

Start Point: BRIARCLIFF LA @ KNOLLWOOD

End Point: KNOLLWOOD DR

Direction of Increasing Station: LT

4

20FZ

2465b

Reason Codes for NON-COMPLIANCE:

Inspector Name: DFJH JTS

Date: 3/28/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 6

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
CLIFFSIDE TERR	3+20	3+38	0+28		VC	
BRIARCLIFF LA	0+28	0+35				
BRIARCLIFF LA	0+00	0+38				
BRIARCLIFF WAY	0+38	0+38				
BRIARCLIFF	0+00	0+08	0+08	0+21	CS	
RAMPWAY	0+21	0+35				
RAMP	0+00	0+00	0+00	0+71	CS	
NO NAME RUTLANDIC6	0+71	1+01				ENTRANCE @ 8815 TOWNS
NO NAME	0+00	0+47	0+47	0+80	CS	
	0+80	0+96	0+96	1+58	CS	
	1+58	1+83	1+83		VC	
	1+83	2+19	2+19	2+35	CS	Did not calculate in Excel
	2+35	2+51	2+51	3+77	CS	PO 3+68 TRIM BUSHES 3+98
KNOLLWOOD DR	3+77	3+98	3+98	4+74	CS	

2465b1

2319

10F1

8

Start Point: BARRINGTON DR @ SPRING FOREST RD

2455

End Point: HILLSBOROUGH DR / HILLSBOROUGH TERR.

Direction of Increasing Station: R+

Reason Codes for NON-COMPLIANCE:

Inspector Name: DF JH
Date: 3/28/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 9

Street Name: Spring Forest Rd	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
SPRING FOREST RD	0+00	1+03	1+03	—	DS	@ 6405
	1+03	1+66	1+66	—	PO	TRIM TREES
	1+66	1+66	1+66	1+86	CS	
CARMICHAEL CT	1+86	2+61				
CARMICHAEL CT	0+00	0+25	0+25	0+53	CS	
	0+53	0+70	0+70	0+98	CS	
	0+98	1+46	1+46	—	VC	
	1+46	2+58	2+58	—	VC	
	2+58	2+98	2+98	—	VC	
	2+98	4+32	4+32	—	VC	
	4+32	4+44	4+44	—	VC	
	4+44	5+30	5+30	5+39	CS	
	5+39	6+33	6+33	—	VC	MANHOLE IN SIDEWALK
	6+33	8+31	8+31	8+51	CS	

HILLSBOROUGH DR & TERR 8+51 10+46

2455

9

Carmichael

Sidewalk Inventory

10FZ

Start Point:

~~CARMICHAEL~~ CT / Bannington Dr

2445a

End Point:

Bannington Dr

Direction of Increasing Station:

R+

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Inspector Name:

DF JH

Date:

Total Number of Driveways: 15

Street Name:

Bannington Dr

Compliant

Non-Compliant

From	To	From	To	Code	Comments
CARMICHAEL	0+00	0+61	0+61	DS	9401
	0+61	1+67	1+67	VC	
	1+67	2+58	2+58	VC	
	2+58	3+27	3+27	VC	
	3+27	3+35	3+35	VC	
	3+35	3+80	3+80	VC	
	3+80	4+82	4+82	VC	
	4+82	6+12	6+12	DS	9417
	6+12	6+12	6+12	CS	
	6+40	6+84	7+19	DS	9410
	7+19	7+48	7+48	CS	
	7+48	9+14	9+14	VC	
	9+14	9+38	9+38	VC	
	9+38	9+93	10+03	DS	9402

10+03 10+13 10+13 10+29 CS
10+29 11+27 11+27 - VC

2445a

2052

9

Sidewalk Inventory

Start Point: BARRINGTON DR @ CLARMICHAEL

244SB

End Point: BARRINGTON DR

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: DF JH
Date: 3/28/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 15

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
	11+27	11+67	11+67	11+87	CS	
	11+87	12+19	12+19	-	VC	
BARRINGTON DR	12+19	12+27	12+27	12+73	CS	

244SB

4775 CF

10K5

Sidewalk Inventory

Start Point:

HILLSBOROUGH TRL @ SPRINGFOREST RD

2435a

End Point:

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name:

JADF

Date:

3/23/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 42

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
SPRINGFOREST RD: RT	0+00	0+08	0+08	0+48	CS	✓
		0+48	0+48	0+48	DS	9300
	0+48	0+48	0+48	0+78	CS	✓
	0+78	0+89	0+89	0+98	CS	✓
	0+98	1+97	1+97	—	PO	TRIM TREE
	1+97	2+40	2+40	2+51	CS	✓
	2+51	3+15	3+15	—	VC	✓
	3+15	3+60	3+60	—	VC	✓
	3+60	4+12	4+12	—	VC	✓
	4+12	5+18	5+18	—	VC	✓
	5+18	5+52	5+52	—	VC	✓
	5+52	7+24	7+24	—	VC	✓
	7+24	7+90	7+90	—	VC	✓
	7+90	8+05	8+05	—	DS	9318

Entered
3/31/14
Bcv

2435A

207-5

243sb

Sidewalk Inventory

Start Point: HILLSBOROUGH DR @ SPRING FOREST RD

End Point: _____

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: DF JH
Date: 3/28/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: _____

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
	8+05	8+05	8+05	8+15	CS	0
	8+15	8+46	8+46	-	VC	
	8+46	9+26	9+26	-	VC	
	9+26	11+33	11+33	-	VC	
BARRINGTON DR	11+33	11+84				
BARRINGTON DR	0+00	0+18	0+18	-	VC	GAS VALVE BOX
	0+18	1+42	1+42	-	VC	
	1+42	1+54	1+54	-	VC	
	1+54	2+72	2+72	-	VC	
	2+72	3+33	3+33	-	VC	
	3+33	4+03	4+03	-	VC	BUS STOP MAIL BOX TRIM
	4+03	4+15	4+15	-	VC	
	4+15	4+24	4+24	-	VC	
	4+24	6+24	6+24	6+43	CS	

243sb

34F3

Sidewalk Inventory

Start Point: HULSBOROUGH DE @ SPRING FOREST RT

2435C

End Point: _____

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: DF SH
Date: 3/28/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: _____

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
	6+43	7417	7417	—	VC	
HULSBOROUGH TREE	7417	8419				
HULSBOROUGH	0400	2473				
INGLENWOOD CT TREE	2473					
INGLENWOOD CT	0400	0472	0472	—	VC	
	0472	0486	0486	—	VC	
	0486	2412	2412	—	VC	
	2412	2477	2477	—	PO	TREE TRIM
	2477	5419	5419	—	VC	
	5419	5432	5432	—	PO	TREE TRIM
	5432	6423	6423	—	VC	
	6423	6435	6435	—	VC	
	6435	6464	6464	—	VC	
HULSBOROUGH PR	6464	7470				

2435C

243SD

Sidewalk Inventory

Start Point: HILLSBOROUGH DR @ SPRING FOREST RD

End Point: _____

Direction of Increasing Station: EW

Reason Codes for NON-COMPLIANCE:

Inspector Name: JF JH
Date: 3/29/11

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: _____

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
HILLSBOROUGH DR	0+00	0+56				
FOREST HILLS CT	0+56					
FOREST HILLS CT	0+00	0+78	0+78	0+94	CS	
	0+94	2+02	2+02	—	VC	
	2+02	2+14	2+14	—	VC	
	2+14	3+01	3+01	—	VC	
	3+01	3+17	3+17	—	DS	9323
	3+17	3+50	3+50	—	VC	
	3+50	4+45	4+45	—	VC	
	4+45	5+19	5+19	—	VC	
	5+19	6+21	6+21	6+49	CS	
BARRINGTON CT	6+49	6+71				

243SD

5055

Sidewalk Inventory

Start Point:

HILSBOROUGH DR @ SPRING FOREST RD

2435e

End Point:

SPRING FOREST RD

Direction of Increasing Station:

RT

Reason Codes for NON-COMPLIANCE:

Inspector Name:

JF JH

Date:

3/22/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

43

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
BABINGTON CT	0+00	0+65	0+65	0+91	CS	
	0+91	3+36	3+36	—	VC	
MARLBOROUGH	3+36	5+69				
MARLBOROUGH	6+00	1+10	1+10	—	PO	TRIM TREES
BRAMBLETON	1+10	3+05				
BRAMBLETON	0+00	0+22	0+22		VC	
	0+22	0+90	0+90	1+03	CS	
	1+03	1+80	1+80	—	VC	GAS VALVE BOX
SPRING FOREST	1+80	1+88				

2435e

pg. 2052

2425

10+31

Start Point: Knollwood Dr / Bradfordway (cont.)

End Point: Bradfordway

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Inspector Name: J. W. T
Date: 3-27-14 Thurs.

Total Number of Driveways: _____

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
			8+27	8+32		
	8+32	8+74	8+74	8+78		
	8+78	9+28	9+28		VC	7 1/2"
	9+28	10+13				
Bradfordway						

2425b

(4)

Start Point: Knollwood Dr / Bradford Way

Sidewalk Inventory

(Left)

Pg. 1 of 2

242SA

End Point: Bradford way

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: J. WITDate: 3-27-14 Thurs.

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Bradford Way	0+00	1+37	1+37	1+41	CS	1 panel
	1+41	2+45	2+45	2+55	CS	6327 CS
			2+55		DS	6327
			2+55	2+64	CS	
	2+64	3+19	3+19	3+31	CS	2+98 trim bush Note
	3+31	4+84			CS	3+21 Trim bush Note
						3+70 Trim bush Note
			4+84	4+93	CS	
			4+93	5+02	DS	6321
	5+02	5+62	5+62	5+70	VC	
	5+70	6+33	6+33	6+82	DS	6317
			6+82	6+91	CS	
	6+91	7+66	7+66	7+74	DS	6315
	7+92	8+15	8+15	8+27	CS	

242SA

3

Start Point: Bradford Way / Bradford Ct.

Sidewalk Inventory

Circle

LT

2415

End Point: _____

Direction of Increasing Station: _____

Inspector Name: J, T, WDate: 3-27-14 Thursday

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

||||| 11

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Bradford Ct.	0+00	2+78	2+78		VC	> 1/2" gap at 6308
	2+78	2+96	2+96	3+28	CS	
	3+28	3+40	3+40	3+59	CS	
			3+59		DS	6307
			3+59	3+83	CS	
			3+83		DS	6305
			3+83	4+40	CS	
			4+40	4+50	DS	6303
	4+50	5+08	5+08	5+97	CS	
Bradford Way	5+97	6+80	6+80	6+92	CS	

2415

2

Start Point: Bradford Way / Bradford Ct.
 End Point: Knollwood

Sidewalk Inventory

↓ Lt

4+84

2405

Direction of Increasing Station: _____

Inspector Name: JTWDate: 3-27-14 Thurs

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 111

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Bradford Ct.	0+00	0+14	0+14	0+39	CS	
	0+39	0+95	0+95		VC	$> \frac{1}{2}$ " gap
	0+95	1+53	1+53	1+73	CS	
	1+73	2+15	2+15	2+24	DS	8908
			2+24	2+ 48 51	CS	
	2+ 48 51	3+82	3+82		VC	$> \frac{1}{2}$ "
	3+82	4+06	4+06		VC	$> \frac{1}{2}$ "
	4+06	4+51	4+51	4+84	VC	$> \frac{1}{2}$ "
Knollwood Dr	4+84	5+01	5+01	5+10	CS	

2405

Start Point: Knollwood Dr / Bradford Way LT

End Point:

Direction of Increasing Station:

Inspector Name: J. T. Wayne
Date: 3-27-14

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

Street Name:

Compliant

From

To

Non-Compliant

From

To

Code

Comments

[illegible]

2395

Start Point:

Danville Terrace / Danville Court (Rt.)

End Point:

Danville Ct.

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name:

TW

Date:

3/27

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

H H H H H 10

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Danville Ct.	0+00	0+06	0+06	0+06	PO	
	0+06	0+28	0+28	0+28	VC	
	0+28	1+60	1+60	1+72	CS	
	1+72	3+17	3+17	3+17	VC	
	3+17	3+38	3+38	3+46	CS	
	3+46	3+71	3+71	3+97	CS	
			3+97	3+97	DS	8909
			3+97	4+32	CS	
	4+32	4+70	4+70	4+88	CS	
			4+88	4+88	DS	8912
	4+88	5+02	4+88	5+02	CS	
	5+02	5+21	5+21	5+21	PO	
	5+21	7+08	7+08	7+08	VC	
	7+08	8+11	8+11	8+24	CS	

8+24

8+40

8+46

8+48

CS

8+48

9+09

Danville Ct. 9+09

12385

X

Start Point: Danville Court / Knollwood Dr.
 End Point: Knollwood Drive

R Circle R

2375

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: TW
 Date: 3/27

VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object

DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

9

Total Number of Driveways: ~~44~~ 111

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Knollwood Dr.	0+00	0+23	0+23	0+39	CS	
	0+39	1+68	1+68	1+68	PO	
	1+68	1+78				
Danville Terr.	0+00	0+48	0+48	0+48	VC	
	0+48	0+77	0+77	0+77	PO	
	0+77	1+34	1+34	1+34	PO	
	1+34	3+26	3+26	3+34	CS	
	3+34	3+78	3+78	3+94	CS	
	3+94	4+73	4+73	4+90	CS	
	4+90	6+21	6+21	6+41	CS	
	6+41	6+57				
Knollwood	6+57					
Dr.						

2375

W

Start Point: Knollwood ~~Way~~ / Knollwood Court (#6346) (Rt.) 2-3

End Point: Danville Court

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: TW

Date: 3/27

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: HHH 1

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Knollwood Ct.	0+00	0+21	0+21	0+21	PO	
	0+21	0+98	0+98	1+25	CS	
	1+25	1+47	1+47	1+47	PO	
			1+47	1+51	CS	
	1+51	1+81	1+81	1+81 2+61	CS	
	1+81		2+61	2+61	DS	6340
	2+61	4+ 07 07	4+07	4+33	CS	Knollwood Way
			4+33	4+33	DS	across from
	4+33		4+33	4+92	CS	Bradford Way
	4+92	5+36	5+36	5+51	CS	ct.
	5+51	5+69	5+69	5+89	CS	
	5+89	5+99	5+99	6+15	CS	
	6+15	7+57	7+57	7+57	VC	manhole
	7+57	7+64				

Danville Ct. 7+64

236-5

Start Point: Knollwood Drive / Sidewalk Inventory Bradford Way (Rt.)

End Point: Knollwood Way

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

TW

3/27

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

###

Compliant

Non-Compliant

Street Name:

From

To

From

To

Code

Comments

[illegible]

(Z35-5)

Start Point: Bradford Way / Knollwood Drive (Rt.)

End Point: Knollwood Dr.

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: TWVJ

Date: 3/27

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 444 111

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Knollwood Dr.	0+00	0+04	0+04	0+04	VC	
	0+04	0+98	0+98	1+76	CS	
	1+76	2+34	2+34	2+34	VC	
	2+34	2+56	2+56	2+56	PO	
	2+56	2+80	2+80	2+80	DS	8907
	2+80	2+90	2+90	2+90	VC	
	2+90	3+55	3+55	3+55	DS	8909
	3+55	5+22	5+22	5+22	PO	
	5+22	5+85	5+85	6+12	CS	
	6+12	6+83	6+83	6+83	VC	
	6+83	7+36	7+36	7+36	DS	8919
			7+36	7+49	CS	
Knollwood Dr.	7+49	8+56				

2345

①

Circle

2335

256

Start Point: Knollwood Ct / Knollwood Way

End Point: _____

Direction of Increasing Station: _____

Inspector Name: J. Tine

Date: 3-27-14

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone


PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 111111111111

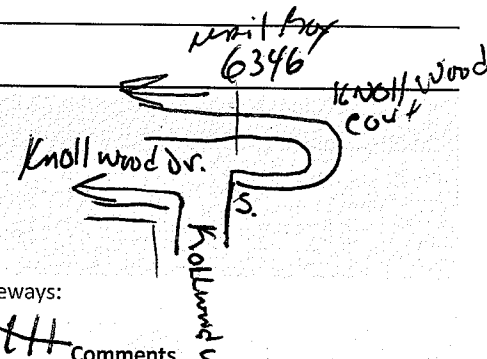

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Knollwood Ct ^{Way}	0+00	1+95	1+95	2+08	PO	2 gas valves 0+00 to 0+4
			2+08		DS	6347
			2+08	2+17	CS	
	2+17	6+93	6+93		VC	7 1/2"
	6+93	7+13	7+13	7+26	CS	
	7+26	8+56				includes total driveway width
Knollwood Ct ^{Way} / Knollwood Dr.						

2335

5

Start Point: Knollwood Way / Knollwood Drive (Rt.)
End Point: Remington Drive

2325

Direction of Increasing Station: _____

Inspector Name: TWW
Date: 3/27

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

3

Total Number of Driveways: 111

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Knollwood Dr.			0+00	0+24	CS	
	0+24	0+40	0+40	1+13	CS	
	1+13	1+89	1+89	1+89	VC	
	1+89	3+19	3+19	3+ 33 63	CS	
	3+63	4+00				
Remington Dr.						

2325

(R)

Start Point: Knollwood Way / Remington Dr. (Rt.)

2315

End Point: Knollwood Ct.

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: TWW
Date: 3/27

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 1111

(4)

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Remington Dr.	0+00	0+20	0+20	0+20	PO	
	0+20	0+58	0+58	0+58	VC	
	0+58	0+78	0+78	0+86	CS	
	0+86	1+70	1+70	1+70	VC	
	1+70	3+90	3+90	3+90	PO	
	3+90	4+16				
Knollwood Ct.						

2315

2305

Q

Start Point: Remington Place / Sidewalk Inventory Remington Drive Rt.

End Point: Remington Drive

Direction of Increasing Station:

Inspector Name: TWW
Date: 3/27

Reason Codes for NON-COMPLIANCE:

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 1

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Remington	0+00	0+73	0+73	1+29	CS	
Dr.			1+29	1+29	DS	8904
			1+29	1+38	CS	
	1+38	1+58	1+58	1+58	VC	
	1+58	2+41	2+41	2+41	DS	8905
			2+41	2+89	CS	
			2+89	2+89	DS	8903
			2+89	3+16	CS	
	3+16	4+09				

2305

(P)

Start Point: Remington Court / Brambleton Way
End Point: Brambleton Way

Sidewalk Inventory



2295

Direction of Increasing Station: _____

Inspector Name: _____

Date: _____

TWW

3/27

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 5

HHH

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Brambleton Way	0+00	0+76	0+76	0+76	VC	
	0+76	1+29	1+29	1+29	VC	
	1+29	2+05	2+05	2+05	VC	
	2+05	2+32	2+32	2+32	VC	
	2+32	2+84	2+84	2+84	CS	
	2+84	3+33	3+33	3+33	VC	
Brambleton Way @ mailbox 6322	3+33	4+86				

2295

6

2285
RT.

Start Point: Remington Drive / mailbox 6322 Remington Ct.

End Point: Spring Ridge Pkwy

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: TWW
Date: 5/27

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 10
|||||

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Remington Ct.	0+00	0+96	0+96	0+96	VC	
	0+96	2+10				
Knollwood Way	0+00	0+00	0+00	0+18	CS	
	0+18	1+73	1+73	1+73	DS	6316
			1+73	2+52	CS	
	2+52	3+22	3+22	3+43	CS	
			3+43	3+43	DS	6312
			3+43	3+99	CS	
	3+99	4+21	4+21	4+21	DS	6310
			4+21	4+96	CS	
	4+96	6+37	6+37	6+37	DS	6304
			6+37	6+52	CS	
Spring Ridge Pkwy	6+52	8+03				

2285

(N)

Start Point: Remington Drive / Spring Ridge Pkwy Rt.

End Point: Brambleton Way

2275

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: TWW
Date: 3/27

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 11

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Spring Ridge Pkwy			0+00	0+74 0+74	CS	
	0+74	1+05	1+05		DS	6301
			1+05	1+25	CS	
	1+25	1+68	1+68	1+68	VC	
	1+68	1+84	1+84	2+00	CS	
	2+00	4+16				
Remington Place	0+00	1+91	1+91	1+91	DS	
			1+91	2+43 2+43	CS	
	2+43 2+43	2+72	2+72	2+72	VC	
	2+72	4+00	4+00	4+00	VC	
	4+00	4+24	4+24	4+33	CS	
Brambleton Way	4+33	5+71				

2275

(M)

Start Point:

Spring Ridge Pkwy / Iverson Terr. South Circle

End Point:

Direction of Increasing Station:

Inspector Name:

Date:

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

Street Name:

From

To

Compliant

From

To

Non-Compliant

Code

Comments

Iverson Terr. S.	0+00		2+23		VC	> 1/2" joint	(RT)
SRP	2+23	4+29	4+29	4+41	CS		
			4+41	4+70	DS	6294	
		4	4+41	4+70	CS		
	4+70	5+23	5+23		DS	6296	
			5+23	5+71	CS		
	5+71		5+71	5+84	CS		
	5+84	6+49	6+49	6+58	CS		
			6+58		DS	6299	
			6+58	7+13	CS		
			7+13		DS	6297	
			7+13	7+34	CS		
	7+34	7+43	7+43	7+82	CS		
	7+82	8+41	8+41	8+70	CS		

2265a

292

22656

12+56

12+56

Start Point: Spring Ridge Pkwy

Sidewalk Inventory

Iversen Trs S. Circle

End Point: Spring Ridge Pkwy

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: TJS
Date: 3/27/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways:

2

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Iversen Trs S.	8+70	8+94	8+94	9+06	CS	
SRP	9+06	9+24	9+24	9+44	CS	
	9+44	10+19	10+19	10+56	CS	
			10+56		DS	6287
			10+56			
			10+56	10+65	CS	
	10+65	10+77	10+77	11+01	CS	
Spring Ridge Pkwy	11+01	12+07	12+07	12+56	CS	

22656

(L)

Start Point: Newport Drive West / Pine Ridge Terrace Rt.

End Point: Spring Ridge Pkwy

2255

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: JTTWW
Date: 3/27/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Pine Ridge Terrace	0+00	2+59	2+59	1+59 2+59	VC	Trim trees 1+49 → 1+64 NOTE
	2+59	3+26	3+26	3+34	CS	
Pine Crest Ln.	0+00		0+00	0+82	CS	
	0+82	1+63	1+63	1+63	VC	
	1+63	4+59	4+59	4+63	CS	
	4+63	4+75				
Elkridge Ln.	0+00	2+43				
Elkridge Ln.	0+00		0+00	0+20	CS-X	Town and Spring ridge Pkwy (9002
	1+00 0+20	1+01	1+01	1+79	CS	9004
Spring Ridge Pkwy	1+79	2+44				

2255

Start Point: Douglas Ave @ Circle Sidewalk Inventory

End Point: Douglas Ave circle @ Lot 6024

Direction of Increasing Station: _____



Inspector Name: RF302
Date: 3-27-14

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 34

Street Name: <u>Douglas Ave</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Circle	0+00	0+14	0+14	0+22	CS	
	0+22	0+79	0+79	1+22	CS	
Grangerfield CT	0+00		0+00	0+14	CS	
	0+14	0+50	0+50	—	VC	
	0+50	3+11	3+11	3+67	CS	No PZ
	3+67	5+01	5+01	5+35	CS	No PZ
	5+35	7+45	7+45	7+53	CS	No DZ
	7+53	7+98	7+98	—	DS	6071
	7+98	8+76	8+76	—	VC	No PZ
	8+76	9+11	9+11	—	VC	
	9+11	9+65				
Watson CT	0+00	4+30	4+30	—	VC	No PZ's
	4+30	7+92	8+92	8+00	CS	No PZ
	8+00	9+21	9+21	—	VC	

22452

20-3
224sb

Sidewalk Inventory

Start Point: Douglas Ave @ Circle

End Point: Douglas Ave @ Lot 6024

Direction of Increasing Station: _____

(12)

Inspector Name: TJ 302
Date: 3-27-14

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: See Sheet 1

Street Name: <u>Douglas Ave</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Cont.	9+21	9+53	9+53	—	DS	6045
	9+53	9+65	9+65	—	VC	No PZ's
	9+65	10+70	10+70	—	VC	
	10+70	12+34	12+34	—	VC	No PZ
	12+34	12+85	12+85	13+16	CS	-
			13+00	—	DS	6035
	13+16	13+44	13+44	—	VC	
	13+44	13+68	13+68	13+96	CS	
			13+82	—	DS	6033
	13+96	14+04	14+04	—	VC	No PZ's
	14+04	15+08	15+08	—	VC	
	15+08	16+30	16+30		VC	
	16+30	16+91	16+91	—	DS	6027 No PZ's
	16+91	17+99	17+99	—	VC	

224sb

Sidewalk Inventory

3 - 3
2245c

Start Point: Douglas Ave @ Circle

End Point: Douglas Ave @ Lot 6024

Direction of Increasing Station: _____



Inspector Name: B. J. O'Z
Date: 3-27-14

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel



Total Number of Driveways: See Sheet 1

Street Name: <u>Douglas Ave</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
	17+99	18+17	18+17	—	DS	6025
	18+17	18+51	18+51	—	VC	
	18+51	19+00	19+00	—	PO	Pine Tree
	19+00	19+43	19+43	—	DS	6023
	19+43	20+04	20+04		JC	No PZ
	20+04	20+38	20+38	—	DO	Bush
	20+38	21+12	21+12	—	DS	6024
Lot 6024	21+12	21+23				END

2245c

Start Point: Samuel DR at Emmaline DR

End Point: Emmaline DR 10658

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: 02/13F
Date: _____

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

R

Total Number of Driveways: 7

Street Name: <u>Samuel DR</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Emmaline DR</u>	<u>0+00</u>	<u>1+18</u>	<u>1+18</u>	<u>1+26</u>	<u>VS</u>	
	<u>1+26</u>	<u>3+65</u>	<u>3+65</u>	<u>3+73</u>	<u>CS</u>	
	<u>3+73</u>	<u>3+95</u>	<u>3+95</u>	<u>—</u>	<u>VC</u>	
	<u>3+95</u>	<u>4+82</u>	<u>4+82</u>	<u>—</u>	<u>DS</u>	<u>10661</u>
	<u>4+82</u>	<u>5+20</u>	<u>5+20</u>	<u>—</u>	<u>VC</u>	
	<u>5+20</u>	<u>5+48</u>	<u>—</u>	<u>—</u>		<u>End 10658</u>

1 F3
2225a

Sidewalk Inventory
Start Point: Farmbrook Dr @ Ballenger Creek Pike

End Point: Crestwood Blvd

Direction of Increasing Station: UP

Inspector Name: BF 602
Date: 3-27-14

Reason Codes for NON-COMPLIANCE:

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways:

Street Name: <u>Farmbrook Dr RT</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Ballenger Creek Pike</u>	0+00	1+27	1+27	—	VC	
	1+27	1+56	1+56	—	VC	
	1+56	2+03				
<u>Glenrock Dr #1</u>	0+00	0+37	0+37	—	VC	
	0+37	1+70	1+70	—	VC	
	1+70	1+95				
<u>Glenrock Dr #2</u>	0+00	1+26	1+26	—	VC	
	1+26	1+73				
<u>Briar Grove CT</u>	0+00	1+90				
<u>Pebble Dr #1</u>	0+60	0+92	0+92	1+51	CS	
	1+51	1+76				
<u>Pebble Dr #2</u>	0+00	0+07	0+07	—	VC	
	0+07	0+19	0+19	—	VC	
	0+19	0+36	0+36	0+55	CS	

2225a

8 = 3
222sb

Sidewalk Inventory

Start Point: Farmbrook Dr @ Ballenger Creek Pike

End Point: Crestwood Blvd

Direction of Increasing Station: UP

Reason Codes for NON-COMPLIANCE:

Inspector Name: JF302
Date: 3-27-14

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 0

Street Name: Farmbrook Dr RT	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Cont	0+55	1+04	1+04	—	VC	
	1+04	1+95				
Farmhouse Dr #1	0+00	0+70	0+70	0+83	CS	
	0+83	1+69				
Farmhouse Dr #2	0+00	0+91	0+91	1+11	CS	
	1+11	2+00				No PZ
Single tree Dr #1	0+00	0+12	0+12	—	VC	
	0+12	1+03	1+03	—	VC	
	1+03	2+28	2+28	2+35	CS	No PZ
Single tree Dr #2	0+00	0+86	0+86	—	VC	
	0+86	1+27				
Farmbrook CT	0+00	1+74	1+74	1+78	CS	
	1+74	1+88				
Yellow Sheave CT	0+00	0+12	0+12	—	VC	

222sb

Start Point: Farmbrook Dr @ Ballenger Creek Pkwy

Sidewalk Inventory

End Point: Crestwood Blvd

22250

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BSF #02
Date: 3-27-19

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: _____

Street Name: <u>Farmbrook Dr</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Cont	0+12	1+97				
Hampes CT	0+00	1+22				
Parking lot	0+00	0+57	0+57	—	VC	
	0+57	1+15	1+15	—	VC	
	1+15	1+31				
Brace CT	0+00	0+20	0+20	—	VC	
	0+20	0+40	0+40	—	VC	
	0+40	0+69	0+69	—	VC	
	0+69	0+81	0+81	—	VC	
	0+81	1+11	1+11	—	VC	
	1+11	1+42	1+42	—	VC	
	1+42	2+09				No P2 End@Crestwood Blvd

22250

20.5

✓

Inspector Name: 02/13F
Date: 3/27/2014

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 13

2215

Sidewalk Inventory

Start Point: Glenrock Dr @ Farmbrook Dr

End Point: Farmbrook Dr

Direction of Increasing Station: UP

2205

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

DS Driveway Cross Slope

PP Pinch Point

CS Panel Cross Slope

PZ Passing Zone

WP Width of Panel

PO Protruding Object

Inspector Name: BF102

Date: 3-22-14

Total Number of Driveways: 14

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Farmbrook Dr RT			0+00	0+18	CS	
	0+18	3+22	3+22	—	VC	No PC's
	3+22	3+90	3+90	—	VC	
	3+90	4+25	4+25	—	VC	
	4+25	4+87	4+87	—	VC	
	4+87	5+22	5+22	—	DS	5682
	5+22	5+44	5+44	—	VC	
	5+44	5+55	5+55	—	DS	5680
	5+55	9+30				END @ Farmbrook Dr No PC's

2205

Sidewalk Inventory

Start Point: Briar Grove CT @ Farmbrook Dr

2195

End Point: Farmbrook Dr


Direction of Increasing Station: UP

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF302
Date: _____

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

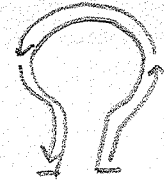

Total Number of Driveways: 9

Street Name: <u>Briar Grove CT</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Farmbrook Dr</u>	<u>0+00</u>	<u>2+10</u>	<u>2+10</u>	<u> </u>	<u>VC</u>	<u>No PZ</u>
	<u>2+10</u>	<u>2+71</u>	<u>2+71</u>	<u> </u>	<u>VC</u>	
	<u>2+71</u>	<u>3+11</u>	<u>3+11</u>	<u>3+11</u>	<u>VC</u>	
	<u>3+11</u>	<u>7+39</u>	<u>7+39</u>	<u> </u>	<u>VC</u>	
	<u>7+39</u>	<u>7+53</u>	<u>7+53</u>	<u>7+73</u>	<u>CS</u>	
	<u>7+73</u>	<u>7+90</u>				<u>END</u>

2195

Start Point: Farmhouse Dr @ Farmbrook Dr

Sidewalk Inventory

2185

End Point: Farmbrook Dr

Direction of Increasing Station: up

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF802
Date: 3-27-14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 11

Street Name: <u>Farmhouse Dr</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Farmbrook Dr</u>			<u>0+00</u>	<u>—</u>	<u>VC</u>	
	<u>0+00</u>	<u>1+98</u>	<u>1+58</u>	<u>—</u>	<u>VC</u>	<u>No PZ</u>
	<u>1+98</u>	<u>2+06</u>	<u>2+06</u>	<u>—</u>	<u>VC</u>	
	<u>2+06</u>	<u>3+22</u>	<u>3+22</u>	<u>3+38</u>	<u>CS</u>	
	<u>3+38</u>	<u>9+05</u>	<u>9+05</u>	<u>—</u>	<u>DS</u>	<u>5603- No PZ's</u>
	<u>9+05</u>	<u>10+69</u>				<u>END @ Farmbrook Dr</u>

2185

1 of 2
2175a

Sidewalk Inventory
Start Point: Singletree Dr @ Farmbrook Dr
End Point: Farmbrook Dr

Direction of Increasing Station: _____

(R)

Inspector Name: BF 302
Date: _____

Reason Codes for NON-COMPLIANCE:

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 40

Street Name: <u>Singletree Dr</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Farmbrook Dr	0+00	2+60	2+60	4+33	CS	No PZ's
			2+98	/	DS	5692
			3+52	/	VC	
			3+68	/	DS	5690
			4+09	/	VC	
	4+33	4+85	4+85	4+93	CS	
	4+93	5+11	5+11	/	VC	
	5+11	5+46	5+46	/	VC	
	5+46	5+84	5+84	/	PP	Storm Drain Inlet & Bush
	5+84	6+26	6+26	/	VC	
		7+22	7+22	/	VC	
		7+59	7+59	/	DS	5678
		8+62	8+62	8+79	CS	
		10+04	10+04	/	VC	

2175a

Sidewalk Inventory

Start Point: Singletree Dr @ Farmbrook Dr

End Point: Farmbrook Dr

Direction of Increasing Station: UP

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Inspector Name: BF30Z
Date: 3-27-14

Total Number of Driveways: See Sheet 1

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Cont.	10+04	10+16	10+16	—	VC	N. PZ's
	10+16	11+09	11+09	—	DS	5666
	11+09	11+16	11+16	11+51	CS	
	11+51	12+00	12+00	—	PO	Bush No PZ's
	12+00	12+54	12+54	12+66	CS	-
	12+66	17+22	17+22	—	DS	5648 No PZ's
	17+22	17+41	17+41	—	VC	
	17+41	19+82	19+82	19+94	CS	No PZ's
	19+94	22+72	22+72	—	PO	Thorn Bush
	22+72	26+34	26+34	—	DS	5622
	26+34	27+94				END @ Farmbrook Dr No PZ's

Sidewalk Inventory

Start Point: Grainery CT @ Singletree Dr

End Point: Singletree Dr

Direction of Increasing Station: up

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope


CS Panel Cross Slope

WP Width of Panel

Inspector Name: DFLOZ

Date: 3-27-14

Total Number of Driveways: 14

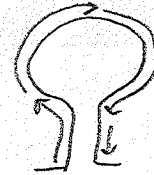

Street Name: <u>Grainery CT</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Singletree Dr</u>	0+00	0+32	0+32	0+70	CS	
	0+70	1+59	1+59	1+87	CS	
			1+77	—	DS	6706
	1+87	2+10	2+10	3+00	CS	
			2+50	—	DS	6708
	3+00	3+56	3+56	—	DS	6710
	3+56	4+10	4+10	—	UC	
	4+10	5+06	5+06	—	DS	6711
	5+06	6+28	6+28	6+32	CS	
	6+28	6+42	6+42	—	DS	6707
	6+42	6+48	6+48	6+88	CS	
	6+88	7+19	7+19	—	DS	6705
	7+19	8+34	8+34	8+61	CS	
	8+61	8+73				END@ Singletree Dr

2/6sa

Sidewalk Inventory

Start Point:

SANTEE RD @ FINN DR

1 OF 2

End Point:

MISSISSIPPI LANE



1 OF 2

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name:

JH/RH

Date:

3/27/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

13

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
FINN DR	0+00	0+12	0+12	0+37	CS	
	0+37	0+91	0+91	1+32	CS	
@ MISSISSIPPI	1+32	1+72	1+72	1+96	CS	
@ MISSISSIPPI	0+00	0+04	0+04	0+11	CS	
	0+11	1+44	1+44	1+44	VC	
	1+44	2+08	2+08	2+08	VC	
	2+08	2+31	2+31	2+31	VC	
	2+31	2+49	2+49	2+49	VC	
	2+49	2+81	2+81	2+81	VC	
	2+81	2+70	2+70	2+70	VC	
	2+70	3+44	3+44	3+44	VC	
	3+44	4+64	4+64	4+64	VC	PZ @ 4+40
	4+64	5+32	5+32	5+32	VC	

2155a

Start Point: SALVAGE RD @ FINNDR

Sidewalk Inventory

ZOF 2155b

End Point: ~~MISSISSIPPI~~ @ END OF CIRCLE

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: HL/RT
Date: 3/27/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: _____

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
MISSISSIPPI	5+32	5+52	5+52	5+61	CS	
	5+61	5+85	5+85	5+85	VC	
	5+85	6+07	6+07	6+07	VC	
	6+07	9+02	9+02	9+02	VC	PZ @ 8+13 PZ @ 8+86
	9+02	9+13	9+13	9+13	VC	
MISSISSIPPI	9+13	9+67				THE END EXIT OF CIRCLE
END OF CIRCLE						

2155b

Sidewalk Inventory

Start Point: SAWYER RD @ MISSISSIPPI LAKE

Direction of Increasing Station:

Date:

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways:

2145

RH SIDE

Start Point: DOUGLAS @ FINN DR

Sidewalk Inventory

213-1

End Point: @ END @ SAMUEL RD

(R)

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: JH RH

Date: 3/27/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
FINN DR	0+00	0+70	0+70	1+18	CS	
	1+18	1+38	1+38	1+58	CS	
	1+58	2+13	2+13	2+13	VC	NO PZ
	1+58	2+13	2+21	2+21	VC	
	2+21	2+32	2+32	2+32	VC	
	2+53	2+53	2+53		DS	6090
	2+53	2+62	2+62		VC	
	6+95	6+95	6+95		DS	6078 NO PZ
	6+95	7+92	7+92		DS	6076
	7+92	8+03	8+03		VC	
	8+03	8+23	8+23		VC	
	8+23	8+63	8+63		VC	
	8+63	9+59	9+59		VC	
	9+59	10+70	10+70		DS	6070

10+70 15+94 15+94

VC

@ SAMUEL RD

15+94 18+50

2135

1 of 2 [21a-a]

RD Sidewalk Inventory

Start Point: SAMUEL DR @ DOUGLAS AVE

End Point: FINN DR. (R)

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: JH/EH
 Date: 3/27/14

VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object

DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

Total Number of Driveways: 2

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
DOUGLAS AVE	0+00	1+09	1+09		VC	
	1+09	1+24	1+24		VC	
	1+24	2+20	2+20		VC	NO PZ
	2+20	2+76	2+76		VC	
	2+76	2+85	2+85		VC	
	2+85	3+04	3+04		VC	
	3+04	3+67	3+67		PO	
	3+67	4+30	4+30		VC	
	4+30	4+62	4+62		VC	
	4+62	4+70	4+70		VC	
	4+70	4+89	4+89		VC	
CLARK AVE	4+89	5+19	5+19		VC	
CAIRO CT	5+19	5+24				

Start Point: SAMUEL JR @ CAIRO CT

End Point: FINNDR

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: JH/EH
Date: 3/27/14

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 0

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
CAIRO CT	0+00	2+49				
EMMA LIN DR	2+49					
EMMA LIN DR	0+00	0+28	0+28	—	VC	
	0+28	0+48	0+48	—	VC	
	0+48	0+60	0+60	—	VC	
	0+60	1+37	1+37	—	VC	
FINNDR	1+37	1+70				

18F 2115

Sidewalk Inventory

Start Point: ~~FARMBROOK DR @ GLENBROOK DR~~ GLENBROOK DR @ FARMBROOK DR

End Point: FARMBROOK DR

Direction of Increasing Station: LT

Reason Codes for NON-COMPLIANCE:

Inspector Name: JH RH SC
Date: 3/27/14

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 8

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
2 FARMBROOK DR	0+00	0+09	0+09	-	VC	
	0+09	0+25	0+25	-	VC	
	0+25	0+54	0+54	0+62	CS	
	0+62	0+81	0+81	-	VC	
	0+81	1+03	1+03	-	VC	PZ @ 1+03-5695
	1+03	1+83	1+83	-	VC	
	1+83	2+29	2+29	-	VC	PZ- 5687
	2+29	2+93	2+93	-	VC	
	2+93	3+13	3+13	-	VC	
	3+13	5+58	5+58	-	VC	HO PZ
	5+58	5+76	5+76	-	VC	
	5+76	6+36	6+36	-	VC	
	6+36	7+08	7+08	-	VC	
	7+08	7+88	7+88	-	VC	
	7+88	8+08	8+08	8+23	CS	

FARMBROOK DR 8+23

2115

Sidewalk Inventory

Start Point: 7 EBBUR DR @ FARMBROOK DR

End Point: FARMBROOK DR

Direction of Increasing Station: CT

Reason Codes for NON-COMPLIANCE:

Inspector Name: JH EATSC
Date: 3/27/14

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 4

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
FARMBROOK DR	0+00	0+48	0+48	—	VC	
	0+48	0+62	0+62	—	VC	No PZ
	0+62	0+92	0+92	—	PO	
	0+92	1+48	1+48	—	VC	
	1+48	2+12	2+12	2+28	CS	
	2+28	4+46	4+46	—	VC	
FARMBROOK DR	4+46	6+00				

was

Sidewalk Inventory

Start Point: ~~FARMBROOK DR @ FARMBROOK DR~~ FARMBROOK DR @ FARMBROOK DR

End Point: FARMBROOK DR

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: JH RASC
Date: 3/27/14

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 13

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
FARMBROOK DR	0+00	0+00	0+00	0+23	CS	
	0+23	0+71	0+71	-	VC	
	0+71	1+31	1+31	-	VC	
	1+31	2+65	2+65	2+74	CS	
	2+74	3+71	3+71	-	VC	
	3+71	3+92	3+92	4+00	CS	
	4+00	4+10	4+10	-	VC	
	4+10	4+70	4+70		VC	
	4+70	4+90	4+90	5+02	CS	
	5+02	5+47	5+47	-	VC	
	5+47	6+28	6+28		VC	
	6+28	6+40	6+40	-	VC	
FARMBROOK DR	6+40	7+57				

Sidewalk Inventory

Start Point: SINGLETON C&D SINGLETON DR

End Point: SINGLETON DR

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: JHSCRH
Date: 3/27/14

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 14

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
SINGLETON DR	0+00	0+00	0+00	0+08	CS	
	0+08	0+38	0+38	0+50	CS	
	0+50	2+71	2+71	4+06	CS	
			3+46	-	DS	#6794
			3+66	-	DS	#6792
			3+86	-	DS	#6790
	4+06	5+22	5+22	5+30	CS	
	5+30	5+40	5+40	5+53	CS	
	5+53	6+31	6+31	6+45	CS	
	6+45	6+52	6+52	6+52	DS	6793
SINGLETON DR	6+52	8+22	8+22	8+36	CS	
	8+36	8+79				

Sidewalk Inventory

2015

Start Point: FARMHOUSE DR @ FARMBROOK DR

End Point: FARMBROOK DR

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: JH-BH SC
Date: 3/27/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: - 19

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
FARMBROOK DR	0+00	0+04	0+04	0+04	CS	
	0+04	1+81	1+81	2+17	CS	No PZ
	2+17	3+04	3+04	3+21	CS	
	3+21	4+07	4+07	4+14	CS	
	4+14	4+48	4+48	—	VC	
	4+48	5+28	5+28	—	VC	
	5+28	5+40	5+40	5+44	CS	
	5+44	7+34	7+34	7+44	CS	
	7+44	8+74	8+74	—	VC	
	8+74	10+02	10+02	—	VC	
	10+02	11+25	11+25	—	VC	
FARMBROOK DR	11+25	12+05				

2015

2065a

Start Point: SINGLETREE DR @ FARMBROOK DREnd Point: FARMBROOK DRDirection of Increasing Station: LT

Reason Codes for NON-COMPLIANCE:

Inspector Name: JH HILSO
Date: 3/27/14VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding ObjectDS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
FARMBROOK DR	0+00	1+35	1+35	1+92	CS	27
	1+92	2+62	2+62	2+77	CS	
	2+77	2+86	2+86	—	VC	
	2+86	4+22	4+22	—	PO	
	4+22	4+43	4+43	4+59	CS	
GRAINERY CT	4+59	5+36				
GRAINERY CT	0+00	1+78	1+78	2+21	CS	
	2+21	2+33	2+33	2+51	CS	
	2+51	2+80	2+80	3+01	CS	
	3+01	3+36	3+36	3+66	CS	
	3+66	3+78	3+78	—	VC	
	3+78	4+05	4+05	—	VC	
	4+05	4+14	4+14	4+22	CS	
	4+22	5+75	5+75	6+02	CS	
	6+02	6+09	6+09		DS	

2065a

206

206sb

Start Point: SINGLETREE DR @ FARMBROOK DR

End Point: FARMBROOK DR

Direction of Increasing Station: LT

Reason Codes for NON-COMPLIANCE:

Inspector Name: JH, RH, SC
Date: _____VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding ObjectDS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
	6+09	6+19	6+19	6+31	CS	
	6+31	8+51	8+51	8+71	CS	
	8+71	8+95	8+95	9+23	CS	
	9+23	10+88	10+88	—	DS	5649
	10+88	11+95	11+95	—	VC	
SINGLETREE	11+95	15+33	—	—		
SINGLETREE	0+00	2+19	2+19		VC	
FARMBROOK DR	2+19	3+11				

206sb

2055

K

Start Point: Iverson Terrace North / Spring ridge Pkwy Rt.

End Point: Spring Ridge Pkwy

Direction of Increasing Station: 8

Reason Codes for NON-COMPLIANCE:

Inspector Name: TDJT
Date: 3/26/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 1111 1111 1111

(17)

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Spring Ridge Pkwy	0+00	0+97	0+97	1+ 18 33	CS	
	1+33	2+05	2+05	2+05	VC	
	2+05		2+05	2+59	CS	6303
	2+59	3+03	3+03	3+19	CS	
	3+19	5+90	5+90	5+90	PO	Bush
	5+90	6+62	6+62	6+82	CS	
	6+82	7+53	7+53	7+73	CS	
			7+73	7+73	DS	6310
			7+73	7+84	CS	
	7+84	8+70	8+70	8+78	CS	
	8+78	9+31	9+31	9+75	CS	
			9+75	9+75	DS	6304
			9+75	9+85	CS	
	9+85	11+46	11+46	11+46	VC	

Spring Ridge Pkwy

11+46 11+84

2055

2045

Start Point: Hawkin Ct. South / Spring ridge Pkwy Rt

End Point: Spring ridge Pkwy 6+85

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: DTS
Date: 3/26/14

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: ||||

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Spring ridge Pkw	0+00	0+40	0+40	0+49	CS	
			0+49		DW	6290
			0+49	0+73	CS	
	0+73	1+10	1+10		VC	greater than 1 1/2"
	1+10	1+91	1+91	1+97	CS	
			1+97		DS	6294
			1+97	2+10	CS	
	2+10	2+65	2+65		VC	Grack greater than 1" wide
	2+65	3+11				
			3+11	3+23	CS	
	3+23	3+31	3+31		VC	Driv by > 1"
	3+31	4+29	4+29	4+37	CS	
	4+35	6+10	6+10	6+47	VC	Trim Trees
	6+10	6+85				

Spring ridge Pkw.

2045

(I) I

2035

Sidewalk Inventory
 Start Point: HAWKINS Court North / Spring Ridge Pkwy Rt. Circle
 End Point: HAWKINS Court North 7+61 Spring Ridge Pkwy

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: JDT5Date: 3/26/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: ||||

Street Name:	Compliant	Non-Compliant	Code	Comments
From	To	From	To	
Spring Ridge Pkwy	0+00	0+14 0+14		VC greater than 1/2"
	0+14	2+00	2+13	CS
	2+13	2+63		VC " " "
	2+63	3+79	3+87	DW DW 6309 CS
		3+87	3+87	DW DW 6309
		3+87	4+04	CS
	4+04	5+31	5+77	CS
	5+77	6+17	6+77 6+77	CS
		6+77		DS 6302
		6+77	7+02	CS
		7+02		DS 6300
		7+02	7+14	CS
	7+14	7+61		
HAWKINS Ct. North				

Spring Ridge Pkwy

2035

H

Start Point: Spring Ridge Parkway

Sidewalk Inventory

HAWKINS Court. NO Lt

circle

2025

End Point: Clunidge Dr NO

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: DTJ

Date: 3/26/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Hawkins Ct. North			0+00	2+75	CS	
			2+75		VC	Bike lane ahead. 5'-4"
			2+75	3+09	CS	
	3+09	3+52	3+52		VC	Storm water vault.
	3+52	3+75				
Clunidge Dr. North						

2025

2015

(R7)

[illegible]

2015

⑦

Rt. Intestine

2005

Sidewalk Inventory

Start Point: Spring Ridge Pkwy Price of side walk under ~~the~~ 70 Dashed Ends

End Point: Side walk on I-70 Rt. side I-70 West 0456 20th St

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: J J
Date: 3/26/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways:

[illegible]

2005

note
side doors behind
ground level

Sidewalk Inventory

Sidewalk Inventory

Start Point: Spring w/ Rkwy / End of 9th St of Grand Ave #6250

End Point: Glen Valley Tce 2+13

End Point: Glen Valley Jc 2+13

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: S D J

Date: 3/26/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

Compliant

Street Name: From

From

To

Non-Compliant

From

To

Code

Comments

[illegible]

1995

Sidewalk Inventory

Start Point: Springdale Pkwy / Spring Forest RD

End Point: See Page 2 Iverson Terr N.

192 BT

1985a

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: J.D.J.
Date: 3/26/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: _____

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Spring Forest RD			0+00	1+09	CS	
	1+09	1+41	1+41	1+45	CS	
	1+45	1+73	1+73	2+31	CS	
	2+31	2+55	2+40	2+55	VC	Trim Trees
			2+55	3+05	CS	Dedicated - Asphalt
	3+05	3+99	3+99		VC	Crack > 1/2"
	3+99	4+34	4+34		VC	" "
	4+34	4+64	4+64		VC	" " Patch Failed
	4+64	4+75	4+75	5+02	CS	
	5+02	5+51	5+51		VC	"
	5+51	5+82	5+82	6+25	CS	
	6+25	6+84	6+84	7+31	CS	
	7+31	7+57	7+57	7+74		
	7+74		7+79		VC	Speed Limit sign. too low

PO

1985a

1985b

198 sb

Side Walk Inventory

Start Point: Spring Field / Remington Dr. LT

End Point: Spring Forest Rd 4+73

1975

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: EDJ

Date: 3/26/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: _____

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Remington Dr.	0+00	0+74	0+00	1+93	VC	Trim trees
	1+14	1+42	0+74	1+14	CS	
	1+14	1+42	1+42	2+62	CS	
	2+62	3+15	2+95	3+09	VC	Roots : spill over
			3+15	3+65	CS	
	3+65	3+93	3+93	4+73	CS	
Spring Forest Rd						

1975

1965

Start Point: Spring Ridge Parkway / Knollwood Dr. Lt

End Point: Remington Dr. 8+91

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: JJJ
Date: 3/26/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Knollwood Dr	0+00	0+16	0+16	0+63	CS	
	0+63	0+69	0+69	2+33	CS	
	2+33	2+51	2+51	2+61	CS	
	2+61	2+93	2+93	3+42	CS	
	3+42	5+56	(4+21 ^{NOTE} to 5+56)	6+58	PO	(Trim trees)
			5+56	6+01	CS	Tree roots
			6+01	8+27	CS	
	8+27	8+91				
Remington Dr						

1965

Asphalt SW A

192

195sa

Start Point: Spring Ridge Pkwy / Ridgefield Dr. (Lt.)
 End Point: See Page 2 Knollwood Dr

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

DS Driveway Cross Slope

PP Pinch Point

CS Panel Cross Slope

PZ Passing Zone

WP Width of Panel

PO Protruding Object

Total Number of Driveways: 11

Inspector Name: SDJ
 Date: 3/26/14

Compliant

Non-Compliant

Street Name:	From	To	From	To	Code	Comments
Ridgefield Dr.	0+00	0+13	0+13		VC	1" Gap; Area
	0+13	2+54				
	2+54	2+83				
	2+54	3+12				
	0+00	0+31	0+31	0+69	CS	
			0+69	0+72	VC	Tree Root
			0+69	0+75	CS	
	0+75	1+19	1+19		VC	Tree Roots. 2 in d.
	1+19	1+55	1+55	1+84	CS	
	1+84	2+45	2+45	2+57	CS	
	2+57	2+94	2+94	4+61	CS	
	4+61	4+71	4+71	4+95	CS	
	4+95	5+83	5+83	7+49	CS	
	7+49	8+08	8+08	8+48	CS	

195sa

NO PASSING Zone' Enforce
(A) 292 am

195sb

Start Point: Spring w/ PKwy / Ridgefield Dr

End Point: Knollwood DR 1915

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: _____

Date: _____

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: _____

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Ridgefield Dr	8+48	8+99	8+99		VC	Storm inlet box.
	8+99	10+57	10+57		VC	Storm inlet box.
	10+57	10+74	10+74	11+93	CS	
	11+93	12+10	12+10	12+27	CS	
	12+27	15+14	15+14	16+17	CS	
	16+17	16+40	16+40	17+08	CS	
	17+08	17+14	17+14	17+34	CS	
	17+34	18+52	18+52	18+63	CS	
	18+63	18+99	18+99		VC	Hole in pavement.
			18+99	19+15		
Knollwood Dr						

195sb

1945

Start Point: Huckleberry Way @ Finn Rd - Cul-DE-Sac

End Point: 11

Direction of Increasing Station: LT

Reason Codes for NON-COMPLIANCE:

Inspector Name: RH, CM, DZ
Date: 3/26/14

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 11

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Finn	0+00	1+42	1+42		VC	
	1+42	2+42	2+42		VC	
	2+42	2+67	2+67		VC	
	2+67	4+63	4+63		RB	
	4+67	5+34	5+34		VC	
	5+34	5+52	5+52		VC	
	5+52	6+68	6+68		DS	6132
	6+68	7+20				

1945

193

Start Point: Mississippi LN @ Elm Dr

End Point: Sawyer Dr

Direction of Increasing Station: LT

Reason Codes for NON-COMPLIANCE:

Inspector Name: RH, CM, OZ
Date: 3/20/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 10

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
FWR Dr	0+00	0+39	0+39		DS	6150
	0+39	3+29	3+29		VC	
	3+29	3+70	3+70	3+74	CS	
	3+74	3+86	3+86		DS	6164
	3+86	4+22	4+22		DS	6168
	4+22	4+47	4+47		VC	
	4+47	5+61	5+61		VC	
	5+61	5+70	5+70	5+91	CS	
	5+91	6+50	6+50	6+59	CS	
	6+50	7+15	7+15		VC	
	7+15	9+20	9+20	9+32	CS	
	9+32	9+63				

1935

1925

Sidewalk Inventory

Start Point: Mississippi / W E Finn Dr

End Point: Sawyer Dr

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: RH, 1/19/02
Date: 5/26/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 8

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Finn Dr	0+00	2+01	2+01		VC	
	2+01	5+02	5+02	5+26	CS	
	5+26	5+68	5+68		VC	
	5+68	5+90	5+90		VC	
Sawyer Dr	5+90	8+37				

1925

1915a 12

Sidewalk Inventory

Start Point: Finch Rd @ Asphalt TrailEnd Point: Twain DrDirection of Increasing Station: LT

Reason Codes for NON-COMPLIANCE:

Inspector Name: RH/CM.02Date: 3/20/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 20

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Asphalt Trail	0+00	0+00	0+00	0+25	CS	
	0+25	1+17	1+17	1+29	CS	
South Steamboat Way	0+00	0+00	0+00	1+83	CS	
	1+83	2+83	2+83	3+15	CS	
	3+15	6+24	6+24	6+52	CS	
	6+52	6+77	6+77	6+81	CS	
	6+81	11+32	11+32	11+53	CS	
	11+53	12+52				
Douglas Ave	0+00	1+49	1+49		DS	10691
	1+49	1+61	1+61		VC	
	1+61	4+83	4+83		VC	
	4+83	5+27	5+27		DS	10681
	5+27	6+10	6+10	6+22	CS	
	6+22	7+18	7+18		VC	

1915a

191sb i 82

Start Point: Finna Dr @ Asphalt Trail

End Point: Turain Dr

Direction of Increasing Station: LT

Sidewalk Inventory

Inspector Name: RH, CM, C2
Date: 3/26/14

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
-	7+18	7+48	7+48		VC	
	7+48	7+69	7+69		DS	10673
	7+69	7+77	7+77	7+93	CS	
	7+93	8+34	8+34		DS	10671
	8+34	8+45	8+45		VC	
	8+45	10+71	10+71		VC	
	10+71	11+10	11+10	11+38	CS	
	11+38	11+86	11+86		VC	
	11+86	13+89	13+89	14+02	CS	
SAMUEL AVE	14+02	15+04				
	0+00	1+15	1+15		VC	
	1+15	2+20	2+20	2+29	CS	
	2+29	2+80				

191sb

11a

Start Point: Watson CT @ Douglas Ave

Sidewalk Inventory

End Point: 11

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: RH, CM
Date: 3/26/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 12

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Douglas Ave	0+00	1+28	1+28		VC	
	1+28	5+12	5+12		VC	
	5+12	6+90	6+90		VC	
	6+90	7+49	7+49		VC	
	7+49	7+97	7+97		VC	
	7+97	8+57	8+57		VC	
	8+57	8+62	8+62	8+66	CS	
	8+66	10+10	10+10		VC	
Douglas Ave	10+10	10+85				

1905

Sidewalk Inventory

1895

Start Point: Grangerford CT @ Douglas Ave

End Point: Lot 10717


Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF BOC
Date: 3-26-14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

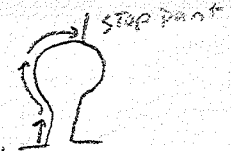

Total Number of Driveways: 4

Compliant		Non-Compliant				Comments
Street Name: <u>Grangerford CT.</u>	From	To	From	To	Code	
<u>Douglas Ave.</u>	<u>0+00</u>	<u>1+38</u>	<u>1+38</u>	<u>1+46</u>	<u>CS</u>	
	<u>1+46</u>	<u>3+03</u>				<u>End @ Lot 10717</u>

1895

18.2

Start Point: Alington Manor Sidewalk Inventory 1.1.10 @ St Jones

End Point: " " " "

Direction of Increasing Station: left

Reason Codes for NON-COMPLIANCE:

Inspector Name: RHSC, CM, PE
Date: 3/25/10

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 20

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Alington Manor West</u>	<u>0+00</u>	<u>0+07</u>	<u>0+07</u>	<u>0+18</u>	<u>CS</u>	
	<u>0+18</u>	<u>0+67</u>	<u>0+67</u>	<u>0+79</u>	<u>CS</u>	
	<u>0+79</u>	<u>0+88</u>	<u>0+88</u>	<u>0+99</u>	<u>CS</u>	
	<u>0+99</u>	<u>1+56</u>	<u>1+56</u>	<u>1+56</u>	<u>DS</u>	<u>9042</u>
	<u>1+56</u>	<u>2+18</u>	<u>2+18</u>	<u>2+18</u>	<u>DS</u>	<u>9038 9040</u>
	<u>2+18</u>	<u>2+74</u>	<u>2+74</u>	<u>2+74</u>	<u>DS</u>	<u>9038</u>
	<u>2+74</u>	<u>3+43</u>	<u>3+43</u>	<u>3+43</u>	<u>DS</u>	<u>9031</u>
	<u>3+43</u>	<u>4+11</u>	<u>4+11</u>	<u>4+11</u>	<u>DS</u>	<u>9034</u>
	<u>4+11</u>	<u>4+76</u>	<u>4+76</u>	<u>4+76</u>	<u>DS</u>	<u>9032</u>
	<u>4+76</u>	<u>5+98</u>	<u>5+98</u>	<u>5+98</u>	<u>DS</u>	<u>9030</u>
	<u>5+98</u>	<u>6+60</u>	<u>6+60</u>	<u>6+60</u>	<u>DS</u>	<u>9028</u>
	<u>6+60</u>	<u>7+79</u>	<u>7+79</u>	<u>7+79</u>	<u>DS</u>	<u>9026</u>
	<u>7+79</u>	<u>8+16</u>	<u>8+16</u>	<u>8+16</u>	<u>DS</u>	<u>9024</u>
	<u>8+16</u>	<u>8+81</u>	<u>8+81</u>	<u>8+81</u>	<u>DS</u>	<u>9022</u>

1885a

Sidewalk Inventory

Start Point:

Alington Manor - west @ St. James (end)

End Point:

" " " "

Direction of Increasing Station:

left

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

DS Driveway Cross Slope

PP Pinch Point

CS Panel Cross Slope

PZ Passing Zone

WP Width of Panel

PO Protruding Object

Inspector Name:

RH, SC, CM, 07

Date:

3/25/11

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
	8+61	9+49	9+49	9+49	DS	9020
	9+49	10+09	10+09	10+09	DS	9018
	10+09	10+51	10+51	10+61	CS	
	10+61	10+71	10+71	10+71	DS	9016
	10+71	11+66	11+66	11+66	DS	9014
	11+66	12+20	12+20	12+20	DS	9012
	12+20	12+81	12+81	12+93	CS	
	12+93	13+25	13+25	13+25	DS	9010
	13+25	14+69	14+69	14+69	DS	9008
	14+69	15+58	15+58	15+58	DS	9006
<i>Proctor Court</i>	15+58	16+09				
<i>" "</i>	0+00	0+14	0+14	0+25	CS	
	0+25	2+21	2+21	2+21	DS	
	2+21	2+37	2+37	2+49	CS	

ST. James Hall 2+49 2+64

1885b

1885b

1875

Sidewalk Inventory

Start Point: Twain Dr @ Finn Dr

End Point:

Direction of Increasing Station: rt

Reason Codes for NON-COMPLIANCE:

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Inspector Name: LH/SC/CA, 02
 Date: 7/25/14

Total Number of Driveways: 15

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Finn Dr</u>	<u>0+00</u>	<u>1+70</u>	<u>1+70</u>	<u>1+70</u>	<u>VC</u>	
	<u>1+70</u>	<u>2+63</u>	<u>2+63</u>	<u>2+63</u>	<u>DS</u>	<u>6114</u>
	<u>2+63</u>	<u>4+43</u>	<u>4+43</u>	<u>4+87</u>	<u>CS</u>	
	<u>4+87</u>	<u>9+47</u>	<u>9+47</u>	<u>9+47</u>	<u>DS</u>	<u>1603</u>
	<u>9+47</u>	<u>9+57</u>	<u>9+57</u>	<u>9+57</u>	<u>VC</u>	
	<u>9+57</u>	<u>11+73</u>	<u>11+73</u>	<u>11+73</u>	<u>VC</u>	
	<u>11+73</u>	<u>11+82</u>	<u>11+82</u>	<u>11+82</u>	<u>VC</u>	
<u>* Finn Dr.</u>	<u>11+82</u>	<u>12+62</u>	<u>end</u>			

1875

1855a

Sidewalk Inventory

Start Point: Finch Dr. @ North Steamboat way

End Point: _____

Direction of Increasing Station: rt

Reason Codes for NON-COMPLIANCE:

Inspector Name: L.H.S., M.O.Date: 3/25/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 18

Compliant

Non-Compliant

Street Name:

From

To

From

To

Code

Comments

N. Steamboat way	0+00	0+58	0+58	4+48	CS	(
N. Sawyer Rd						
Sawyer Rd	0+00	1+64	1+64	1+94	CS	
	1+94	2+99	2+99	3+16	CS	
Mississippi LN	3+16	3+28				
Mississippi LN	0+00	3+54				
Huckberry way						
Huckberry way	0+00	0+14	0+14	0+20	CS	
	0+20	1+65	1+65	1+65	DS	10694
	1+65	2+44	2+44	2+44	DS	10688
	2+44	3+50	3+50	3+58	CS	
	3+58	4+66	4+66	4+74	CS	
	4+74	6+05	6+05	6+05	VC	
	6+05	10+00	10+00	10+00	DS	

1855a

Sidewalk Inventory

185sb 185sb

Start Point: Finn Dr @ North

End Point: Twin Dr

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

DS Driveway Cross Slope

PP Pinch Point

CS Panel Cross Slope

PZ Passing Zone

WP Width of Panel

PO Protruding Object

Inspector Name: _____

Date: _____

Total Number of Driveways: _____

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
	10+00	10+92	10+92	11+15	CS	
	11+15	11+88	11+88	11+88	VC	
	11+88	12+24	12+24	12+24	VC	
	12+24	12+37	12+37	12+37	DS	10658
	12+37	12+39	12+39	12+97	CS	
	12+97	13+27	13+27	13+97	CS	
	13+97	13+97	13+97	13+97	DS	10654
	13+97	14+08	14+08	14+08	DS	10654
	14+08	14+16	14+16	14+25	CS	
	14+25	16+19	16+19	16+19	VC	
	16+19	16+31	16+31	16+31	VC	
Twin Dr	16+31	17+63				

185sb

Sidewalk Inventory

1865

Start Point: allington - West

End Point: _____

Direction of Increasing Station: rt

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

DS Driveway Cross Slope

PP Pinch Point

CS Panel Cross Slope

PZ Passing Zone

WP Width of Panel

PO Protruding Object

Inspector Name: _____

Date: _____

Total Number of Driveways: 9

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>St James Place</u>	<u>0+00</u>	<u>0+00</u>	<u>0+00</u>	<u>0+00</u>	<u>DS</u>	<u>9069</u>
	<u>0+00</u>	<u>0+82</u>	<u>0+82</u>	<u>1+03</u>	<u>CS</u>	
	<u>1+03</u>	<u>1+31</u>	<u>1+31</u>	<u>1+31</u>	<u>DS</u>	<u>9067</u>
	<u>1+31</u>	<u>2+00</u>	<u>2+00</u>	<u>2+00</u>	<u>DS</u>	<u>9065</u>
	<u>2+00</u>	<u>2+62</u>	<u>2+62</u>	<u>2+62</u>	<u>DS</u>	<u>9063</u>
	<u>2+62</u>	<u>2+97</u>	<u>2+97</u>	<u>2+97</u>	<u>DS</u>	<u>9061</u>
	<u>2+97</u>	<u>3+12</u>	<u>3+12</u>	<u>3+31</u>	<u>CS</u>	
	<u>3+31</u>	<u>3+84</u>	<u>3+84</u>	<u>3+84</u>	<u>DS</u>	<u>9059</u>
	<u>3+84</u>	<u>4+48</u>	<u>4+48</u>	<u>4+48</u>	<u>DS</u>	<u>9057</u>
	<u>4+48</u>	<u>5+17</u>	<u>5+17</u>	<u>5+17</u>	<u>DS</u>	<u>9055</u>
	<u>5+17</u>	<u>5+38</u>	<u>5+38</u>	<u>5+52</u>	<u>CS</u>	
	<u>5+52</u>	<u>5+82</u>	<u>5+82</u>	<u>5+82</u>	<u>DS</u>	<u>9053</u>
	<u>5+82</u>	<u>6+40</u>	<u>6+40</u>	<u>6+40</u>	<u>DS</u>	<u>9051</u>
	<u>6+40</u>	<u>6+54</u>	<u>6+54</u>	<u>6+54</u>	<u>PP</u>	

1865a

Sidewalk Inventory

186

Start Point: allington - west

End Point: _____

Direction of Increasing Station: st

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

DS Driveway Cross Slope

PP Pinch Point

CS Panel Cross Slope

PZ Passing Zone

WP Width of Panel

PO Protruding Object

Inspector Name: _____

Date: _____

Total Number of Driveways: 11

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
	6+54	6+92	6+92	6+92	DS	9049
	6+92	7+36	7+36	7+36	DS	9047
	7+36	7+59	7+59	7+59	DS	9045
	7+59	7+88	7+88	7+88	DS	9043
	7+88	8+50	8+50	8+50	PP + DS	9041
	8+50	9+25	9+25	9+25	DS	9039
	9+25	9+72	9+72	9+84	CS	
	9+84	9+94	9+94	9+94	DS	9037
	9+94	10+81	10+81	10+81	DS	9035
	10+81	10+97	10+97	10+97	PP	
	10+97	11+18	11+18	11+18	DS	9033
	11+18	12+51	12+51	12+51	DS	9029
	12+51	13+20	13+20	13+20	DS	9027
	1320	13+81	13+81	13+81	DS	9025

186sb1

Sidewalk Inventory

Start Point: Alhambra - West

End Point: _____

Direction of Increasing Station: West

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Inspector Name: _____

Date: _____

Total Number of Driveways: 12

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
	13+81	14+43	14+43	14+43	DS	9023
	14+43	14+99	14+99	14+99	DS	9021
	14+99	15+17	15+17	15+17	PO	
	15+17	15+63	15+63	15+63	DS	9019
	15+63	16+19	16+19	16+19	DS	9017
	16+19	16+72	16+72	16+72	DS	9015
	16+72	17+22	17+22	17+22	DS	9013
	17+22	17+84	17+84	17+84	DS	9011
	17+84	18+37	18+37	18+37	DS	+ VC 9009
	18+37	18+56	18+56	18+67	CS	
	18+67	18+97	18+97	18+97	DS	9007
	18+97	19+35	19+35	19+35	DS	9005
	19+35	20+27	20+27	20+27	DS	9003
	20+27	21+41	21+41	21+41	DS	9001

20+41 21+83 21+83 21+94 CS
21+94 22+11 end

186SC

1915

Start Point: Field Crest Dr / Field Crest Ct 192
 End Point: Spring Valley Dr / Field Crest Ct & Sack

1835a

Direction of Increasing Station: _____

Inspector Name: D/T/5
 Date: 3/24/14

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object

DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

Total Number of Driveways: ~~TH~~ ~~TH~~ 1 (1)

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Field Crest Ct.	0+00	0+23	0+23	0+57	VC	
	0+57	1+47	1+47	1+64	VC	
			1+64	1+64	DS	6123 mm' Box.
			1+64	1+81		
	1+81	6+69	6+69	6+69	DS	6135
			6+69	6+78	CS	
	6+78	8+56	7+11	7+11	VC	
			7+19	7+19	VC	
			8+56	9+16	CS	
			8+73	8+73		
			9+16	9+16	DS	6139
	9+16	10+42	10+42	11+30		
			11+02	11+02	DS	6143
	11+30	13+27	12+43	12+43	VC	

1835a

Start Point: Field Crest Dr / Field Crest Ct

Sidewalk Inventory

292

183Sb

End Point: _____

Direction of Increasing Station: _____

Inspector Name: D/T/5

Date: 3/24

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 11/11

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Field Crest Ct.			13+27	13+48	C/S	
	13+48	13+94	13+94	14+24	CS	
			14+15	14+15	DC	6/51
	14+24	14+48	14+48	14+82	CS	
	14+82	15+28	15+28	15+54		
			15+41	15+41		6/53
	15+54	16+22	16+22	16+30	CS	
	16+30	17+01	17+01	17+21		
	17+21	17+43	17+43	17+60		
			17+43	17+43	PO H/C	Bush Trimming
	17+60	19+06	19+06	19+15	CS	
Spring Valley Dr.	19+15					
Field Crest Ct. Cul-de-sac						

183Sb

Start Point: Fieldcrest Dr / Spring Valley Dr ^{Sidewalk Inventory} Rt 192
 End Point: Fieldcrest Dr 1825a

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object

DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

Total Number of Driveways: 111

Inspector Name: DTS
 Date: 3/24/14

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Spring Valley Dr	0+00	1+76	0+47	0+47	VC	
end: Fieldcrest Ct			0+94	0+94	VC	Man hole storm drain
Fieldcrest Ct	0+00	(2+12)	1+76	2+12	CS	
Fieldcrest Ct	0+00	1+00	1+00	1+21	DS/CS	6131
	1+21	1+36	1+36	1+36	VC	
			1+36	1+66	CS	
	1+66	2+55	2+05	2+05	VC	
			2+55	2+71		MB # 6134?
			2+71	2+71	VC	
	2+71	2+85	2+85	3+03	CS	6132
	3+03	3+19	3+19	3+28	CS	
	3+28	3+71	3+41	3+41	VC	
			3+71	3+71	VC	
			3+71	3+92		

1825a

Start Point: Field Crest Dr / Spring Valley Dr RT 292
End Point: Field Crest Dr

Sidewalk Inventory
Field Crest Dr
← on this road

182SB

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

- Inspector Name: _____
Date: _____
- VC Vertical Clearance
 - PP Pinch Point
 - PZ Passing Zone
 - PO Protruding Object
 - DS Driveway Cross Slope
 - CS Panel Cross Slope
 - WP Width of Panel

Total Number of Driveways: 1 (Total 4)

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Field Crest Dr</u> <u>Spring Valley Dr</u>	<u>3+93</u>	<u>4+95</u>				

182SB

Sidewalk Inventory

Start Point: Fieldcroft Dr / Spring Valley Dr Rt.

End Point: Shady Brook

~~6483~~

1515

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: DTJ

Date: 3/24/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 11/1

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Spring Valley Dr	0+00	2+169				
		4+39	1+89	2+189	VC	crack
			2+17	2+17		
			2+49	2+49	VC	Trim branches
			2+169 2+77	2+77	VC	crack
			2+1 3+71	3+99		
			3+75	3+75		6106
	3+99	(6+83)	5+42	5+42	VC	Trim branches
Shady Brook Dr.						

1815

Sidewalk Inventory

Start Point: Spring Meadows Ln / Shady Brook Dr.

End Point: Spring Valley Dr.

2+

5589

11805

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: DTJ

Date: _____

3/24/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 4

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Shady Brook Dr.	0+00	0+48	0+48	0+96	CS	
			0+84	0+84	DS	6101
	0+96	2+29	1+17	1+17	PO	Man hole Storm Drain
			2+04	2+04	VC	Side walk p.p.
			2+12	2+12	VC	1/2" gap
			2+29	3+05	CS	
			2+49	2+49	CS	6103
	3+05	4+45	4+05	4+05	VC	Lip S/W
			4+10	4+10	VC	Crack side walk.
			4+45	4+65	CS	
			4+49	4+49	DS	6107
	4+65	5+12	4+82	4+82	VC	Lip S/W
			5+12	5+39	CS	Major side walk issue
Spring Valley Dr.	(5+39)					

11805

Start Point: Spring Meadow Ln / Fieldcrest Dr. Rt
 End Point: Spring Meadow Circle

495
1795

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: _____
 Date: _____

VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object

DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

Total Number of Driveways: 111

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Fieldcrest Dr.	0+00	1+86	1+23	1+23	VC	1" plus sidewalk
			1+47	1+47	VC	
			1+86	2+14	CS	
	2+14	2+93	2+22	2+22	VC	1" Lug Sidewalk
			2+93	2+93	VC	1" lug.
			2+93	3+13	CS	
	3+13	3+45	3+21	3+21	VC	1/2" Lug SW
			3+45	3+59	CS	
	3+59	3+72	3+72	4+08	CS	
	4+08	4+95				
Spring Meadow Cir	4+95					

1795

1785

1785

Start Point: Shady Brook Dr. / Ridge Field Dr. R+

Sidewalk Inventory

1775

End Point: Spring Meadow La.

~~1732~~

Direction of Increasing Station: _____

Inspector Name: DTJ

Date: 3/24/14

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 11

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Ridge Field Dr.			0+00	0+16		
	0+16	1+39	0+34	0+34	PO	Gas valve box
			0+33	0+33	PO	Tree Trim
			0+95	0+95	VC	1/2" Lip side walk
Fieldcrest Dr.	0+00	0+55	0+39	0+91		Trim trees
			0+55	1+11	DS	
	1+11	2+53	1+94	1+94		Trim Bush.
			2+53	2+65	DS	
	2+65	3+64	3+27	3+27	VC	1/2" Lip
			3+57	3+93		Trim Bushes
			3+64	3+72	CS	
	3+72	4+85	4+64	4+04	VC	2" open joint
			4+72	4+90		Trim bushes
Spring Meadow La.						

1775

Start Point:

Shady Brook Dr / Spring Meadow LA.

Sidewalk Inventory

Rt 192

1765a

End Point:

Wedge Field Dr

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

DS Driveway Cross Slope

PP Pinch Point

CS Panel Cross Slope

PZ Passing Zone

WP Width of Panel

PO Protruding Object

Inspector Name:

DTS

Date:

3/24/14

Total Number of Driveways:

11/11

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Spring Meadow Ln	0+00	1+34	0+77	0+77	VC	1" lip side walk
			1+34	1+47	CS	
	1+47	3+23	1+91	1+91	VC	1/2" lip side walk
			2+13	2+13	VC	3/4" lip SW
			3+23	3+90	CS	
			3+36	3+46	VC	Entire width 1"+
			3+67	3+67	VC	9004
	3+90	4+67	4+75	4+75	VC	9002
	4+67		4+67	4+91	CS	
	4+91	5+07	5+07	5+07	VC	9000
			5+07	5+14	CS	
	5+14	7+86	5+52	5+52	VC	7 1/2" lip SW
			6+71	6+71	VC	1/2" lip SW
			7+86	8+15	CS	

1765a

Sidewalk Inventory

Start Point: Shady Brook Dr / Spring Meadow Rt End 213

End Point: _____

176sb

213

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: DTS
Date: 3/24/14

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 11

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Shady Meadow Dr</u>	<u>8+15</u>	<u>8+43</u>	<u>8+43</u>	<u>8+63</u>	<u>CS</u>	
			<u>8+51</u>	<u>8+51</u>	<u>DS</u>	<u>9007</u>
	<u>8+63</u>	<u>9+49</u>				
			<u>9+49</u>	<u>9+60</u>	<u>CS</u>	
	<u>9+60</u>	<u>10+20</u>	<u>10+20</u>	<u>10+36</u>	<u>CS</u>	<u>Inlet</u>
	<u>10+36</u>	<u>11+25</u>	<u>11+25</u>	<u>11+45</u>	<u>CS</u>	<u>Inlet</u>
	<u>11+45</u>		<u>12+06</u>	<u>12+06</u>	<u>VC</u>	<u>1" joint SW</u>
			<u>12+05</u>	<u>12+35</u>	<u>CS</u>	
	<u>12+35</u>	<u>12+95</u>	<u>12+95</u>	<u>13+12</u>	<u>CS</u>	
	<u>13+12</u>	<u>13+76</u>	<u>13+76</u>	<u>14+68</u>	<u>CS</u>	
	<u>14+68</u>	<u>15+16</u>	<u>15+16</u>	<u>15+52</u>	<u>CS</u>	
			<u>15+24</u>	<u>15+24</u>	<u>VC</u>	<u>1/2" up SW</u>
	<u>15+52</u>	<u>15+96</u>	<u>15+96</u>	<u>16+08</u>	<u>CS</u>	
	<u>16+08</u>	<u>16+65</u>	<u>16+65</u>	<u>17+29</u>	<u>CS</u>	

176sb

Sidewalk Inventory
Start Point: Shady Brook Dr. / Ridge Field Dr RT

1765C

39.3

End Point: _____

Direction of Increasing Station: _____

Inspector Name: D/H/S
Date: 3/27

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: _____

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Spring Meadows	17+29		17+29	17+49	CS	
	17+49	18+09				
Ridge Field Dr						

1765C

Spring Meadow Ls

Sidewalk Inventory

Start Point: ~~Spring Meadow LA~~ / Spring Meadow Cr. / RT 1755

End Point: Spring Meadow LA.

Direction of Increasing Station: Spring Meadow La

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Inspector Name: _____
Date: _____

Total Number of Driveways: 111

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Spring Meadow La	0+00	0+17	0+17	0+51	CS	
Cr.			0+30	0+30	VC	Trim tree
	0+51	3+22	0+60	0+60	VC	Lip 1" +
			1+63	1+63	VC	Lip 1" +
			2+69	2+69	VC	Lip 1"
			3+22	3+58		
			3+58	3+58	VC	Lip
	3+58	4+70	4+39	4+39	VC	Lip
			4+70	4+81	CS	Lip
	4+81	4+95				
Spring Meadow La.						

Sidewalk Inventory

Start Point: Spring Meadows Ln / Spring Meadows Cir RT
 End Point: Shady Brook Dr

1745

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: DTJ
 Date: 3/24/14

VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object

DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

Total Number of Driveways: 11

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Spring Meadows Cir.	0+00	1+68	0+16	0+16	VC	1" lip side walk.
			1+68	1+85	VC	
	1+85		2+10	2+24	VC	Tra trim.
			2+12	2+12	VC	1" lip.
			2+24	2+73	CS	
			2+36	2+36	DS	9010
	2+73	3+10	3+10	3+14		
Shady Brook Dr	3+14	3+24				

1745

Start Point: Field Crest / Spring Meadows CN.

Sidewalk Inventory

Rt

1735

~~8133~~

End Point: Spring Valley Dr.

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: DTJ

Date: 3/24/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 111

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Spring Meadows Ln.	0+00	0+78	0+78	0+88	DS	6/13 Entire Driveway
	0+89	0+168	1+868	1+968	DS	6/13 6/28
			1+968	1+980	CS	
	1+80	2+54	2+54	2+54	DS	6/26
			2+54	2+73	CS	
	2+73	3+43	3+43	3+51	CS	
	3+51		3+63	3+63	VC	Driveway VC 6/24
			4+24	4+24	VC	
			4+81	4+81	VC	
			7+86	7+86	VC	
Spring Valley Dr.	8	8+38	8+23	8+38	CS	

1735

Start Point: Field Crest Dr / Shady Brook Dr Rt

End Point: Spring Valley Dr

1725

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: DTJ
Date: 3/24/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 11

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Shady Brook Dr	0+00	0+38	0+38	0+46	CS	
			0+46	0+46	DC	6101
	0+46	2+99	2+99	3+23		
			3+08	3+08	DS	6107
	3+23	3+39	3+39	4+06		
			3+94	3+94	DS	6109
	3+94	4+75	4+75	4+98		
			4+84	4+84	DS	6111
	4+98	5+22	5+14	5+14	VC	
			5+22	5+91	CS	
			5+74	5+74	DS	6113
	5+91	6+52	6+36	6+36	VC	Man hole Storm Drain
			6+52	6+64	DS	6115
	6+64		6+84	7+10	CS	

Spring Valley Dr.

7+10

7+25

1725

Drive way - Measurement

185- 185 Mailbox # (RT)

11481

Start Point: Field Crest Dr. Cul-de-sack

Sidewalk Inventory Start Keep measn 185 to 190 - 190-190 Mailbox

End Point: Spring Meadows Ln.

Direction of Increasing Station: _____

1715

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Inspector Name: DTJ

Date: 3/24/14

Total Number of Driveways: 5 10

Street Name: Cul-de-sack

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Field Crest Dr. &	0+00		0+00	0+00	DS	DS Mailbox 6/60
			0+00	0+61	CS	Mailbox 6/58
	0+61	1+88	0+61	0+61		Mailbox 6/50 d
			1+88	1+68	DS	Mailbox 6/54
			1+88	2+12	CS	
	2+12	4+40	4+40	4+46	CS	
	4+46	5+74	5+74	5+87	CS	
	5+87	6+23	6+23	6+26	DS	6/46
		6+23	6+23	6+41		
	6+41	8+80	9+80	9+80	DS	6/40
			9+80	10+11	CS	
	10+11	10+45	10+45	10+45	VC	> 1/2"
	10+45	10+80	10+80	11+20		
Spring Meadows Ln	11+20	<u>11+81</u>				

SPR

1715

Sidewalk Inventory

Start Point: Cool Spring Town / Spring Valley Dr

End Point: Spring Valley Dr.

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Inspector Name: DTJ
Date: 3/24/14

Total Number of Driveways: 11

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Spring Valley Dr.	0+00	0+25	0+25	2+11	CS	
			0+75	0+75	DS	6121
			1+78	1+78	DS	6123
	2+11	2+91	2+91	3+10	CS	6125
			3+00	3+00	DS	6125
	3+10	3+43	3+43	4+35	CS	
			3+52	3+52	DS	6127
			3+96	3+96	DS	6129
			4+23	4+23	DS	6128
	4+35	4+55	4+55	4+73	CS	
			4+64	4+64	DS	6126
	4+73	5+53	4+85	4+85	VC	L.P.
			5+53	5+71	CS	
			5+62	5+62	DS	6124

Start Point: Cool Spring Rd / Spring Valley Dr.

Sidewalk Inventory

170sb

2 of 2

End Point:

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name:

Date:

3/24/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Main Hwy 612y	5+71	6+26	6+26	6+52	CS	
			6+34	6+34	DS	6122
	6+52	7+19	7+19	7+36	CS	
			7+28	7+28	DS	6120
	7+36	7+62	7+62	7+91	CS	
Spring Valley Dr.	(7+91)					

170sb

16950

192

Sidewalk Inventory

Start Point: Cool Spring Ter S. Spring Valley Dr. R+

End Point: Spring Valley Dr.

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: DTS
Date: 3/24/14

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: THH 1

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Spring Valley Dr.			0+00	0+08	CS	
	0+08	0+16	0+16	1+08 2+00	CS	
			0+98	0+98	VC	>1" Side walk
			1+09	1+09	VC	" "
	1+15	1+33	1+33	2+00	CS	
			1+82	1+82	DS	6/12
	2+00	5+21	2+40	2+40	VC	grate 1/2" SW
			2+56	2+56	VC	" " "
			3+02	3+02	VC	" " "
			4+61	4+61	VC	" " "
			5+21	6+45	CS	
			5+30	5+30	DS	6/04
			5+82	5+82	DS	6/02
6+45			6+01	6+45	CS	6/00

Ab Drive way 6/01

16952

Sidewalk Inventory

Start Point: Cooling Tr. S Spring Vally Dr R R+ 169sb 292

End Point: _____

Direction of Increasing Station: Spring V. Dr.

Reason Codes for NON-COMPLIANCE:

Inspector Name: DTJ

Date: 3/24/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 11

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Mailbox 6101</u>	<u>6+45</u>	<u>6+65</u>	<u>6+65</u>	<u>6+78</u>	<u>CS</u>	
	<u>6+78</u>	<u>7+13</u>	<u>7+13</u>	<u>7+13</u>	<u>VC</u>	<u>Rip 1" gutter</u>
			<u>7+13</u>	<u>7+38</u>	<u>CS</u>	
	<u>7+38</u>	<u>7+68</u>	<u>7+68</u>	<u>7+68</u>	<u>VC</u>	<u>" "</u>
			<u>7+68</u>	<u>8+06</u>	<u>CS</u>	
	<u>8+06</u>	<u>8+27</u>	<u>8+27</u>	<u>9+90</u>	<u>CS</u>	
			<u>8+36</u>	<u>8+36</u>	<u>DS</u>	<u>6105</u>
			<u>9+53</u>	<u>9+53</u>	<u>DS</u>	<u>6107</u>
	<u>9+70</u>	<u>9+95</u>	<u>9+95</u>	<u>10+14</u>	<u>CS</u>	
			<u>10+05</u>	<u>10+05</u>	<u>DS</u>	<u>6109</u>
	<u>10+14</u>	<u>10+39</u>	<u>10+39</u>	<u>11+60</u>	<u>CS</u>	
			<u>10+90</u>	<u>10+90</u>	<u>DS</u>	<u>6111</u>
	<u>11+60</u>	<u>11+95</u>	<u>11+75</u>	<u>11+75</u>	<u>VC</u>	
			<u>11+95</u>	<u>11+95</u>	<u>DS</u>	<u>6113</u>

Spring Vally Dr 12+15 12+38

169sb

cwc -

1685

192

Sidewalk Inventory

Start Point: Cornwall Turn / Spring Valley Dr. BT

End Point:

Direction of Increasing Station: Spring Valley Dr Cornwall Pl.

Reason Codes for NON-COMPLIANCE:

Inspector Name: DTS
Date: 3/24/14


VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 17/1

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Spring Valley Dr.	0+00	0+50	0+52	1+07	CS	
			0+60	0+62	DS	Mm' 1 6/21
	0+62	0+95	0+95	0+95	PO	Tree Bush Train
	1+07	1+59	1+59	1+95	CS	6/23
			1+70	1+70	DS	6/23
	1+95	2+56	2+56	2+78	CS	
			2+66	2+66	DS	6/25
	2+78	3+17	3+17	3+47	N/A	
			3+28	3+28	DS	6/27
	3+47		3+17	3+89	CS	
	3+89	4+36	4+05	4+05	VC	Sidewalk Feet 1/2"
			4+36	4+60	CS	
			4+46	4+46	DS	6/29
	4+46	5+80				

1685a

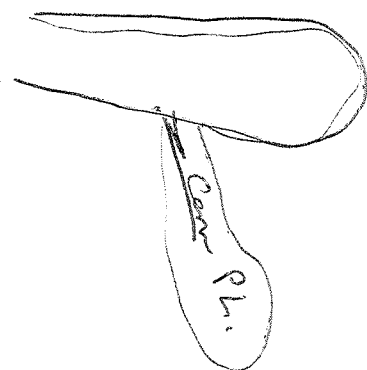

Start Point: Cornwall Terrace / Sidewalk Inventory

End Point: Cornwall PL

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: DTS

Date: 3/24/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope


WP Width of Panel

Total Number of Driveways: 111

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Cornwall Terrace			5+80	6+23	CS	
	6+23	6+59	6+59	7+35	CS	
			7+11	7+11	DS	6135
	7+35	7+48	7+48	8+43	CS	
			7+58	7+58	DS	6136
			8+26	8+26	DS	6134
	8+43	8+90	8+90	9+25	CS	
			9+01	9+01	DS	6132
	9+25	9+52	9+52	9+75	CS	
			9+62	9+62	DS	6130
	9+75	10+19	10+19	10+62	CS	
			10+30	10+30	DS	6128
	10+62	10+87	10+87	10+98	CS	
	10+98	11+31	11+31	11+39	CS	
Cornwall PL	11+39	11+47	11+48	11+48	DS	Left Side Hand Lane

168sb

Com-won

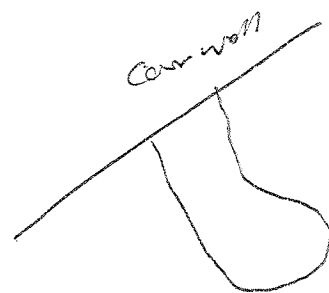A hand-drawn signature or mark consisting of a diagonal line with a loop underneath it.

Place circle
Sidewalk Inventory

Start Point: Cornwall Terr / Cornwall Place R + 1675

End Point: Cornwall Terr

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: DTJ
Date: 3/24/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 111

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Cornwall Place			0+00	0+93	CS	
			0+77	0+77	DS	6/31
	0+93	1+18	1+18	2+43	CS	
			1+26	1+26	DS	6/33
			1+66	1+66	DS	6/35
			1+97	1+97	DS	6/34
	2+43	2+61	2+61	2+96	CS	
			2+70	2+70	DS	6/32
	2+96	3+35				
Cornwall Terr.	3+35					

1675

Sidewalk Inventory

Start Point: Cornwall ter / Cornwall PL. RT

End Point: Spring valley Dr.

1665

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: DTJ

Date: 3/24/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 11

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Cornwall Place</u>			<u>0+00</u>	<u>0+15</u>	<u>CS</u>	
	<u>0+15</u>	<u>0+37</u>	<u>0+35</u>	<u>1+26</u>	<u>CS</u>	
		<u>35</u>	<u>1+08</u>	<u>1+08</u>	<u>DS</u>	<u>6122</u>
	<u>1+26</u>	<u>1+61</u>	<u>1+38</u>	<u>1+38</u>	<u>VC</u>	<u>Ex Log 1/2" or greater</u>
	<u>1+38</u>	<u>1+61</u>	<u>1+61</u>	<u>2+21</u>	<u>CS</u>	
			<u>1+71</u>	<u>1+71</u>	<u>DS</u>	<u>6120</u>
	<u>2+21</u>	<u>2+29</u>				
<u>Spring valley Dr.</u>	<u>2+29</u>					

1665

1655

Sidewalk Inventory

Start Point: St James Pl @ Corporate DrEnd Point: Corporate Dr

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF 302Date: 3-24-14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 8 LT & 6 on RT

Street Name: <u>ST James Pl</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Corporate Dr	0+00	2+69	2+69	2+97	CS	No PZ
Allington Manor Cr W	0+00	1+96	1+96	1+96	DS	5340 No PZ
	1+96	2+50	2+50	3+60	CS	
			3+42	3+42	DS	5344
	3+60	5+19				END @ Allington Manor Cr W
Corporate Dr	0+00	0+72	0+72	0+72	VC	
	0+72	0+82				
Pool Entrance Rd.	0+00	1+40	1+40	1+40	VC	
	1+40	1+85				
Allington Manor Cr E	0+00	2+70	2+70	2+70	VC	
	2+70	3+76	3+76	3+76	VC	
	3+76	4+27	4+27	4+27	VC	
	4+27	4+96				END @ Allington Manor Cr E

1655

Start Point: Brandford Ln @ Corporate Dr (loop) Sidewalk Inventory

End Point: Corporate Dr

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF B02
Date: 3-24-14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 0

Street Name: <u>Brandford Ln.</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Corporate Dr	0+00	0+86	0+86	1+27	CS	
	1+27	1+67	1+67			
Viceroy CT	0+00	0+11	0+11	0+67	CS	
	0+67	0+79	0+79	1+53		
	1+53	2+26	2+26	2+36	CS	No PZ's
	2+36	3+38	3+38	3+58	CS	
	3+58	3+62				
Lyndale Way ¹	0+00	1+83	2+17	5+07	CS	No PZ's
Lyndale Way ²	0+00	0+74				* 0+25 hole in sidewalk 3" x 2.5"
						END @ Corporate Dr. ↓

Sidewalk Inventory

Start Point: Ivywood Dr N @ Corporate Dr

End Point: Corporate Dr

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF302
Date: 3-24-14

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 26

LT

Street Name: <u>Ivywood Dr N</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Corporate Dr	0+00	0+12	0+12	0+12	VC	
	0+12	4+51	4+51	4+51	VC	No PZ's
	4+51	5+95	5+95	5+95	VC	
	5+95	7+20				
Fielding Ct	0+00	3+63	3+63	3+63	VC	No PZ's
	3+63	5+45	5+45	5+45	VC	
Corporate Dr	5+45	11+26	11+26	11+44	CS	No PZ's
						End @ Corporate Dr

Sidewalk Inventory

Start Point: Morrow Way @ Inwood Dr N

End Point: Inwood Dr N

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Inspector Name: BF602
Date: 3-24-19

Total Number of Driveways: 10



Street Name: ^{RT} Morrow Way	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Inwood Dr N	6+00	2+15	2+15	2+32	CS	No PZ's
	2+32	4+51	4+51	4+55	CS	No PZ's
	4+55	6+32	6+32	6+43	CS	No PZ's
	6+43	7+64				End @ Inwood Dr N


Sidewalk Inventory

1615a

Start Point: Baron CT @ Chillingham PlEnd Point: Chillingham Pl

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

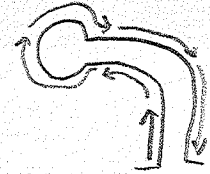Inspector Name: BF102
Date: 3-24-14VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding ObjectDS Driveway Cross Slope
CS Panel Cross Slope
WP Width of PanelTotal Number of Driveways: 25

Street Name: <u>Baron CT</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
	0+00	0+49	0+49	0+49	DS	6902
	0+49	0+87	0+87	0+87	DS	6904
	0+87	1+57	1+57	1+57	PP/VC	Storm Drain Inlet
	1+57	2+34	2+34	2+34	✓C	
	2+34	3+10	3+10	3+10	DS	6906
	3+10	3+56	3+56	3+56	PP/VC	Storm Drain Inlet
	3+56	4+23	4+23	4+23	DS	6908
	4+23	5+18	5+18	5+18	DS	6910
	5+18	5+96	5+96	5+96	DS	6912
	5+96	6+32	6+32	6+32	DS	6914
	6+32	6+42	6+42	6+42	PP/VC	Storm Drain Inlet
	6+42	7+50	7+50	7+50	DS	6916
	7+50	8+53	8+53	8+53	DS	6918
	8+53	8+89	8+89	8+89	DS	6920

1615a

Start Point: Baron CT @ Chillingham Pl Sidewalk Inventory

161sb

End Point: Chillingham CT

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: RF 302
Date: 3-24-14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: See Sheet 1

Street Name: <u>Baron CT</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
	8+89	9+16	9+16	9+16	DS	6922
	9+16	9+43	9+43	9+43	DS	6924
	9+43	9+65	9+65	9+65	DS	6925
	9+65	9+93	9+93	9+93	DS	6923
	9+93	10+01	10+01	10+01	VC	-
	10+01	10+09	10+09	10+09	VC	
	10+09	10+27	10+27	10+27	DS	6921
	10+27	10+57	10+57	10+57	DS	6919
	10+57	11+88	11+88	11+88	DS	6917
	11+88	12+22	12+22	12+22	DS	6915
	12+22	12+53	12+53	12+53	VC	
	12+53	13+00	13+00	13+00	DS	6913
	13+00	13+53	13+53	13+53	VC	
	13+53	13+68	13+68	13+68	DS	6911

161sb

Start Point: Baron CT @ Chillingham Pl

Sidewalk Inventory

161SC

End Point: Chillingham Pl

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF B02
Date: 3-24-14

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: See Sheet 1

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
	13+68	14+41	14+41	14+41	DS	6909
	14+41	15+05	15+05	15+05	DS	6907
	15+05	16+00	16+00	16+00	DS	6905
	16+00	16+75	16+75	16+75	DS	6903
	16+75	17+46	17+46	17+46	DS	6901
	17+46	19+82				END @ Chillingham Pl

Sidewalk Inventory

Start Point: Allington Manor Cir. E @ ST. James Pl

1605a

End Point: ST. James Pl


Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF 602
Date: 3-24-14

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

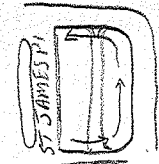

Total Number of Driveways: 7

Compliant		Non-Compliant				Comments
Street Name: <u>Allington Manor Cir E</u>	From	To	From	To	Code	
<u>St. James Pl</u>	<u>0+00</u>	<u>1+91</u>				
<u>Hever Way</u>	<u>0+00</u>	<u>0+17</u>	<u>0+17</u>	<u>0+17</u>	<u>VC</u>	
	<u>0+17</u>	<u>1+23</u>	<u>1+23</u>	<u>1+23</u>	<u>DS</u>	<u>7008</u>
	<u>1+23</u>	<u>1+53</u>	<u>1+53</u>	<u>1+53</u>	<u>PP/VC</u>	<u>Storm Drain Inlet</u>
	<u>1+53</u>	<u>1+90</u>				<u>Crosswalk Ramp</u>
<u>Crosswalk Ramp</u>	<u>0+00</u>	<u>0+78</u>	<u>0+78</u>	<u>0+78</u>	<u>VC</u>	
	<u>0+78</u>	<u>1+03</u>	<u>1+03</u>	<u>1+03</u>	<u>PP/VC</u>	<u>Storm Drain Inlet</u>
	<u>1+03</u>	<u>1+32</u>	<u>1+32</u>	<u>1+32</u>	<u>DS</u>	<u>7010</u>
	<u>1+32</u>	<u>2+23</u>	<u>2+23</u>	<u>2+23</u>	<u>DS</u>	<u>7012</u>
	<u>2+23</u>	<u>2+61</u>	<u>2+61</u>	<u>2+61</u>	<u>PP/VC</u>	<u>Storm Drain Inlet</u>
	<u>2+61</u>	<u>3+30</u>	<u>3+30</u>	<u>3+30</u>	<u>DS</u>	<u>7014</u>
	<u>3+30</u>	<u>4+15</u>	<u>4+15</u>	<u>4+15</u>	<u>DS</u>	<u>7016</u>
	<u>4+15</u>	<u>4+97</u>	<u>4+97</u>	<u>4+97</u>	<u>DS</u>	<u>7018</u>
	<u>4+97</u>	<u>5+40</u>	<u>5+40</u>	<u>5+40</u>	<u>DS</u>	<u>7020</u>
	<u>5+40</u>	<u>5+92</u>	<u>5+92</u>	<u>5+92</u>	<u>VC</u>	
	<u>5+92</u>	<u>8+53</u>				

1605a

Start Point: Allington Manor Cir E @ St. James Pl

1605b

End Point: St. James Pl

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: 302
Date: 3-24-11

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: See Sheet 1

[illegible]

1605b

1595 L2 + side

Sidewalk Inventory
 Start Point: Brandford La at Corporate Dr.
 End Point: Corporate Dr.

Direction of Increasing Station: _____

Inspector Name: SC. RH
 Date: March 29, 2014

Reason Codes for NON-COMPLIANCE:
 VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object
 DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

Total Number of Driveways: 0

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Corporate	0+00	1+79				
Monk's Crossing	0+00	1+05				
Wiltshire Dr	0+00	1+22	1+22	1+22	VC	
	1+22	1+33	1+33	1+33	VC	
	1+33	1+41	1+41	1+41	VC	No Passing Zones
	1+41	1+54	1+54	1+54	VC	
	1+54	1+89	1+89	1+89	VC	
	1+89	2+62	2+62	2+62	VC	
	2+62	4+31	4+31	4+49	CS	end
UPShur Dr,	0+00	1+71				
Westcott Cir.	0+00	1+40	1+40	1+67	CS	end
Aerie P1	0+00	0+75				end at Corporate Dr.

1595

Sidewalk Inventory

Baron Ct



Start Point:

Chillingham Place at Chillingham Place

End Point:

Chillingham Place at Hallard Ct

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name:

RH. SC.

Date:

March 24, 2014

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 16

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Baron Ct: R	0+00	4+46	4+46	4+69	CS	
	4+69	5+08	5+08	5+08	VC	
Hallard Ct	5+08	11+03				end

1 of 2

157sa

(right)

Sidewalk Inventory

Start Point: Holland St at Chillingham Place

End Point: _____

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Inspector Name: _____

Date: _____

Total Number of Driveways: 18

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Chillingham Pl			0+00	0+21	CS	
	0+21	0+21	0+21	0+21	DS	MB 6802
	0+21	1+28	1+28	2+33	CS	
	2+33	2+37	2+37	2+37	DS	MB 6804
	2+37	3+16	3+16	3+16	DS	MB 6806
	3+16	3+55	3+55	3+55	DS	MB 6808
	3+55	4+76	4+76	4+76	DS	MB 6810
	4+76	5+13	5+13	5+13	DS	MB 6812
	5+13	6+06	6+06	6+06	DS	MB 6814
	6+06	6+34	6+34	6+34	DS	MB 6816
	6+34	6+57	6+57	6+57	DS	MB 6818
	6+57	6+85	6+85	6+85	DS	MB 6817
	6+85	7+11	7+11	7+11	DS	MB 6815
	7+11	7+35	7+35	7+35	DS	MB 6813

157sa

Start Point:

Hallart Ct at Chilling Ham Place

End Point:

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name:

SC, RH

Date:

March 24, 2014

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 18

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
	7+35	7+75	7+75	7+75	DS	MB 6811
	7+75	8+66	8+66	8+66	DS	MB 6809
	8+66	9+76	9+76	9+76	DS	MB 6807
	9+76	10+14	10+14	10+14	DS	MB 6805
	10+14	10+82	10+82	10+91	CS	
			10+91	10+91	DS	MB 6803
	10+91	11+49	11+49	11+69	CS	at inlet.
	11+69	11+89	11+89	11+89	VC	
			11+89	11+89	DS	MB 6801
	11+89	12+11	12+11	12+31	CS	
	12+31	13+29	13+29	14+22	CS	end

157sb

Right side

15

Sidewalk Inventory

Start Point:

Ivy wood Dr. N

End Point:

Corporate Dr.

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name:

S.G. / R.H.

Date:

March 24, 2014

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 16

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Corporate			0+00	0+20	CS	
	0+20	0+48	0+48	0+48	VC	
	0+48	0+63	0+63	0+63	DS	
	0+63	1+77	1+77	1+77	VC	
	1+77	1+94				End
Morrow Way	0+00	0+19	0+19	0+19	VC	No Passing Zones
	0+19	0+86	0+86	0+86	VC	
	0+86	2+07	2+07	2+07	VC	
	2+07	3+42	3+42	3+62	CS	
	3+62	4+39	4+39	4+39	VC	
	4+39	6+50				end
Morrow Way	0+00	5+88	5+88	5+94	CS	No passing 0+00 - 6+00
	5+94	7+19				

1565

ISSS Right

Start Point: Fielding Ct at Ivywood Dr.

End Point:

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: SC/24
Date: May 24, 2014

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 8

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Ivywood Dr.	0+00	4+70				Right side

ISSS

ISAS Left side

Sidewalk Inventory

Start Point: Monmouth Way at Ivywood Dr. North
 End Point: Ivywood Dr. north

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: S.G. RV.
 Date: March 24, 2014
 VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object
 DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

Total Number of Driveways: 5

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Ivywood Dr. North	6+00	0+09	0+09	0+09	VC	
	0+09	3+47	3+47	3+47	VC	
	3+47	4+84	4+84	4+84	VC	
	4+84	5+44	5+44	5+44	VC	
	5+44	7+04				

Start Point: Allington Manor at Allington Manor Circle East

End Point:

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: RH/S.C.
Date: March 24, 2014

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 11

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Allington Manor Circle	0+00	0+18	0+18	0+18	PP	
	0+18	0+81	0+81	0+81	VC	
	0+81	3+06	3+06	3+06	VC	
	3+06	4+94	4+94	4+94	DS	MB 5313
	4+94	5+25	5+25	5+25	DS	MB 5311
	5+25	6+08	6+08	6+08	VC	
	6+08	6+38	6+38	6+38	DS	MB 5309
	6+38	6+75	6+75	6+75	DS	MB 5307
	6+75	7+55	7+55	7+55	DS	MB 5305
	7+55	8+31	8+31	8+31	VC	
	8+31	8+44	8+44	8+44	PP, WP VC	VC at inlet
	8+44	8+60	8+60	8+60	DS	MB 5303
	8+60	9+20	9+20	9+20	DS	MB 5301
						No Passing Zones

1525 RI 11

Sidewalk Inventory

Start Point: Allington Manor Circle East and St. James
 End Point: Allington Manor Ct.

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: SC RH
 Date: March 24, 2014

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 1

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
St. James			0+00	0+27	CS	
	0+27	0+87	0+89	0+98	CS	
Entrance to swimming pool			0+00	0+64	CS	
			0+64	0+64	WP	PP, VC - inlet
			0+64	0+76	CS	
	0+76	2+26	2+26	2+45	CS	
			2+45	2+45	DS	MB 7009
			2+68	2+68	CS	WP inlet
Allington Manor Ct	2+68	2+99				end

1525

Sidewalk Inventory

Start Point: Allington Manor Circle East at Allington Manor Ct.

End Point:

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: R.H. S.C.
Date: March 24, 2014

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 18

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Allington Manor Ct	0+00	0+73	0+73	0+73	DS	MB 7011
	0+73	1+06	1+06	1+22	CS	
	1+22	1+40	1+40	1+40	DS	MB 7013
	1+40	1+81	1+81	1+93	CS	
	1+93	2+13	2+13	2+13	DS	MB 7015
	2+13	2+62	2+62	2+78	CS	in let wp
	2+78	2+78	2+90	2+90	DS	MB 7017
	2+90	3+67	3+67	3+67	DS	MB 7019
	3+67	4+96	4+96	4+96	VC	
			4+96	4+96	DS	MB 7023
	4+96	5+69	5+69	5+69	DS	MB 7025
	5+96	6+07	6+07	6+07	DS	MB 7027
	6+07	6+63	6+63	6+63	DS	MB 7029
	6+63	6+97	6+97	6+97	DS	MB 7031

151sb 2082

R'ght

Sidewalk Inventory

Start Point: Allington Manor Circle East at Allington Manor Ct.
End Point: St. James

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: J.C. R.H.
Date: 5/24/14

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
	6+97	7+90	7+90	7+90	PS	MB 70 33
	7+90	8+54	8+54	8+54	PS	MB 70 35
	8+54	9+04	9+04	9+04	DS	MB 70 37
	9+04	9+71	9+71	9+71	DS	MB 70 39
	9+71	10+42	10+42	10+42	DS	MB 70 41
	10+42	11+22	11+22	11+22	DS	MB 70 43
	11+22	11+88	11+88	11+88	VC	WP at inlet
	11+88	12+66	12+66	12+66	DS	MB 70 45
	12+66	13+04	13+04	13+11	CS	inlet
St. James	13+11	13+20				end No Passing Zones

151sb

Sidewalk Inventory

Start Point: Coronet Ct. / Allington Manor Cir. w (Right)

End Point: _____

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: S.C. / R.H.

Date: March 24, 2014

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 16

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
	0+70	2+05	2+05	2+05	VC	
	2+05	2+09	2+09	2+09	DS	MB 5307
	2+09	3+57	3+57	3+57	VC	
	3+57	3+74	3+57	3+74	DS	MB 5313
	3+74	4+59	4+59	4+68	CS	
	4+68	4+80	4+80	4+80	VC	
	4+80	9+51				End No Passing Zones

1495

Start Point: Taran CT @ Sovereign PLS

End Point: Sovereign PLS


Direction of Increasing Station:

Inspector Name: RE 102
Date: 3-21-14

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

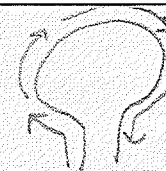

Total Number of Driveways: 8

Street Name: Taran CT	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Sovereign PLS	0+00	0+52	0+52	0+52	VC	
	0+52	1+57	1+57	1+57	VC	No PZ
	1+57	2+53	2+53	3+09	CS	
	2+53	2+76	2+76	2+76	DS	6917
			3+01	3+01	DS	6915
	3+09	4+02	4+02	4+02	VC	No PZ
Sovereign PLS	4+02	509				END @ Sovereign PLS

1495

Sidewalk Inventory

Start Point: Sovereign Dr S @ Sovereign Pl

End Point: Sovereign Pl

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF 302
Date: 3-20-14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 21

LT

Street Name: Sovereign PLS

	Compliant		Non-Compliant			
Street Name:	From	To	From	To	Code	Comments
Sovereign Pl	0+00	0+72	0+72	6+72	DS	5329
	0+72	1+53	1+53	1+53	DS	5325
	1+53	1+92	1+92	2+23	CS	
Taran CT	0+00	0+44	0+44	0+44	DS	5321
	0+44	0+53	0+53	0+69	CS	-
	0+69	1+64	1+64	1+64	DS	5311
	1+64	3+50	3+50	3+50	DS	5309
	3+50	4+30	4+30	4+30	DS	5307
	4+30	5+65	5+65	5+65	DS	5305
	5+65	5+13	5+13	5+28	CS	
	5+28	5+44	5+44	5+44	VC	
	5+44	5+86	5+86	5+86	DS	5303
	5+86	6+21	6+21	6+21	DS	5301
	6+21	6+53	6+53	6+81	CS	


14852

5330
Sovereign PI

Cutoff

Sovereign PL S

Sovereign PI N

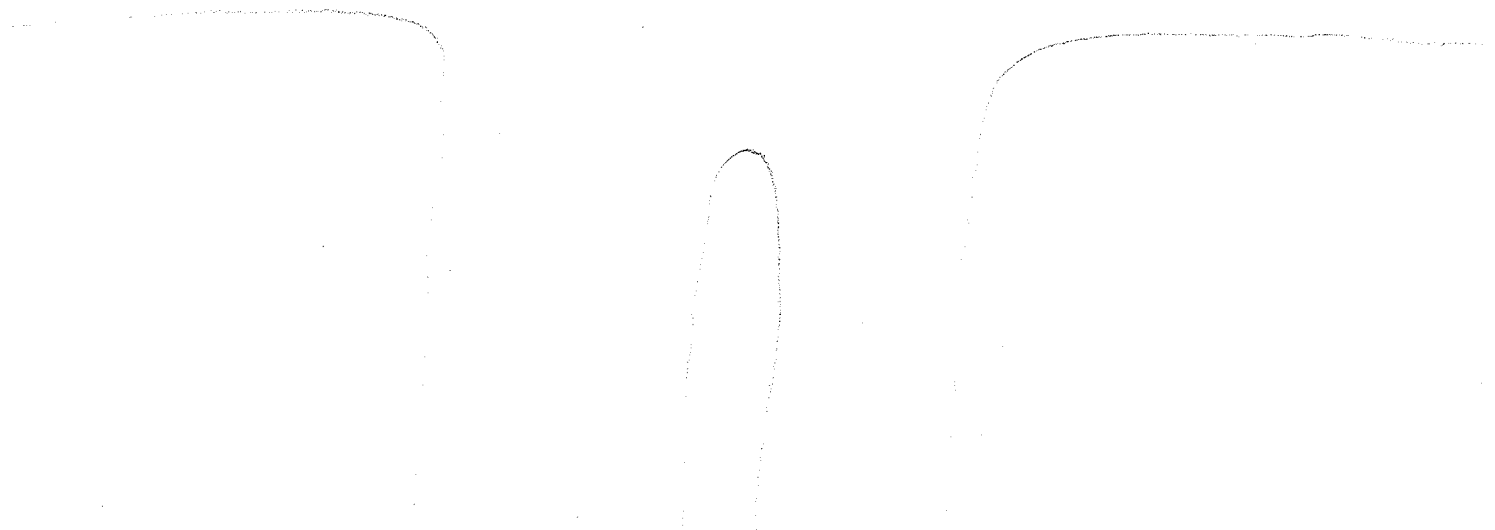

Sidewalk Inventory

Start Point: Sovereign Dr S (at Sovereign Dr)

End Point: Sovereign Dr

Direction of Increasing Station: _____

Inspector Name: BF 307

Date: 3-21-11

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: _____

Street Name: <u>Sovereign PLS</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
conti	6+81	6+90	6+90	6+90	DS	5300
	6+90	7+37	7+37	7+37	DS	5302
	7+37	8+14	8+14	8+39	CS	
			8+31	8+31	DS	5304
	8+39	9+01	9+01	9+12	CS	
			9+17	9+17	DS	5306
	9+48	9+58	9+58	9+58	DS	5308
		9+92	9+92	10+30	CS	European Bank
Evergreen	0+01	0+52				European Bank
Evergreen	0+52		0+00	0+34	CS	
	0+30	0+43	0+43	0+43	DS	5318
	0+43	1+12	1+12	1+12	DS	5320
	1+12	2+02	2+02	2+02	DS	5322
			2+17			5324

1485b



3053

1AGSC

14850

End Point: TVY Used Dr S

7

[illegible]

1461

Start Point: Ivywood Dr S @ Bradley Way

End Point: Corporate Dr

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF, JH
Date: 3/21/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 11

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Bradley Way	0+00	1+22	1+22	1+22	VC	
	1+22	4+90	4+90	4+96	CS	
	4+96	5+52	5+52	5+52	VC	
	5+52	7+30	7+36	7+36	VC	
	7+36	7+51				
Bradley Way E	0+00	0+12	0+12	0+24	CS	1
	0+24	4+24	4+24	4+24	VC	No PZ's
			4+24	4+47	CS	
	4+47	4+92	4+92	4+92	VC	
	4+92	4+98	4+98	4+98	VC	
	4+98	6+16	6+16	6+16	DS	Lot 5204
	6+16	6+48	6+48	7+08	CS	
	7+08	7+32				
Wythe CT	0+00	0+09	0+09	0+30	CS	
	0+30	1+37				
						END @ Corporate Dr

1465

Sidewalk Inventory

Start Point: Henden Wood Ln @ Kingsbrook Dr

End Point: Kingsbrook Dr


Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: 7302
Date: 3-21-14

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

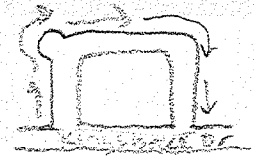

Total Number of Driveways: 12

LT

Street Name: <u>Henden Woods Ln</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Kingsbrook Dr	0+00	0+34	0+34	0+45	CS	
	0+45	1+26	1+26	1+50	CS	
	1+50	2+64	2+64	2+72	CS	
	2+72	3+66	3+66	3+66	VC	
	3+66	4+33	4+33	4+33	DS	5318 -
	4+33	7+97	7+97	7+97	VC	
	7+97	8+45	8+45	8+45	DS	5328
	8+45	9+96	9+96	9+96	VC	
Kingsbrook Dr.	9+96	13+16				end @ Kingsbrook Dr

Sidewalk Inventory

Start Point: Kingsbrook Dr @ Corporate Dr

End Point: Corporate Dr

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Inspector Name: BFB/JH
Date: 3-21-14

Total Number of Driveways: 13

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Kingsbrook Dr	0+00		0+00	0+32		
	0+32	2+81	2+81	2+93	CS	No PZ's
	2+93	3+10				
Sovereign Pl	0+00	1+68	1+68	1+68	VC	
	1+68	1+83	1+83	1+83	VC	
	1+83	2+19	2+19	2+19	VC	
	2+19	3+43	3+43	3+60	CS	
	3+60	4+20	4+20	4+20	DS	6" 5240
	4+20	4+84	4+84	5+05	CS	
	5+05	6+46	6+46	6+72	CS	
			6+46	6+46	PO	Tree limbs
	6+72	7+45	7+45	7+50	CS	
Bellenger Creek Elem. #1			0+00	1+55	CS	
	1+55	2+98	2+98	3+24	CS	

10.4
1445a

1445a

Sidewalk Inventory

Start Point: Kingsbrook Dr @ Corporate Dr

End Point: Corporate Dr

144Sb

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF502
Date: 3-21-14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: _____

Street Name: <u>Kingsbrook Dr</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Cont</u>	<u>3+34</u>	<u>3+76</u>	<u>4+76</u>	<u>5+72</u>	<u>CS</u>	
<u>3 Lower Creek Elev #2</u>			<u>0+00</u>	<u>0+43</u>	<u>CS</u>	
	<u>0+43</u>	<u>1+23</u>	<u>1+23</u>	<u>1+47</u>	<u>CS</u>	
	<u>1+47</u>	<u>2+32</u>	<u>2+32</u>	<u>2+53</u>	<u>CS</u>	
	<u>2+53</u>	<u>2+82</u>				
<u>Bamburg CT</u>			<u>0+00</u>	<u>0+46</u>	<u>CS</u>	
	<u>0+46</u>	<u>0+71</u>	<u>0+71</u>	<u>0+71</u>	<u>VC</u>	
			<u>0+71</u>	<u>0+91</u>	<u>CS</u>	
	<u>0+91</u>	<u>1+11</u>	<u>1+11</u>	<u>1+11</u>	<u>VC</u>	
	<u>1+11</u>	<u>1+73</u>	<u>1+73</u>	<u>1+97</u>	<u>CS</u>	
<u>Earles CT</u>			<u>0+00</u>	<u>0+24</u>	<u>CS</u>	
	<u>0+24</u>	<u>0+89</u>	<u>0+89</u>	<u>1+05</u>	<u>CS</u>	
	<u>1+05</u>	<u>1+70</u>	<u>1+70</u>	<u>1+98</u>	<u>CS</u>	
<u>Regal CT</u>			<u>0+00</u>	<u>1+20</u>	<u>CS</u>	

144Sb

Sidewalk Inventory

1445C 3 of 4

Start Point: Kingsbrook Dr @ Corporate Dr

End Point: Corporate Dr

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: JF 302
Date: 3-21-14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways:

Street Name: RT Kingsbrook Dr	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Cont.	1+26	2+64	2+64	3+27	CS	
			3+03	3+03	PO	Tree branches
	3+27	3+48	3+68	3+71	CS	
Duke Ct	0+00		0+00	0+58	CS	
			0+27	0+27	PO	Tree branches
	0+58	1+48	1+48	1+48	VC	
	1+48	1+86	1+86	1+86	VC	
	1+86	3+65	3+65	3+65	VC	
	3+65	3+97	3+97	3+97	VC	
	3+97	4+87	4+87	4+95	CS	
	4+95	7+14				
ST Mapes Ct	0+00	0+39	0+39	0+39	VC	
	0+39	1+62	1+75	1+75	DS	W# 5313/5311
	1+75	1+92	1+92	2+15	CS	

1445C

Sidewalk Inventory

Start Point: Kingsbrook Dr @ Corporate Dr

End Point: Corporate Dr

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF302
Date: 3-21-14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: _____

Street Name: <u>Kingsbrook Dr</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Cont.	2+15	3+61	3+61	3+61	VC	
	3+61	5+63	5+63	5+63	VC	
	5+63	6+16				END @ Corporate Dr

144sd

144sd

1435

Sidewalk Inventory
Start Point: Sovereign PL @ Kingsbrook Dr
End Point: Sovereign PL S

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: REJOE
Date: 3-21-14

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 4

Street Name: Sovereign PL LT	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Kingsbrook Dr	0+00	1+71	1+31	1+31	VC	
	1+31	1+71	1+71	1+71	VC	
	1+71	1+81	1+81	1+81	DS	6915
Sovereign PL S	1+81	4+26				END @ Sovereign PL S

1435

Sidewalk Inventory

Start Point: St. Marys CT @ Kingsbrook DrEnd Point: Kingsbrook Dr

Direction of Increasing Station: _____

Inspector Name: BF602Date: 3-21-14

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 13

Street Name: <u>St. Marys CT</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Kingsbrook Dr	0+00	1+65	1+65	1+65	VC	
	1+65	1+73	1+73	1+73	VC	
	1+73	1+85	1+85	2+01	CS	
	2+01	2+73	2+73	2+73	VC	
	2+73	3+76	3+76	3+76	PO	Bush
	3+76	6+05	6+05	6+05	PO	Bush
	6+05	9+08	9+08	9+40	CS	
	9+40	9+92	9+92	9+92	VC	
	9+92	10+44	10+44	10+53	CS	
	10+53	10+84	10+84	10+84	DS	45350
	10+84	11+08	11+08	11+42	CS	
	11+42	12+49	12+49	12+56	CS	
Kingsbrook Dr	12+56	13+15				END @ Kingsbrook Dr

Sidewalk Inventory

1415

Start Point: Sovereign PL @ Kingsbrook

End Point: Sovereign PL

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: RH/SC
Date: 3/26/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 5

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Kingsbrook DR	0+00	0+11	0+11	0+37	CS	
	0+37	2+00	2+00	2+100	PZ	NO PZ
	2+00	2+22	2+22	2+48	CS	
	2+48	3+27	3+27	3+27	VC	
	3+27	4+01	4+01	4+01	DS	60910
	4+01	4+91				

1415

142

Sidewalk Inventory

Start Point: PALACE CT @ SOUTHERN PL NORTH

End Point: 4 4 2

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: RA/SC
Date: 3/21/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 10

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Southern Pl North</u>	<u>0+00</u>	<u>1+03</u>	<u>1+03</u>	<u>1+03</u>	<u>VC</u>	
	<u>1+03</u>	<u>2+32</u>	<u>2+32</u>	<u>2+56</u>	<u>CS</u>	
	<u>2+56</u>	<u>2+72</u>	<u>2+72</u>	<u>2+89</u>	<u>CS</u>	
	<u>2+89</u>	<u>4+41</u>	<u>4+41</u>	<u>4+41</u>	<u>DS</u>	<u>6/12</u>
	<u>4+41</u>	<u>5+53</u>	<u>5+53</u>	<u>5+53</u>	<u>IC</u>	
	<u>5+53</u>	<u>5+69</u>	<u>5+69</u>	<u>5+69</u>	<u>IC</u>	
	<u>5+69</u>	<u>6+37</u>				

1405

Sidewalk Inventory

1395

Start Point: Sovereign Place abn @ Sovereign PL

End Point: Sovereign PL Medium

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: RA/SC
Date: 3/21/13

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 11

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Sovereign PL</u>	<u>0+00</u>	<u>1+81</u>	<u>1+81</u>	<u>1+81</u>	<u>DS</u>	<u>5335</u>
<u>PLACE CT</u>	<u>1+81</u>	<u>2+32</u>				
<u>Palace CT</u>	<u>0+00</u>	<u>0+57</u>	<u>0+57</u>	<u>0+72</u>	<u>CS</u>	
<u>Sovereign PL Medium</u>	<u>3+72</u>	<u>3+46</u>	<u>3+46</u>	<u>3+60</u>	<u>CS</u>	
	<u>3+60</u>	<u>4+45</u>	<u>4+45</u>	<u>4+45</u>	<u>DS</u>	<u>5336</u>
	<u>4+45</u>	<u>5+35</u>	<u>5+35</u>	<u>5+35</u>	<u>DS</u>	<u>5334</u>
	<u>5+35</u>	<u>6+14</u>	<u>6+14</u>	<u>6+14</u>	<u>DS</u>	<u>5332</u>
	<u>6+14</u>	<u>6+82</u>				

1395

Sidewalk Inventory

1382

Start Point: HENDEN WOOD LA @ KINGSBROOK DR

End Point: 1

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: RHSC
Date: 3/2/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 10

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Kingsbrook Dr	0+00	3+89	3+89	4+01	CS	
Unnamed ramp	4+01	6+60	6+60	6+60	PZ	
	6+60	7+10	7+10	7+10	DS	5327
	7+10	7+40	7+40	7+61	CS	
	7+61	8+60	8+60	8+60	PZ	
	8+60	9+48	9+48	9+48	DS	5329
	9+48	9+59	9+59	9+67	CS	
	9+67	10+18	10+18	10+26	CS	
				10+26	DS	5331
Kingsbrook Dr	10+26	10+67				

1385

Sidewalk Inventory

Start Point:

WYWOOD DR South @ BRADLEY WAY

End Point:

CONTINUE ON PAGE 2

Direction of Increasing Station:

RT

Reason Codes for NON-COMPLIANCE:

Inspector Name:

J. H. RH, SC

Date:

3/21/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

25

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
BRADLEY WAY	0+00	4+22				NO PZ
SNOWDEN CT	4+22					
SNOWDEN CT	0+00	0+90	0+90	0+90	VC	
	0+90	2+30	2+30	2+40	CS	
	2+40	4+14	4+14	4+14	DS	5229
	4+14	4+42	4+42	4+42	VC	
	4+42	6+00	6+00	6+00	PZ	NO PZ
	6+00	6+32	6+32	6+32	VC	
	6+32	7+99	7+99	7+57	CS	
	7+99	9+45	9+45	9+45	VC	
	9+45	9+72	9+72	9+90	CS	
			9+90	9+90	DS	5211
	9+90	10+20	10+20	10+20	VC	

Cont 2 of 2

1365a

Sidewalk Inventory

Start Point:

Kingsbrook Dr @ Corporate Dr

End Point:

CONTINUE Pg 2

Direction of Increasing Station:

15'

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Inspector Name:

SH/SC

Date:

7/2/14

Total Number of Driveways:

8

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
@ Corporate	0+00	1+43	1+43	1+43	VC	
	1+43	2+00	2+00	2+00	PZ	NO PZ
	2+00	2+13	2+13	2+37	CS	
	2+37	3+57	3+57	3+57	VC	
	3+57	3+73	3+73	7+81	CS	
	3+81	3+98				
@ EXETER CT	0+00	5+77	5+77	5+77	VC	NO PZ
	5+77	6+62				
CASTLE CT	0+00	0+08				MEDIUM
CASTLE CT						
CASTLE CT	0+00	1+66	1+66	1+98	CS	
	1+98	3+33	3+33	3+76	CS	
	3+76	4+21	4+21	4+42	CS	
@ BRIGHAM CT	4+42	5+46				

1355a

Sidewalk Inventory

Start Point: KINGSBROOK DR @ CORPORATE DR
End Point: 4 1 12
Direction of Increasing Station: LT

2 of 2

Reason Codes for NON-COMPLIANCE:

Inspector Name: RAH/SC
Date: 3/26/14

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 6

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
@ BRIGHTON CT	0+00	0+61	0+61	0+69	CS	
	0+69	1+19	1+19	1+19	PP/H	
	1+19	1+73	1+73	2+79	CS	
	2+79	3+61	3+61	3+81	CS	
	3+81	5+90	5+90	5+90	PP/H	
ROOKS CT	5+90	7+51				
ROOKS CT	0+00	1+20	1+20	1+40	CS	
	1+40	5+86	5+86	5+86	VC	
	5+86	6+09	6+09	6+09	VC	TRIP HAZARD HOLE
	6+09	6+29	6+29	6+29	VC	
	6+29	6+73	6+73	6+81	CS	
HENDON WOOD LA	6+81	11+55				
HENDON WOOD LA	0+00	0+16	0+16	0+16	PO	
	0+16	1+65	1+65	1+65	DS	5310

1+65 3+26 3+26 3+26 DS 53141
3+26 3+71 3+71 3+71 DS 5316
HENDON WOOD LA 3+71 5+37
HENDON WOOD LA 0+00 0+36
CORPORATE DR

Start Point: Brook Haven Ct / Brook Haven Dr. LT
End Point: Brookhaven Dr.

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: TWWS
Date: 3/21/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 111 8

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Brook Haven Dr.	0+00	0+62	0+62	1+71	CS	0+82 DS (4.9) 9050
	1+71	2+37	2+37	2+48	CS	*VC - 1+01 Lip - Drive way
	2+48	3+05				1+79 9052 2+08 9450, 9056
			3+05	3+85	CS	*2+87 VC 3+00 Senti needs Replac
	3+85	4+77	4+77	5+13	CS	3+08 9057 out 3+32 # 9055
	5+13	5+60	5+60	5+82	CS	4+27 9053
Brook Haven Dr	5+82					5+13 0951

Sidewalk Inventory

Start Point:

Spring Valley Dr / Spring Meadow Ln Lt.

End Point:

Cool Spring Terr.

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

DS Driveway Cross Slope

PP Pinch Point

CS Panel Cross Slope

PZ Passing Zone

WP Width of Panel

PO Protruding Object

Inspector Name: TWS

Date: 3/21/14

Total Number of Driveways: 1111

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Spring Meadow Ln	0+00	0+13				0+03 VC Joint
			0+13	0+24	CS	
	0+24	0+78	0+78	1+66	CS	DS - 9030, 9032 ✓
	1+66	2+32	2+32	2+80	CS	9034 ^{0.8%} ✓
	2+80	2+98	2+98	3+01	CS	CS/VC 1" drop
	3+01	3+74	3+74	3+91	CS	
	3+91	4+19	4+19	4+86	CS	4+66 DW 9036
	4+86	5+08	5+08	6+41	CS	5+68 DW 9038
Fried Creek Dr.	6+41	(6+51)				
Fried Creek Dr *	0+00	1+31	1+31	1+98	CS	
Cool Spring Terr N	1+98	2+17				
Cool Spring Terr.	(2+17)					

Sidewalk Inventory

Start Point: Spring Valley Dr / Brookhaven Dr. (Lt.)
 End Point: Spring Meadow Ln.

Trans

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: SWTJ.
 Date: 3/21/14

VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object

DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

Total Number of Driveways: 111

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Brookhaven Dr.	0+00	1+17	1+17	1+60	CS	9049 ^{4.7%} 1+20
	1+60	4+04	4+04	4+20	CS	9041 [✓] 1+99
	4+20	4+45				9045 [✓] 2+91
Cool Spring Terr S.	4+45	4+45				
Cool Spring Terr S.	0+00	2+18				GAS Meter Valve NO Pass. Zone
Fieldcrest Dr.	2+18	2+18				VC 1+44 Bush in side walk
Fieldcrest Dr.	0+00	1+74	1+74	1+79	CS	1+79 9033 [✓]
	1+79	3+95	3+95	4+10	CS	2+82 9031 [✓]
	4+10	5+76 ^{Driveway}				3+21 VC Bushes 3+17
	5+76	6+05	6+05	6+05	VC	4+10 9029
	6+05	6+13	6+13	6+25	CS	9027 [✓]
	6+25	6+42				
Spring Meadow Ln.	(6+42)					

Sidewalk Inventory

Start Point: Spring Valley Dr / Cool Spring Terr N. Rte.

End Point: Brookhaven Dr

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

DS Driveway Cross Slope

PP Pinch Point

CS Panel Cross Slope

PZ Passing Zone

WP Width of Panel

PO Protruding Object

Inspector Name: WWTJ

Date: 3/21/14

Total Number of Driveways: 0

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Cool Spring Terr N.			0+00	0+95	CS	
	0+95	2+03				
Cornwall Terr.	(2+03)					
Cornwall Terr	0+00	0+47	0+47	1+03	CS	
	1+03	1+90	1+90	2+02	CS	
Brookhaven Dr.	(2+02)					

Sidewalk Inventory

1305

Start Point: BROOKHAVEN TERR / BROOKHAVEN DR

End Point: BROOKHAVEN DR

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: WAYNE
W. H. 35
 Date: 3.21.14

VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object

DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

Total Number of Driveways: 7.0 EA

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
BROOKHAVEN DR	0+00	0+25 RT	0+25	0+38 RT	CS	
	0+38	0+64 RT	0+64	0+78 RT	CS	* D/W 0+47 BLDG 9050 (GOOD)
	0+78	2+31 1+31 RT	2+31 1+31	2+35 RT	CS	* D/W 1+52 BLDG 9052 "
	2+35	2+42 RT	2+42	2+64 RT	CS	* D/W 2+42 BLDG 9054
E OF CIRCLE BROOKHAVEN TERR	2+64	3+28 RT				* D/W 2+85 BLDG 9056 -
						*
E OF CIRCLE BROOKHAVEN TERR	0+00	0+30 RT	0+30	0+49 RT	CS	* D/W 0+30 BLDG 9053 (BAD) D/W 0+00 BLDG 9055
BROOKHAVEN DR	0+49	2+98 RT	2+98	2+98		D/W 2+41 BLDG 9051

1305

Start Point: BROOKHAVEN DR / BROOKHAVEN TWP

End Point: RIDGEFIELD DR

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: W44J2
Date: 3.21.19

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 024

[illegible]

Sidewalk Inventory

Start Point: ~~Ridgefield Dr~~ Brook Haven Dr. / Ridgefield Dr. RT 2

End Point: Brookline & 9 Circle (STA 11+46 RT)

Direction of Increasing Station: STOP, MIDDLE OF CIRCLE

Inspector Name: ~~WES & WAYNE~~

Date: 3/21/14

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope


CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 12.0 EA

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Ridgefield Dr.	4+00		0+00	0+51 RT	CS	DS 0+31 RT Gas VB & VC AT JOINT
	0+51	1+34 RT	1+34 RT	1+48 RT	CS	D/W 0+53 RT BLDG G103
	1+48	2+01 RT	2+01	2+25 RT	CS	D/W 1+11 BLDG G101 DS
	2+25	2+72 RT	2+72	3+04 RT	CS	AT 2+01
	3+04	3+44 RT	3+44	3+60 RT	CS	* D/W 2+41 BLDG G105 DS
	3+60	3+96 RT	3+96	4+25 RT	CS	* D/W 3+16 BLDG G107 DS
	4+25	4+46 RT	4+46	5+67 RT	CS	* D/W 4+08 BLDG G109
	5+67	6+18 RT	6+18	6+34 RT	CS	D/W 5+67 BLDG G113
	6+34	6+47 RT	6+47	6+64 RT	CS	* D/W 4+08 BLDG G111
	6+64	6+73 RT	6+73	6+97 RT	CS	D/W 6+51 BLDG G115 Driveway
	7+10	7+10 RT	7+10	7+40 RT	CS	* D/W 7+40 BLDG G117 Driveway DS
	7+40	7+79 RT	7+79	8+19 RT	CS	
	8+19	8+41 RT	8+41	8+77 RT	CS	
RIDGEFIELD DR	8+77	9+52 RT	9+52	9+77 RT	CS	* D/W 9+52 BLDG G121
	9+77	10+34 RT	10+34	10+54 RT	CS	
EQ- STOP AT CIRCLE ON BROOK HAVEN DR	10+54	10+67 RT	10+67	11+46 RT	CS	* D/W 11+28 BLDG G122
					CS	D/W 10+67 BLDG G123

1285a

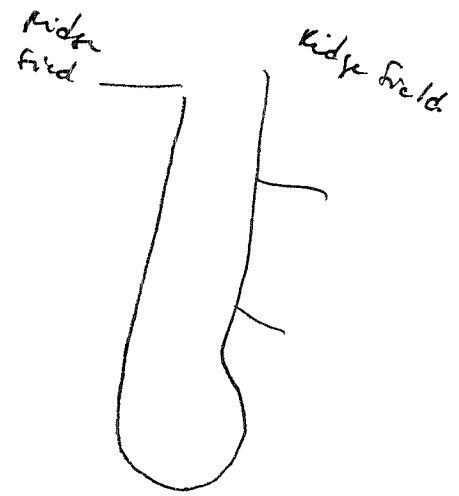

Sidewalk Inventory

2 of 2

Start Point: BROOKHAVEN DR / E of CIRCLEEnd Point: BROOKHAVEN TERR

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: W. J. W. J.
Date: 3.21.14VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding ObjectDS Driveway Cross Slope
CS Panel Cross Slope
WP Width of PanelTotal Number of Driveways: 503A

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
E of CIRCLE at BROOKHAVEN DR			0+00	0+25 RT	CS	VB 0+12 RT
	0+25	0+42 RT	0+42	1+47 RT	CS DS	D/W 0+66 BLDG 6118 H2O METER 0+63 RT D/W 0+25 BLDG 6120, VB 0+54 RT D/W 1+29 BLDG 6116
	1+47	1+63 RT	1+63	1+67 RT	CS	S VB 1+64 RT
	1+67	1+78 RT	1+78	2+02 RT	CS	* D/W 1+78 BLDG 6114
SPRING VALLEY DR	2+02	2+31 RT				
	0+00					
SPRING VALLEY DR	0+00	0+08 RT	0+08	1+79 RT	CS DS	* 0+08: S.D. INLET HIGH D/W 0+47 BLDG 6110
BROOKHAVEN CT	1+79	1+91 RT				
BROOKHAVEN CT			0+00	0+91 RT	CS	
	0+91	1+38 RT	1+38	1+43 RT	CS PO	PO MH 1+41
BROOKHAVEN TERR	1+43	1+55 RT	1+55	2+54 RT	CS	

Sidewalk Inventory

Start Point: Ridgefield Dr / LaPetite Entrance

27

End Point: Elementary School Entrance

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: WWS TT
Date:

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
LaPetite Ent.	0+00		0+00	1+37	CS	deter. beyond repair
	1+37	1+65	1+65	1+74	CS	Cracks " "
	1+74	2+02	2+02	2+02	VC	VC
			2+02	2+36.9	CS	deter. beyond repair; cracks
	3+69	5+96				
			3+87	3+93	CS	cracks " (note) "
			4+53	4+53	VC	1" crack
			4+87	4+94	CS	1" crack + low spot
			5+36	5+36	VC	1" crack
			5+81	5+93	CS	cracks & tree roots
School Entrance	5+96					

Sidewalk Inventory

Start Point: Ridge field Dr. / Entrance 9093.

End Point:

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name:
Date:

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
9093: Left	0+00	0+45	0+45	0+96	CS	
			0+45	0+45	VC	
	0+96	1+31	1+31	1+48	CS	
	1+48	2+06	2+06	2+48	CS	
	2+51	2+84	2+40	2+51	CS	Cracks & roots
		2+74	2+74	2+74	VC	tree root
	2+74	2+84	2+84	2+86	CS	tree root
Entrance to office	2+86					
9093 / Apr 90						

Start Point: Spring Ridge Pkwy / Old N+I. Pke. (stone wall on right)

End Point:

Direction of Increasing Station: Page 192

Reason Codes for NON-COMPLIANCE:

Inspector Name: TTWWJ
Date: 3-20-14

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

NO Intersect or Pass Zones

Total Number of Driveways: (0)

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Old N+I. Pke.	0+00	0+00	0+00	1+03	CS	24% RS
(Left)			0+30	0+30	VC	1" crack
			0+85	0+85	VC	1" crack + tree root
			0+92	0+92	VC	" 1+03 "
	1+03	2+67	2+67	3+23	CS	25% RS
			3+08	3+25	CS	3" Bumps
	3+25	4+26	4+26	8+33	CS	
			5+73	5+73	CS	(Sidewalk Dips; Rolls Right to Left)
			8+10	8+10	VC	1" crack + 1" Lip
	8+33	8+65	8+65	8+65		
	8+65		8+65	9+97	CS	Cracks; Roots. 6" issues. / CS + VC
	8+65	9+64	9+64	10+80	CS	
			10+40	10+40	VC	1" crack
			10+61	10+64	VC	crack and 1/2 inch sidewalk. 3' seal

Sidewalk Inventory
 Start Point: Old National Pike Pannell (R.T.) R Tina 1038 1235

End Point: _____

Direction of Increasing Station: _____

Inspector Name: TTWWJ
 Date: 3/20/19

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object

DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

5' wide Paved Asphalt

Total Number of Driveways: _____

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Ridge Field Dr.	0+00	0+61	0+61	8+43	CS	
			2+03	2+03	VC	crack > 1"
			2+40	2+40	CS	" "
			2+70	2+70	VC	" "
			3+10	3+10	VC	" " + Bump
			3+92	3+92	VC	" "
			5+06	5+06	VC	" "
			6+17	6+17	VC	" "
			6+83	6+83	VC	" "
			7+20	7+31	VC CS	" (Tree Roots)
			8+07	8+43	VC	" "
Spring Ridge Pkwy	8+43	10+38				
Spring Ridge Pkwy	10+38					

Note VC 8+43 VC Tree roots

1235

1215 CT

Sidewalk Inventory

Start Point: ~~Seagrass~~ Ridge Field Dr / Spring water ~~RT~~ RT
 End Point: _____

Direction of Increasing Station: _____


Reason Codes for NON-COMPLIANCE:

Inspector Name: TTWWS
 Date: _____

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: _____

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Spring water Ct	0+00	0+19	0+19	② 4+36	CS	
			0+23	0+23	VC	excessive crack in bump
			0+38	0+38	VC	" "
			0+62	1+13	CS	4+ cracks & bumps > 1"
			1+95	2+52	CS	" "
			2+93	3+04	CS	excessive cracks & bumps
Ridge Field Dr	3+04					
Side end into						
Ramp. (#1)	4+36					
Old water p.u						

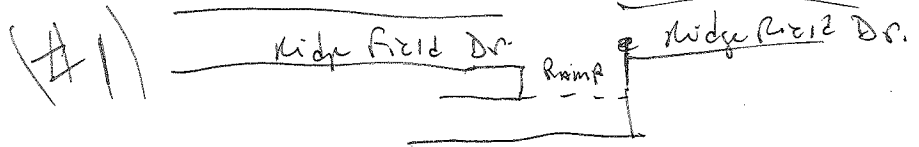

1215

Sidewalk Inventory

Start Point:

Springridge Pkwy / Ridgefield Dr.

End Point:

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name:

Date:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Ridgefield Dr	0+00	0+40	0+00	0+00	VC	1" CRACK / 0+37- Step Down to slope
	0+00	0+40	0+40	0+86	CS	Shopping Center
			0+79	0+86	CS	Roots & CRACKS
	0+86	1+28	1+28	1+58	CS	new
Shopping Center			0+00	0+30	CS	
Center Entrance	0+30	0+98	0+39	0+60	CS	1" crack, Roots, excessive cracking
			0+77	0+98	CS	" "
End 1 Exon/Shopping Center Entrance	0+98	1+46	0+98	1+46	CS	
2nd Entrance	0+00	0+91				
Exxon Entrance	0+00	0+91				
Exxon Entrance	0+91					

1205

1st

1195

Start Point: Ridge Field Dr. / Spring Ridge Pkwy (Rt.) Asphalt
End Point: Cracks;

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: T/H/W/W/J
Date:

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Spring Ridge Pkwy	0+00	1+06				
	2+39		1+06	2+39	CS	
	2+39	3+36				
Intersecti.	0+00	0+39	0+39	2+09	CS	Swimming Pool 1 st entrance
2 nd Ramp.			0+39	2+09		Swimming Pool 2 nd entrance
Swimming pool entrance	0+00		0+00	0+25	CS	
	0+25	0+48	0+48	0+60	CS	
			0+60	2+71	CS	Asphalt Crack greater than 1"
	2+71	3+40	3+40	4+78	CS	
Brook Haven Dr.	4+78	5+00	5+00	5+15	CS	Intersecti.
Brook Haven Dr.	5+15					

1195

Start Point: Ridge Field Dr / Brookhaven Dr RT

1185

End Point:

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: TTWWJ
Date: 3-20-14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Brookhaven Dr	0+00	0+22	0+22	0+52	CS	
	0+52	0+87	0+87	1+94	CS	
	1+94	2+37	2+37	3+06	CS	Side in front see sheet
offset shoot walk			0+00	1+29	CS	min box 12 6/01 6/00
offset shoot	0+00	0+00	0+00	1+29	CS	out > 3%
			0+37	0+37	VC	tree root lifting walk way
Shady brook Dr	0+83	4+06	0+00	0+83	CS	Run slope 19.9 very steep 3+30 to (cheap
Shady brook Dr	0+00	0+55	0+55	2+02	CS	
Spring Water Terr	0+00	0+47	0+09	0+09	VC	Tree Root into walk way
	0+09	0+47	0+47	0+83	CS	
			0+83	0+83	VC	Tree root " " "
			0+70	0+70	VC	1" wide Lip
	0+83	1+14	1+14	2+71	CS	
Spring Water Ct.	2+71	4+16	4+16	4+33	CS	Nota County Sign Small Gro

(VC Points: (2+48) (3+02)
Tree roots (2+52)

1185

1175
(1175)

Sidewalk Inventory

Start Point: Bentley Way at Corporate Dr.

End Point: Corporate Dr.

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: S.C. / R.H.
Date: March 20, 2014

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Corporate Dr	0+00	0+74				end Worsham Ct.
Worsham Ct	0+00	2+56				
Skyler Place	0+00	1+01	1+01	1+28	CS	
end			1+28	1+28	VC	
Manorly Ct	0+00	2+00	2+00	2+00	PZ	
			2+00	2+00	VC	
	2+00	2+74	2+74	2+88	CS	
end	2+88	3+77				
Fallard Place	0+00	0+43				end Corporate Dr

Sidewalk Inventory

Start Point:

Corporate Dr at Bentley Way (Left)

End Point:

Bal. Ck.

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name:

SC RH

Date:

March 29, 2014

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Bentley Way	0+00	0+95	0+95	0+95	VC	
	0+95	1+20	1+20	1+40	CS	No passing Zones
	1+40	1+80	1+80	1+80	VC	
	1+80	2+90	2+90	2+90	VC	
	2+90	3+91				
Unimproved at P.L.	0+00	2+57	2+57	2+57	VC	(Parking area)
	2+57	2+93	2+93	2+93	VC	No passing Zones
	2+93	3+22				End at Bal. Ck.

Sidewalk Inventory

Start Point:

Corporate Dr. at Kingsbrook Dr. (Left)

End Point:

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name:

S.G. RH.

Date:

March 27, 2014

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 0

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Kingsbrook Dr	0+00	5+41	5+41	5+41	VC	at inlet 5' sidewalk
			5+41	5+41	PP	
	5+41	7+19	7+19	7+19	VC	
	7+19	7+41	7+41	7+41	VC	
	7+41	9+55				End at Kingsbrook Dr.
Kingsbrook Dr	0+00	0+15	0+15	0+35	CS	4' sidewalk - 0+00-0+35
	0+35	2+83	2+83	2+98	CS	begin 50' sidewalk
	2+98	4+84	4+84	4+94	CS	
	4+94	6+70	6+70	6+70	VC	
			6+70	6+85	CS	
	6+85	9+75				4' sidewalk at 9+00
141 Wood St	0+00	0+07	0+07	0+07	VC	
	0+07	0+60	1+60	1+60	VC	
	1+60	1+64	1+64	1+64	VC	

Continue

Sidewalk Inventory

Start Point: Corporate Dr at Ivywood Pr. (Left)
 End Point: Bentley Way

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: S.C. RA
 Date: March 20, 2014

VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object

DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

Total Number of Driveways: 0

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Ivywood Dr South	1+64	4+93				End No Passing Zone
Bradley Way	0+00	3+11	3+11	3+28	CS	4.0' sidewalk
	3+28	4+71	4+71	4+71	VC	
	4+71	4+83	4+83	5+03	CS	No Passing Zones
	5+03	5+39	5+39	5+39	VC	
	5+39	6+36	6+36	6+36	VC	
	6+36	9+77				
Bentley Way	0+00	3+99	3+99	4+15	CS	4' sidewalk
	4+15	5+25	5+25	5+25	VC	No Passing Zones
	5+25	6+06	6+06	6+34	CS	VC at 6+34
	6+34	7+07				

Start Point:

Robin Dr E at New Design Rd.

10F?

1135a

Ramp Inventory Corresponding to Start:

Direction of Increasing Station:

Right or Left Side of Road:

Right

Inspector Name:

S. C. RH

Date:

March 23, 2014

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

Reason Codes for NON-COMPLIANCE:

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

0 DWS

Street Name:	Compliant			Non-Compliant			Code	Comments
	From	To	Distance	From	To	Distance		
New Design Rd	0+00	0+17		0+17	0+25		CS	
	0+25	0+51		0+51	0+77		CS	
	0+77	4+19		4+19	4+19		VC	8" drop-off at edge of sidewalk
	4+19	5+01		5+01	5+01		VC	No passing zones
	5+01	7+83						
Finch Ct	0+00	2+00		2+00	2+00		PZ	
Mallard Ln	0+00	2+84		0+00	0+00		VC	
	0+00	2+11		2+11	2+11		VC	
	2+11	2+18		2+18	2+18		PP	Manhole frame 2" and covered
	2+18	2+60		2+60	2+97		CS	
	2+97	3+69						end
Kingfisher	0+00	1+50		1+50	1+70		CS	
	1+70	1+96						end

1135a

30F3

1135C

Start Point: Robin Dr. at Teal Loop

End Point: ROBIN DR @ NEW DESIGN RD

Direction of Increasing Station: Right

Reason Codes for NON-COMPLIANCE:

Inspector Name: S.C. RH
Date: March 26, 2014VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding ObjectDS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways:

Street Name: Robin Dr.	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Teal Loop	0+0	1+49	1+49	3+47	CS	No PZ
	3+47	3+79	3+79	4+31	CS	No PZ
	4+31	4+39	4+39	5+54	CS	No PZ
WHIPPOORHILL	5+54	5+73				
	0+00	1+10	1+10	1+10	PO	No PZ
ROBIN CT	1+10	3+86				No PZ
	0+00	3+60	3+60	3+68	CS	No PZ
ARCTIC TURN	3+68	4+42				
NEW DESIGN RD	0+00	1+01	1+01	1+62	CS	SWITCHES FROM 4' TO 5' @ 0+31

1135C

2 of 3

1135b

Start Point: Robin Dr E at Snow Goose Ct

Ramp Inventory Corresponding to Start:

Direction of Increasing Station:

Right or Left Side of Road: Right

Inspector Name: S. L. R. H. J. H.
Date: March 20, 2014

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

Reason Codes for NON-COMPLIANCE:

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Street Name:	Compliant			Non-Compliant			Code	Comments
	From	To	Distance	From	To	Distance		
Snow Goose Ct				0+00	0+00		VC	
	0+00	2+45		2+00	2+00		PZ	
Snow Goose Ct	0+00	0+80		0+80	1+04		CS	
	1+64	2+11						No Passing Zone
Mallard Ct	0+00	0+12		0+12	0+66		CS	
	0+66	0+97						End
Mallard Ct.	0+00	1+60		1+60	1+81		CS	
	1+81	2+10						No Passing Zone
Gooseander Eider Ct.	0+00	2+26		2+00	2+00		PZ	
				0+00	0+08		CS	
	0+08	2+89		2+60	2+00		PZ	
Teal loop	0+00	0+98		0+98	1+30		CS	
	1+30	2+21					PZ	

1135b

Sidewalk Inventory

Start Point: BRADLEY WAY @ CORPORATE DR

End Point: IVEYWOOD DR SOUTH

Direction of Increasing Station: _____

Inspector Name: JH & BF

Date: 3/20

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 13

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
R CORPORATE BRADLEY WAY	0+00	0+00	0+00	0+00	VC	
IVEYWOOD DR S.	0+00	1+0				
	0+00	2+95	2+95	2+95	VC	
	2+95	3+58	3+58	3+58	VC	NO PZ
IVEYWOOD DR S.	3+58	4+57				
L CORPORATE BRADLEY WAY	0+00	2+41	2+41	2+41	VC	NO PZ
	2+41	2+55	2+55	2+55	VC	
	2+55	2+60	2+60	2+60	VC	
	2+60	3+15	3+15	3+15	VC	
	3+15	4+0	4+40	4+72	CS	
	4+72	5+90	5+90	5+90	FP	
	5+90	6+15	6+15	6+31	CS	
IVEYWOOD DR S.	6+31	6+47				

Sidewalk Inventory

Start Point: Corporate Dr @ New Dasher Rd

End Point: Ballenger Creek Pike

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: JF302
Date: 3-20-14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 0

Street Name: RT Corporate Dr	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
New Dasher Rd			0+00	0+14	CS	
	0+14	0+65	0+65	0+85	VC	
	0+65	1+55	1+55	1+55	VC	
			1+55	1+65	CS	
			1+65	1+65	VC	
	1+65	2+33	2+33	2+38	CS	5' sidewalk/c
Gas Station Entrance	0+00	0+78	0+78	0+88	CS	
	0+88	1+28	1+28	1+66	CS	
	1+66	2+28				
Kingsbrook Crossing entrance	0+00	0+47	0+47	0+78	CS	
	0+78	2+08	2+08	2+08	VC	
	2+08	2+28	2+28	2+63	CS	
	2+63	8+03	8+03	8+38	CS	
	8+38	8+78	8+78	8+99	CS	Stop @ ST James Pl

Sidewalk Inventory

Start Point: Corporate Dr @ New Design Rd

End Point: Bullenger Creek Pike

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BEBOZ
Date: 3-20-14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 1

Street Name: <u>Corporate Dr</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
St James Pl	0+00	5+47	5+47	5+62	CS	
	5+62	5+92	5+92	5+92	VC	
	5+92	7+12	7+12	7+29	CS	
	7+29	9+59				END @ Kingsbrook Dr Crosswalk
Kingsbrook Dr Crosswalk	0+00	3+96				
Chillingham Pl #1	0+00	0+34				5' sidewalk
Chillingham Pl #2	0+00	4+21				
Lywood Dr N #1	0+00	0+71	0+71	1+35	CS	4' sidewalk
	1+35	2+79	2+79	2+87	CS	No PZ
	2+87	4+53	4+53	4+81	CS	No PZ
	4+81	5+39				
Lywood Dr N #2	0+00	0+16	0+16	0+32	CS	
	0+32	0+68	0+68	0+68	VC	
	0+68	0+84	0+84	0+96	CS	

1115b

Sidewalk Inventory

Start Point: Corporate Dr @ New Design Rd

11/5c 4

End Point: Bellinger Creek Pike

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF 02
Date: 3-20-14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: _____

Street Name: <u>Corporate Dr</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Cont.</u>	0+96	1+97	1+97	1+97	VC	
	1+97	2+77	2+77	2+77	VC	No PZ
	2+77	2+97	2+97	3+78	CS	
	3+78	4+34	4+34	4+66	CS	No PZ
	4+66	5+39	5+39	5+39	VC	-
	5+39	5+55	5+55	5+79	CS	
			5+79	5+79	VC	
	5+79	7+42	7+42	7+42	VC	No PZ
	7+42	9+39				No PZ
<u>Brandford Ln</u>	0+00	0+36	0+36	0+36	VC	
	0+36	1+91	1+91	1+91	VC	No PZ
	1+91	4+89	4+89	4+89	VC	No PZ
	4+89	7+33				
<u>Brandford Ln #2</u>	0+00	0+49	0+49	0+61	CS	

11/5c

Sidewalk Inventory

111SD 4

Start Point: Corporate Dr @ New Design Rd

End Point: Ballenger Creek Pike

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF 302
Date: 3-20-14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways:

Street Name: Corporate Dr	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Cont:	0+61	0+77	0+77	1+01	CS	
			0+93	0+93	VC	
	1+51	2+70	2+70	3+07	CS	No PZ
	3+07	3+83	3+83	3+95	CS	
	3+95	4+54	4+54	4+54	VC	Damaged sidewalk @ SD drain hole No PZ
	4+54	7+32	7+32	7+51	CS	END @ Ballenger Creek Pike

111SD

Start Point: Kingfisher CT @ Robin Dr. E


End Point: Robin Dr E

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

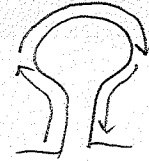

Inspector Name: BF 802
Date: 3-20-14

Total Number of Driveways: 12

Street Name: <u>Kingfisher CT</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Robin Dr E	0+00	0+51	0+51	0+51	VC	
	0+51	0+60	0+60	0+60	DS	Lot 6802
	0+60	0+89	0+89	0+89	DS	Lot 6804
	0+89	1+36	1+36	1+36	VC	
	1+36	1+53	1+53	1+53	DS	Lot 6806
	1+53	2+18	2+18	2+18	DS	Lot 6808 No PZ
	2+18	2+86	2+86	2+86	DS	Lot 6812
	2+86	3+20	3+20	3+20	DS	Lot 6814
	3+20	3+65	3+65	3+84	CS	
	3+84	3+96	3+96	3+96	DS	Lot 6813 No PZ
	3+96	4+02	4+02	4+08	CS	
	4+08	4+16	4+16	4+16	DS	Lot 6811
	4+16	4+88	4+88	4+88	DS	6809
	4+88	5+55	5+55	5+55	DS	6807
	5+55	6+11	6+11	6+11	DS	6805 No PZ
	6+11	6+51	6+51	6+51	DS	6803
	6+51	6+61	6+61	6+61	PO	Bush
Robin Dr E	6+61	7+18				END

Sidewalk Inventory

1095a

Start Point: Mallard Ln. @ Robin Dr E

End Point: Robin Dr E

Direction of Increasing Station: _____


Reason Codes for NON-COMPLIANCE:

Inspector Name: BF302
Date: 3-20-14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 19

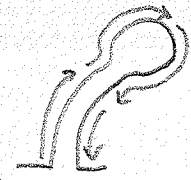

Street Name: <u>Mallard Ln</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Robin Dr E</u>			<u>0+00</u>	<u>0+51</u>	<u>CS</u>	
	<u>0+51</u>	<u>0+61</u>	<u>0+61</u>	<u>0+61</u>	<u>DS</u>	<u>Lot 5002</u>
	<u>0+61</u>	<u>0+96</u>	<u>0+96</u>	<u>0+96</u>	<u>VC</u>	
	<u>0+96</u>	<u>1+17</u>	<u>1+17</u>	<u>1+17</u>	<u>VC</u>	<u>(over 2")</u>
	<u>1+17</u>	<u>1+26</u>	<u>1+26</u>	<u>1+26</u>	<u>DS</u>	<u>Lot 5004</u>
	<u>1+26</u>	<u>1+53</u>	<u>1+53</u>	<u>1+53</u>	<u>DS</u>	<u>Lot 5006</u>
	<u>1+53</u>	<u>1+62</u>	<u>1+62</u>	<u>1+62</u>	<u>VC</u>	
	<u>1+62</u>	<u>1+93</u>	<u>1+93</u>	<u>1+93</u>	<u>PO</u>	<u>Bush</u>
	<u>1+93</u>	<u>2+11</u>	<u>2+11</u>	<u>2+11</u>	<u>DS</u>	<u>Lot 5008</u>
	<u>2+11</u>	<u>2+20</u>	<u>2+20</u>	<u>2+20</u>	<u>VC</u>	<u>(over 2")</u>
	<u>2+20</u>	<u>2+62</u>	<u>2+62</u>	<u>2+62</u>	<u>DS</u>	<u>Lot 5010</u>
	<u>2+62</u>	<u>3+19</u>	<u>3+19</u>	<u>3+19</u>	<u>DS</u>	<u>Lot 5012</u>
	<u>3+19</u>	<u>3+39</u>	<u>3+39</u>	<u>3+39</u>	<u>VC</u>	
	<u>3+39</u>	<u>3+75</u>	<u>3+75</u>	<u>3+75</u>	<u>DS</u>	<u>Lot 5014</u>

1095a

Sidewalk Inventory

Start Point: Mallard Ln @ Robin Dr E

End Point: Robin Dr E

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF302
Date: 3-20-14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: See Sheet 1

Street Name: <u>Mallard Ln</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Cont.	3+75	4+34	4+34	4+34	DS	Lot 5016
	4+34	4+76	4+76	4+76	DS	Lot 5018
	4+76	5+28	5+28	5+28	PO	Bush
	5+28	5+40	5+40	5+40	DS	Lot 5022
	5+40	5+90	5+90	5+90	DS	Lot 5024
	5+90	6+36	6+36	6+36	DS	Lot 5023
	6+36	6+67	6+67	6+67	DS	Lot 5021
	6+67	7+27	7+27	7+27	DS	Lot 5019
	7+27	8+67	8+67	8+67	DS	Lot 5017
	8+67	9+29	9+29	9+29	DS	Lot 5015
	9+29	9+47	9+47	9+47	PO	Tree limbs
	9+47	9+76	9+76	9+76	VC	
	9+76	9+83	9+83	9+83	VC	
	9+83	10+03	10+03	10+03	DS	Lot 5013

2 F3
109sb

109sb

Sidewalk Inventory

3 3
109Sc

Start Point: Mallard Ln @ Robin Dr E

End Point: Robin Dr E

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF302
Date: 3-20-14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: See Sheet 1

Street Name: <u>Mallard Ln</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Cont.	10+03	10+35	10+35	10+35	VC	
	10+35	10+68	10+68	10+68	DS	Lot 5011
	10+68	11+14	11+14	11+14	DS	Lot 5009
Robin Dr E	11+14	11+81				END

109Sc

Sidewalk Inventory

 Start Point: Finch CT @ Robin Dr E


 End Point: Robin Dr E

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

 Inspector Name: BF 302
 Date: 3-20-14

 VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object

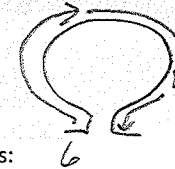 DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel


Total Number of Driveways:

Street Name: <u>Finch CT</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Robin Dr E	0+00	0+51	0+51	0+51	DS	Lot 5002
	0+51	0+97	0+97	0+97	DS	Lot 5004
	0+97	1+37	1+37	1+37	DS	Lot 5006
	1+37	1+69	1+69	1+69	DS	Lot 5005
	1+69	1+93	1+93	1+93	VC	-
	1+93	2+22	2+22	2+22	DS	Lot 5003
	2+22	2+86	2+86	2+86	DS	Lot 5001
Robin Dr E	2+86	3+25				END

1075a

Sidewalk Inventory

Start Point: Bentley Way at Corporate Right

End Point: Corporate Dr

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF 502
Date: 3-20-14

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 0

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Corporate Dr			0+00	0+04	CS	
	0+04	0+62				
Ellington Way	0+00	0+12	0+12	0+36	CS	
	0+36	1+94	1+94	2+26	CS	
	2+26	2+94	2+94	3+03	CS	No PZ
Ellington Way #2	0+00	0+11	0+11	0+31	CS	
	0+31	1+51	1+51	1+55	CS	
	1+55	1+55	1+95	1+95	VC	
	1+95	2+43	2+43	2+43	VC	
	2+43	3+18	3+18	3+18	VC	No PZ
Grenville CT	0+00	0+00	0+00	0+20	CS	
	0+20	0+89	0+89	1+10	CS	
	1+10	2+37				No PZ
DeLafield CT			0+00	0+20	CS	

1075a

Start Point: Bentley Way @ Corporate Dr Sidewalk Invento

107sb

End Point: Corporate Dr

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: DFB 02
Date: 3-20-14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: See Sheet 1

[illegible]

107sb

Lane

Sidewalk Inventory

Start Point: Underwood Court / Parallels Danvers / Across from Underwood Court

End Point: _____

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:


Inspector Name: _____

Date: _____

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 6

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Underwood Ln.	0+00	0+91				Asphalt sidewalk / Parallels
		note (0+91	1+08)			Major Dip Down to under vertical
	0+91	1+08				Bottom of Swale
			1+08	1+45	CS	Plus major Puddle Areas
	(1+45		1+45	2+03	CS	
						See Drawing on Backs

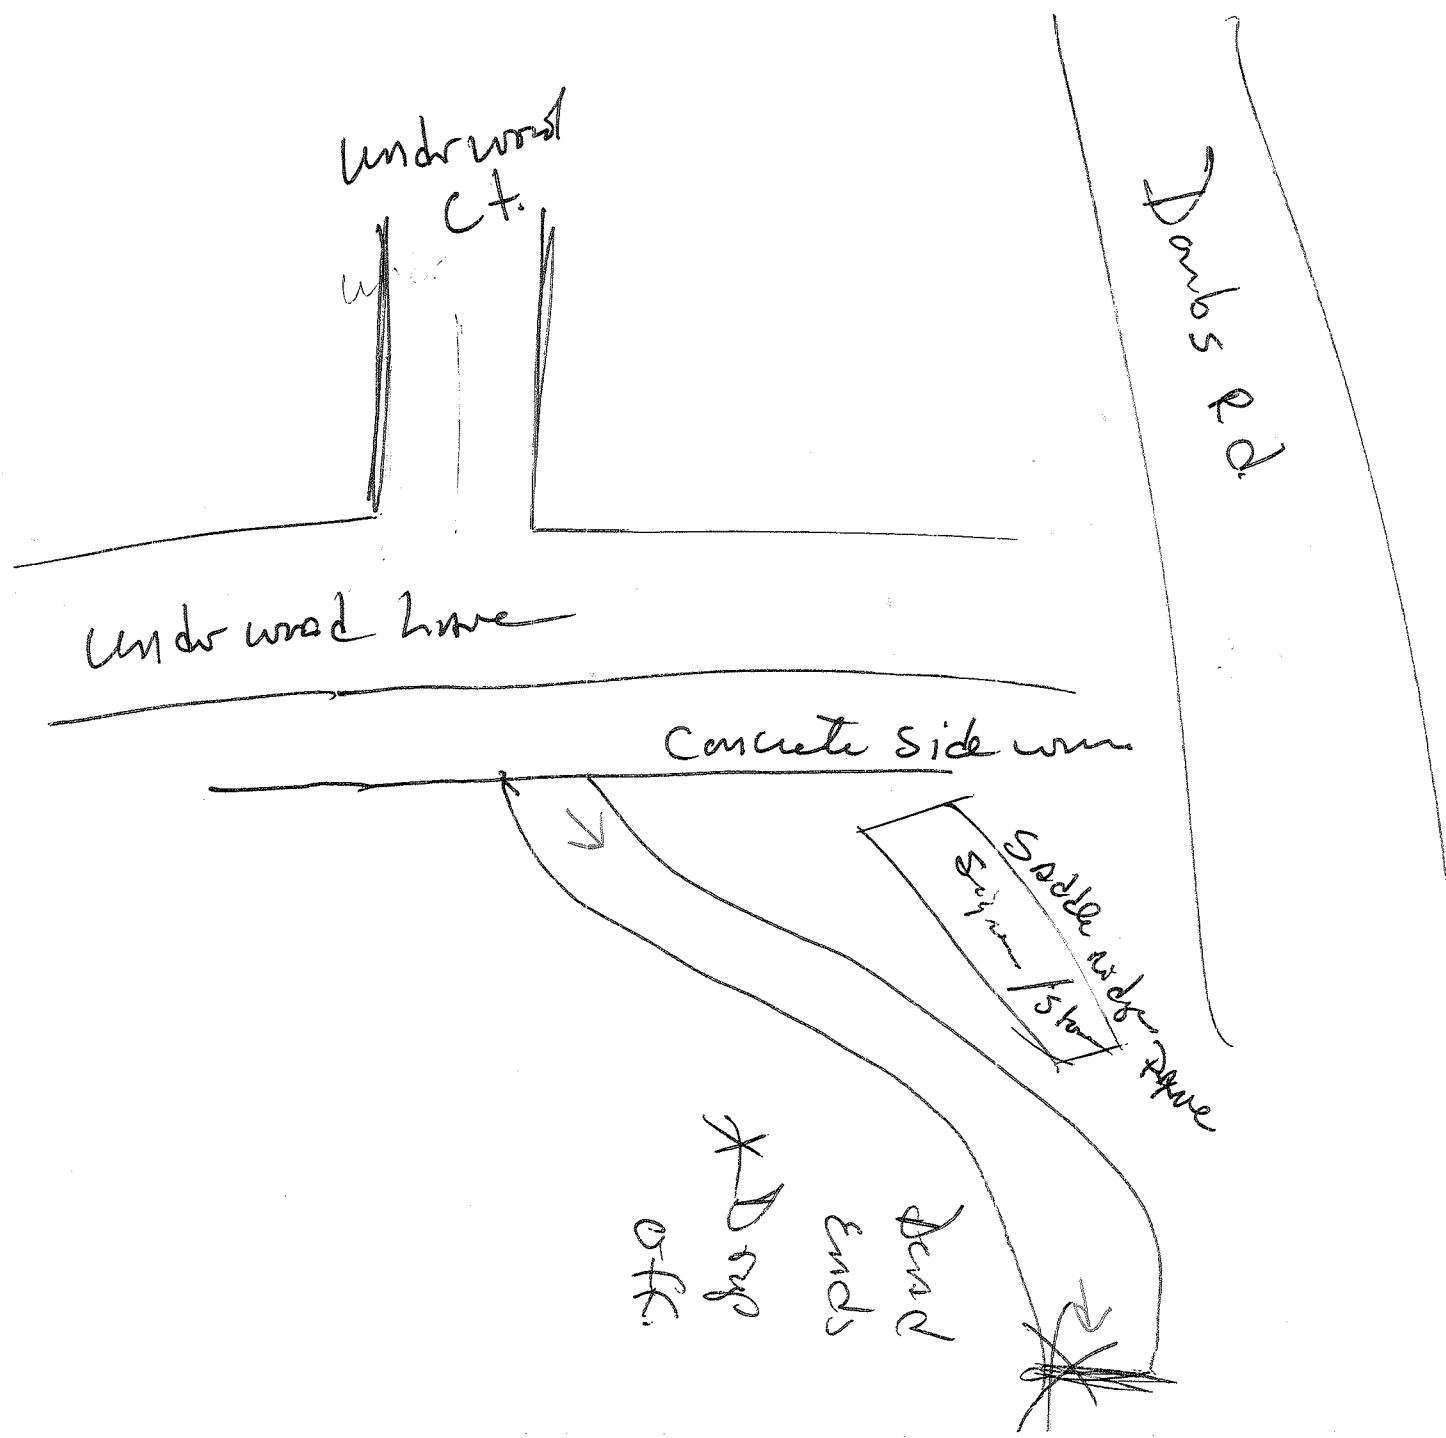

Start Point:

End Point:

Direction of Increasing Station:

Sidewalk Inventory

228

1055

Reason Codes for NON-COMPLIANCE:

Inspector Name:

Date:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

0

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Ridge Field Dr	0+00	0+13	0+00	0+13	CS	
			0+04	0+04	VC	Side walk 1" Lip
			0+04	0+18	CS	
Count	0+13	1+81				
Baldridge Dr	0+00	1+31				
Baldridge Dr	0+00	0+73	0+73	0+73	PO	Storm Drain Manhole 2' into 4'
		1+38				
			1+33	1+73	CS	
Baldridge Dr	0+00	0+96				
			0+96	1+20	VC	SHA Storm Drain Lid. Broken Lip
			0+96	1+20	CS	
	1+20	1+76				
			1+76	2+28	CS	
Spring Ridge PKWY		2+28				

1055

Start Point:

Ridge Field ^{LN} / Ridge Field ^{LN} Lt

black: white sig.

1045

End Point:

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Inspector Name: WS/T/S,
Date:

Total Number of Driveways: 0

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Ridge Field LN.	0+00		0+00	1+55	CS	
	1+55	4+21				
			4+21	4+40	CS	
	4+40	4+69				
			4+69	4+93	CS	
			4+93	4+93	VC	1" Lip side walk
	4+93		4+93	5+42	CS	
Spring side PKwy	5+42					

1045

Dr
B A Drijda ~~Dr~~ / Flagstone Ct

1035

End Point: BALDWIN CT

Direction of Increasing Station:

DS Driveway Cross Slope

PP Pinch Point

CS Panel Cross Slope

PZ Passing Zone

WP Width of Panel

PO Protruding Object

Total Number of Driveways: 0

[illegible]

1035

Sidewalk Inventory

Start Point: BALDRIIDGE CT Dr / BALDRIIDGE CT 189 1025

Direction of Increasing Station:

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Inspector Name: D. T. W.
Date: 3.19.14

Total Number of Driveways: 0

1025

Sidewalk Inventory

Start Point: SPRING RIDGE PKWY

Baldridge Dr / Spring Ridge Parkway

1015

End Point: FLYCASTER CT

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

DS Driveway Cross Slope

PP Pinch Point

CS Panel Cross Slope

PZ Passing Zone

WP Width of Panel

PO Protruding Object

Inspector Name: D.T.W.

Date: 3.10.14

Total Number of Driveways: 0

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Spring Ridge Pkwy</u> <u>Baldridge Dr: R</u>	<u>0+00</u>		<u>0+00</u>	<u>0+13 RT</u>	<u>CS</u>	
	<u>0+13</u>	<u>1+12 RT</u>	<u>1+12</u>	<u>3+01 RT</u>	<u>CS</u>	
	<u>3+01</u>	<u>3+09 RT</u>	<u>3+09</u>	<u>3+13 RT</u>	<u>CS</u>	
	<u>3+13</u>	<u>3+36 RT</u>	<u>3+36</u>	<u>3+49 RT</u>	<u>CS</u>	
	<u>3+49</u>	<u>3+69</u>	<u>3+69 RT</u>	<u>3+69</u>	<u>VC</u>	<u>1" Lip</u>
	<u>3+69</u>	<u>3+96 RT</u>				
<u>Flagstone</u>	<u>3+96 RT</u>					

1015

Start Point: Bob White CT @ WHIPPPOOL WILL DR

End Point: " "

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Inspector Name: RH/SC

Date: 3/10/14

Total Number of Driveways: 21

Street Name: <u>Bob White CT</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
WHIPPPOOL WILL DR	0+00	1+10	1+10	1+38	CS	
	1+38	1+54	1+54	1+54	VC	
			1+54	1+54	DS	5015 Bob White CT
	1+54	2+38	2+38	2+38	PO	
	2+38	2+62	2+62	2+62	VC	
	2+62	2+83	2+83	2+88	CS	
	2+88	3+02	3+02	3+02	DS	5021 B W CT
	3+02	4+44	4+44	4+44	VC	
	4+44	5+57	5+57	5+57	VC	
	5+57	5+87	5+87	5+94	CS	
			5+94	5+94	DS	5010 B W CT
	5+94	7+36	7+36	7+36	DS	5006 B W CT
	7+36	7+49	7+49	7+49	VC	
	7+49	8+92	8+92	9+00	CS	
	9+00	9+64	9+64	9+68	CS	
	9+68	10+51	10+51	10+51	VC	
WHIPPPOOL WILL DR	10+51	10+83				

15

whippoorwill Dr.
Sidewalk Inventory
Start Point: ~~WHIPPOORWILL~~ @ BOB WHITE CT

End Point: " " @ ROBIN DR

Direction of Increasing Station: RT + LT

Reason Codes for NON-COMPLIANCE:

Inspector Name: RH/SC
Date: 3/12/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 2

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
BOB WHITE CT @ RT	0+00	0+89	0+89	0+89	VC	10w
	0+89	1+45	1+45	1+45	VC	TRIP HAZARD
ROBIN DR	1+45		1+45	1+71	CS	
BOB WHITE CT @ RT	0+00	1+67	1+67	1+71	CS	10w
ROBIN DR						

Start Point: Gooseander Ct @ Robin Dr W

End Point: Robin Dr W

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point


PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

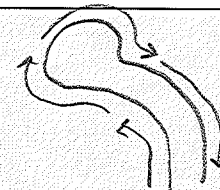

Inspector Name: BF 602
Date: 3-19-14

Total Number of Driveways: 24

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Robin Dr W : L			0+00	0+08	CS	
	0+08	0+36	0+36	0+36	DS	Lot 6601
	0+36	0+58	0+58	0+58	VC	
	0+58	0+67	0+67	0+67	VC	
			0+67	0+85	CS	
			0+85	0+85	VC	
	0+85	1+00	1+00	1+00	VC	
			1+00	1+16	CS	
	1+16	1+26	1+26	1+26	DS	Lot 6605
	1+26	1+47	1+47	1+60	CS	
	1+60	1+72	1+72	1+81	CS	
	1+81	1+87	1+87	1+87	DS	Lot 6609
	1+87	2+22	2+22	2+22	VC	
	2+22	2+51	2+51	2+51	DS	Lot 6613

Sidewalk Inventory

Start Point: Gooseander CT @ Robin Dr W

End Point: Robin Dr W

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Inspector Name: BF 802

Date: 3-19-24

Total Number of Driveways: See Sheet 1

Street Name: <u>Gooseander CT</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Cont. : L	2+51	2+72	2+72	2+72	VC	
	2+72	2+88	2+88	3+09	CS	
	3+09	3+15	3+15	3+15	DS	Lot 6617
	3+15	3+23	3+23	3+56	CS	
	3+56	4+55	4+55	4+55	VC	
			4+55	4+70	CS	
	4+70	4+80	4+80	4+80	DS	Lot 6621
	4+80	5+16	5+16	5+16	VC	
	5+16	5+49	5+49	5+49	DS	Lot 6625
	5+49	5+56	5+56	5+71	CS	
	5+71	5+77	5+77	5+77	DS	Lot 6629
	5+77	6+27	6+27	6+27	DS	Lot ?
	6+27	6+66	6+66	6+66	DS	Lot 6628
	6+66	6+84	6+84	6+90	CS	

20FY
985b

985b

Start Point: Gooseander CT @ Robin Dr W

End Point: Robin Dr W

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF302
Date: 3-9-14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: See sheet 1

Street Name: <u>Gooseander CT</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Cont. : L	6+90	7+03	7+03	7+03	DS	Lot 6622
	7+03	7+14	7+14	7+26	CS	
	7+26	7+37	7+37	7+37	DS	Lot 6624
	7+37	7+97	7+97	7+97	DS	Lot 6622
	7+97	8+50	8+50	8+50	DS	Lot 6620
	8+50	8+56	8+56	8+62	CS	
	8+62	9+06	9+06	9+06	DS	Lot 6618
	9+06	9+55	9+55	9+55	DS	Lot 6616
	9+55	9+64	9+64	9+73	CS	
	9+73	9+79	9+79	9+79	DS	Lot 6614
	9+79	9+86	9+86	10+65	CS	
			10+40	10+40	DS	Lot 6612
	10+65	11+15	11+15	11+15	DS	Lot 6610
	11+15	11+33	11+33	11+59	CS	

3FY
98SC

98SC

Sidewalk Inventory

Start Point: Gooseander CT @ Robin Dr W

End Point: Robin Dr W

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF102
Date: 3-19-14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: See sheet 1

Street Name: <u>Gooseander CT</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
	11+59	11+66	11+66	11+66	DS	Lot 6608
	11+66	11+71	11+71	11+81	CS	
	11+81	11+88	11+88	11+88	PO	Bush
	11+88	12+21	12+21	12+21	DS	Lot 6606
	12+21	12+70	12+70	12+70	DS	Lot 6604
	12+70	13+12	13+12	13+12	DS	Lot 6602
	13+12	13+31	13+31	13+31	VC	
	13+31	13+47	13+47	13+47	DS	Lot 6600
Robin Dr W : L	13+47					END

of 4
985d

985d

9752
TOPZ

Start Point: Eider CT @ Robin Dr W Sidewalk Inventory


End Point: Robin Dr W

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF302
Date: 3-19-14

VC Vertical Clearance = $\frac{1}{2}$ more DS Driveway Cross Slope
PP Pinch Point = 3' or less CS Panel Cross Slope
PZ Passing Zone = 200' WP Width of Panel
PO Protruding Object

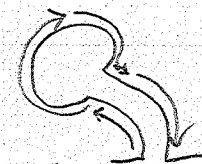

Total Number of Driveways: 11

Street Name: <u>Eider CT</u> (PT1)	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Robin Dr W: 2	0+00	0+04	0+04	0+12	CS	
	0+12	1+91	1+91	1+91	DS	Lot 6601
	1+91	1+98	1+98	2+12	CS	No PZ's
	2+12	2+21	2+21	2+21	DS	Lot 6603
	2+21	2+69	2+69	2+69	DS	Lot 6605
	2+69	2+85	2+85	2+85	DS	Lot 6607
	2+85	2+99	2+99	2+99	VC	
	2+99	3+07	3+07	3+17	CS	
	3+17	3+24	3+24	3+24	DS	Lot 6609
	3+24	3+30	3+30	3+36	CS	
	3+36	3+42	3+42	3+42	DS	Lot 6611
	3+42	3+58	3+58	3+58	VC	
	3+58	3+80	3+80	3+80	DS	Lot 6610
	3+80	3+95	3+95	4+51	CS	No PZ's

9752

10-156
120F2

Sidewalk Inventory

Start Point: Eider CT @ Robin Dr W

End Point: Robin Dr W

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Inspector Name: REBOZ

Date: 3-19-14

Total Number of Driveways: See Sheet 1

Street Name: Eider CT. (PT 2)	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Conte : L	4+51	4+57	4+57	4+57	DS	Lot 6608
	4+57	4+62	4+62	4+69	CS	
	4+69	4+83	4+83	4+83	DS	Lot 6606
	4+83	5+28	5+28	5+28	DS	Lot 6604
	5+28	5+95	5+95	5+95	DS	Lot 6602
	5+95	6+24	6+24	6+24	DS	Lot 6600 No PZ's
	6+24	6+30	6+30	6+40	CS	
	6+40	6+48	6+48	6+56	CS	
Robin Dr W	6+56					END

19756

965a

1 of 2

Start Point: Robin CT @ Robin Dr W

Sidewalk Inventory

End Point: Robin Dr W


Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF302
Date: 3-19-14

- VC Vertical Clearance = 1/2" more
- PP Pinch Point = 3' or less
- PZ Passing Zone = 200'
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 17

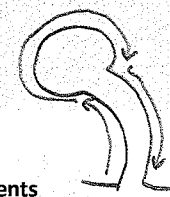

Street Name: Robin CT	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Robin Dr W: L	0+00	0+03	0+03	0+65	CS	
	0+65	2+44	2+44	2+44	VC	No PZ's
	2+44	2+85	2+85	2+85	VC	
	2+85	3+00	3+00	3+19	CS	No PZ's
	3+19	5+31	5+31	5+48	CS	
			5+40	5+40	DS	Lot 4984
	5+48	5+57	5+57	5+57	VC	
	5+57	5+86	5+86	5+86	VC	
	5+86	6+06	6+06	6+06	VC	
	6+06	6+55	6+55	6+55	VC	
	6+55	6+98	6+98	6+98	VC	
	6+98	7+38	7+38	7+38	VC	
	7+38	7+71	7+71	7+71	DS	Lot 4992
	7+38	7+59	7+59	8+01	CS	

965a

Sidewalk Inventory

Start Point: St. Simon CT @ Lambert Dr

End Point: Lambert Dr


Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF302
Date: 3-19-14

- VC Vertical Clearance = 1/2" ^{more}
- PP Pinch Point = 3' ^{or less}
- PZ Passing Zone = 200'
- PO Protruding Object
- DS Driveway Cross Slope 3%+
- CS Panel Cross Slope 3%+
- WP Width of Panel

Total Number of Driveways: 22

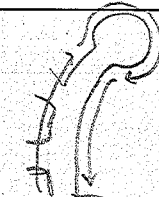

Street Name: <u>St. Simon CT</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Lambert Dr: L	0+00	2+42				
Sutherland Dr: L	0+00	3+19				
Lysander Ct: L	0+00	2+49	2+49	2+49	DS	Lot 5020
	2+49	4+66	4+66	4+75	CS	
	4+66	4+92	4+92	4+96	CS	
	4+96	5+17	5+17	5+17	DS	Lot 5015
	5+17	5+50	5+50	5+61	CS	
	5+61	6+07	6+07	6+07	DS	Lot 5013
	6+07	6+37	6+37	6+57	CS	
	6+57	6+88	6+88	6+92	CS	
	6+92	7+91	7+91	7+91	DS	Lot 5009
	7+91	8+82	8+82	8+82	DS	Lot 5007
	8+82	9+10	9+10	9+10	VC	
	9+10	10+95	10+95	10+95	VC	

Lambert Dr 10+95 11+81

END

Sidewalk Inventory

Start Point: Teal loop @ Robin Dr WEnd Point: Robin Dr W

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF802Date: 3-19-14VC Vertical Clearance = $\frac{1}{2}$ inch

PP Pinch Point = 3' or less


PZ Passing Zone = 200'

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

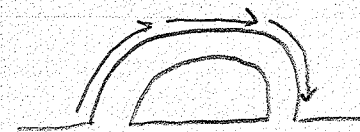Total Number of Driveways: 10

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Robin Dr W: L	0+00	—	0+00	0+00	VC	
	0+00	0+44	0+44	0+44	DS	Lot 6601
	0+44	1+41	1+41	1+41	DS	Lot 6607
	1+41	3+45	3+45	3+57	CS	
	3+57	4+39	4+39	4+52	CS	
	4+52	4+73	4+73	4+73	VC	
Robin Dr W	4+73					END

Sidewalk Inventory

Start Point: Farrington Ct. @ Sutherland DrEnd Point: Sutherland Dr

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BEJ02Date: 3-19-14

VC Vertical Clearance = $\frac{1}{2}$ more
 PP Pinch Point = 3' or less
 PZ Passing Zone = 200'
 PO Protruding Object

DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

Total Number of Driveways: 9

Street Name: <u>Farrington Ct.</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Sutherland Dr</u>	0+00	0+04	0+04	0+10	CS	
	0+10	0+64	0+64	0+64	PO	Tree limbs
	0+64	0+94	0+94	0+94	PO	Tree limbs
	0+94	3+34	3+34	3+34	DS	Lot 4968
	3+34	3+80	3+80	3+80	DS	Lot 4967
	3+80	4+45	4+45	4+45	VC	
	4+45	5+99	5+99	5+99	DS	Lot 4961
<u>Sutherland Dr</u>	5+99	6+67				END

Sidewalk Inventory

1025

Start Point: Croydon CT @ Lambert Dr


End Point: Lambert Dr

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF 302
Date: 3-19-14

- VC Vertical Clearance = 1/2" ^{more}
- PP Pinch Point = 3' ^{or less}
- PZ Passing Zone = 200'
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

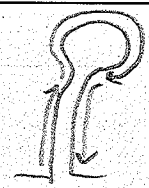

Total Number of Driveways: 17

Street Name: <u>Croydon CT</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Lambert Dr: L</u>	<u>0+00</u>	<u>1+64</u>	<u>1+64</u>	<u>1+64</u>	<u>VC</u>	
	<u>1+64</u>	<u>2+30</u>	<u>2+30</u>	<u>2+56</u>	<u>CS</u>	
	<u>2+56</u>	<u>4+43</u>	<u>4+43</u>	<u>4+43</u>	<u>PO</u>	<u>Tree limb</u>
	<u>4+43</u>	<u>8+91</u>	<u>8+91</u>	<u>8+91</u>	<u>VC</u>	
	<u>8+91</u>	<u>11+31</u>	<u>11+31</u>	<u>11+38</u>	<u>CS</u>	
<u>Lambert Dr</u>	<u>11+38</u>	<u>12+22</u>				<u>END</u>

925

Sidewalk Inventory

Start Point: Caverness Ct @ Lambert Dr


End Point: Lambert Dr

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF #02
Date: 3-19-14

- VC Vertical Clearance = $\frac{1}{2}$ " more
- PP Pinch Point = 3' or less
- PZ Passing Zone = 200'
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

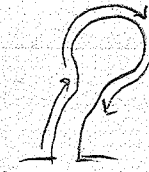

Total Number of Driveways: 2

Street Name: <u>Caverness Ct</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Lambert Dr.</u>	<u>0+00</u>	<u>0+62</u>	<u>0+62</u>	<u>0+62</u>	<u>DS</u>	
	<u>0+62</u>	<u>2+75</u>	<u>2+75</u>	<u>2+75</u>	<u>DS</u>	
	<u>2+75</u>	<u>3+24</u>	<u>3+24</u>	<u>3+24</u>	<u>DS</u>	
	<u>3+24</u>	<u>3+40</u>	<u>3+40</u>	<u>3+44</u>	<u>CS</u>	
	<u>3+44</u>	<u>4+04</u>	<u>4+04</u>	<u>4+04</u>	<u>VC</u>	
	<u>4+04</u>	<u>4+20</u>	<u>4+20</u>	<u>4+20</u>	<u>VC</u>	
	<u>4+20</u>	<u>5+57</u>	<u>5+57</u>	<u>5+60</u>	<u>CS</u>	
<u>Lambert Dr.</u>	<u>5+60</u>	<u>6+35</u>				<u>END</u>

Sidewalk Inventory

Start Point: Edgeware ct. @ Lambert DrEnd Point: Lambert Dr

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF102Date: 3-19-14VC Vertical Clearance = $\frac{1}{2}$ " ^{more} - DS Driveway Cross Slope

PP Pinch Point = 3' or less CS Panel Cross Slope

PZ Passing Zone = 200' WP Width of Panel

PO Protruding Object

Total Number of Driveways: 12

Street Name: <u>Edgeware ct.</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Lambert Dr</u>  L	0+00	2+32	2+32	2+32	VC	
	2+32	2+70	2+70	2+81	CS	
			2+81	2+81	VC	
	2+81	3+28	3+28	3+37	CS	
	3+37	4+55	4+55	4+55	VC	
	4+55	4+67	4+67	4+67	VC	
	4+67	4+78	4+78	4+78	DS	
	4+78	6+72	6+72	6+80	CS	
	6+80	8+03	8+03	8+13	CS	
<u>Lambert Dr</u>	8+13	8+98				END

Start Point: Charlington Ct and Lambert Dr

End Point: "

Direction of Increasing Station: ET

Reason Codes for NON-COMPLIANCE:

Inspector Name: SLRTH JH

Date: March 2014

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 9

Street Name: <u>Charlington Ct</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
	0+00	0+87	0+87	0+95	CS	
	0+95	1+23	1+23	1+23	VC	
	1+23	2+57	2+57	2+57	VC	
	2+57	6+70				
McLaren Lane ^{RT}	0+00	0+50	0+50	0+58	CS	off of Lambert Dr.
McLaren Lane ^{Left}	0+00	0+18	0+18	0+28	CS	" " "
	0+28	0+42				

Start Point: Lambert Dr. at Tiverton Ct

End Point: Lambert Dr. at Tiverton Ct

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: SC. RH. JH
Date: March 19, 2014

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 10

Street Name: Tiverton Ct	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Right	0+00	1+12	1+12	1+12	DS	MB 5163
	1+12	2+52	2+52	2+52	VC	
	2+52	2+64	2+64	2+64	PO	No Passing Zone
	2+64	4+26	4+26	4+26	VC	
	4+26	6+77	6+77	6+77	VC	
	6+77	7+04	7+04	7+04	VC	
	7+04	7+16	7+16	7+16	CS	

Start Point:

Lambert Dr.

Sidewalk Inventory

at

Boscombe Ct

Right

875

End Point:

"

"

Direction of Increasing Station:

Rt

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

DS Driveway Cross Slope

PP Pinch Point

CS Panel Cross Slope

PZ Passing Zone

WP Width of Panel

PO Protruding Object

Inspector Name: SC/SH/RH

Date: March 19, 2014

Total Number of Driveways:

9

Street Name:

Boscombe Ct

Compliant

Non-Compliant

From

To

From

To

Code

Comments

Right	0+00	0+14	0+14	0+33	CS	
	0+33	2+29	2+29	2+29	VC	
	2+29	4+27	4+27	4+27	VC	
	4+27	4+47	4+47	4+47	PO	
	4+47	5+63	5+63	5+71	CS	
			5+71	5+71	VC	
end Lambert	5+71	6+19	6+19	6+19	VC	

875

Sidewalk Inventory

Start Point: Ly sandar at St. Simon Dr.

End Point: "

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: SC RH JH

Date: March 16, 2014

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 11

Street Name: <u>Ly sandar</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Right</u>	<u>0+00</u>	<u>2+00</u>	<u>2+00</u>	<u>2+00</u>	<u>PZ</u>	
	<u>2+00</u>	<u>3+98</u>	<u>3+98</u>	<u>3+98</u>	<u>VC</u>	
	<u>3+98</u>	<u>5+21</u>	<u>5+21</u>	<u>5+21</u>	<u>DS</u>	<u>MB 6343</u>
	<u>5+21</u>	<u>6+19</u>	<u>6+19</u>	<u>6+19</u>	<u>DS</u>	<u>MB 6339</u>
	<u>6+19</u>	<u>10+24</u>				<u>End</u>

Start Point: Regate CT / Lambert Dr

End Point: " "

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: RHSC/JH
 Date: 3/9/14

- VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object
- DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 12

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Regate	0 +00	0+67	0+67	0+67	DS	5081
	0+67	0+90	0+90	0+90	PO	
	0+90	2+81	2+81	2+81	VC	
	2+81	6+39				

Start Point: Dartmoor Ct at Lambert Dr.

End Point: 11 11

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: SLR/HJH
Date: March 15, 2014

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 9

Street Name: <u>Dartmoor Ct.</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Right</u>			<u>0+00</u>	<u>0+17</u>	<u>CS</u>	
	<u>0+17</u>	<u>0+29</u>	<u>0+29</u>	<u>0+50</u>	<u>CS</u>	
			<u>0+50</u>	<u>0+50</u>	<u>DS</u>	<u>MB 5/01</u>
			<u>0+50</u>	<u>0+75</u>	<u>CS</u>	
	<u>0+75</u>	<u>3+82</u>	<u>3+82</u>	<u>3+82</u>	<u>VC</u>	
<u>Lambert Dr.</u>	<u>3+82</u>	<u>6+49</u>				

835

0+00

1851
+ 1852
2703

Sidewalk Inventory

Start Point: In wood pt. / Mountville Rd (L+)

End Point: Union Ridge Dr 18+51

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Inspector Name: R/D/JT
Date:

Total Number of Driveways: IIII IIII IIII

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Mountville Rd	0+00	1+65				
			1+65	2+05	CS	2613 →
	2+05	3+29	3+29	3+29	VC	Joint raised sidewalk
	3+29		3+29	3+29	VC	Raise sidewalk joint.
	3+29	3+90				
	3		3+90	3+90	VC	1/4 Bump Drive 2617
	3+90	6+12 16				2621
			6+12 16	6+16	VC	2625, 2627
	6+16	6+62				
MarLnd Dr. S.	6+62	12+59 GA				2625, 2627, 2629, 2631, 2633, 2635, 2637 2641, 2643
			12+59 GA	12+64	VC	Bump
	12+64	14+03				
			14+03	14+03	VC	Vertical Bump.
	14+03	16+53	16+53	16+53	VC	Vertical Driveway Bump

Union Ridge Dr.
16+53 18+51

835

5775 3/18/14
 Adams town

Start Point: Underwood Lane / Doubs Rd
 End Point: Morland Dr. Sate

Sidewalk Inventory

10+36

1056
 1040

2072

815

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: D/R/S F
 Date: _____

VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object

DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

Total Number of Driveways: 7+11 11

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>R Doubs Rd</u>	<u>0+00</u>	<u>1+01</u>				
<u>Underwood ct.</u>	<u>1+01</u>	<u>1+42</u>				
<u>Underwood ct.</u>	<u>1+42</u>	<u>5+50</u>	<u>5+50</u>	<u>5+51 1/2</u>	<u>VC</u>	<u>1" Lip. About 1' wide 2511.</u>
	<u>5+51</u>	<u>7+29 50</u>	<u>7+29 50</u>	<u>7+50</u>	<u>DS 1/2</u>	<u>25.03, 25.05, 25.07, 25.09, 25.11, 25.13</u>
	<u>7+50</u>	<u>7+92</u>	<u>7+92</u>	<u>7+92</u>	<u>VC</u>	<u>25.15</u>
<u>Morland Dr. S</u>	<u>7+92</u>	<u>10+36</u>				<u>Entire Driveway 25.16</u>
<u>Morland Dr. S</u>	<u>10+36</u>					<u>1" Lip. 25.13 Driveway</u>

815

End Point: Dombs Rd.

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

Inspector Name: C/R/S.T.
Date: 7/1

Compliant

Non-Compliant

Total Number of Driveways: 15 Total
with 572

— Do side you
are on
only

Street Name:

From

To

From

To

Code

Comments

[illegible]

Sidewalk Inventory

Start Point: Meridan CT @ Tennison Dr

End Point: Tennison Dr


Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF 302
Date: 3-18-14

VC Vertical Clearance = $\frac{1}{2}$ " or more
PP Pinch Point = 3' or less
PZ Passing Zone = 200'
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

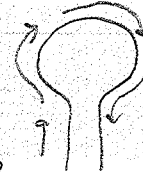

Total Number of Driveways: 8

Meridan CT

LT

Compliant

Non-Compliant

Street Name:

From

To

From

To

Code

Comments

Tennison Dr	0+00	1+80	1+80	1+80	VC	
	1+80	3+62	3+62	3+62	VC	
	3+62	3+90	3+90	4+21	CS	
	4+21	5+26	5+26	5+30	CS	
Tennison Dr	5+30	6+31				END

785

Sidewalk Inventory

Start Point: McLauren CT @ Tennison Dr


End Point: Tennison Dr

Direction of Increasing Station: _____

Inspector Name: BF3 82
Date: 3-18-14

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance = $\frac{1}{2}$ ' or less
PP Pinch Point = 3' or less
PZ Passing Zone = 200'
PO Protruding Object
DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

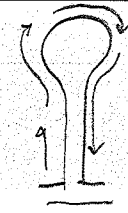

Total Number of Driveways: 14

McLauren CT.
Street Name:

LT

Compliant

From

To

Non-Compliant

From

To

Code

Comments

Tennison Dr	0+00	2+93	2+93	2+93	VC	
	2+93	4+20	4+20	4+35	CS	
	4+35	7+53	7+53	7+53	VC	
Tennison Dr	7+53	10+01				END

785

1.75

Sidewalk Inventory

Start Point: Marsden CT @ Tennison Dr


End Point: Tennison Dr

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF 802
Date: 3-18-14

VC Vertical Clearance = 1/2' more
PP Pinch Point = 3' or less
PZ Passing Zone = 200'
PO Protruding Object
DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

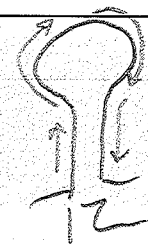

Total Number of Driveways:

Marsden CT
Street Name:



Compliant

Non-Compliant

Street Name:	From	To	From	To	Code	Comments
Tennison Dr	0+00	2+40	2+40	2+40	JC	
	2+40	6+39	6+39	6+57	DS	
Tennison Dr	6+57	9+26				END

775

End Point: Claremont Dr

10

Comments

765

Sidewalk Inventory

Start Point: Lambert CT @ Meridian Way

End Point: Meridian 10.4

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF 302

Date: 3-18-19

VC Vertical Clearance = $\frac{1}{2}$ more DS Driveway Cross Slope

PP Pinch Point = 3' or less


PZ Passing Zone = 200'

PO Protruding Object

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

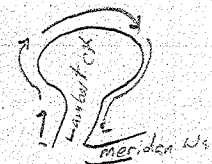

Lambert CT

LT

Compliant

Non-Compliant

Street Name:

From

To

From

To

Code

Comments

[illegible]

745

Sidewalk Inventory
Start Point: Sutherland Dr @ Lambert Dr

End Point: ST Simon CT

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF302

Date: 3-18-14

- VC Vertical Clearance = 1/2" more
- PP Pinch Point = 3' or less
- PZ Passing Zone = 200'
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 15

Sutherland Dr LT

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Lambert Dr	0+00	7+58	7+58		VC	
	7+58	11+11				
Farrington CT	0+00	0+22	0+22	0+35	CS	
			0+26	0+26	PO	Tree limbs
	0+35	0+88 1+08	0+88 1+08	1+08	DS	
	1+08	1+33	1+33	1+54	CS	
			1+33	1+33	VC	
	1+83.54	1+94	1+94	1+94	DS	
	1+94	2+54	2+54	2+54	PO	Tree (Pine)
	2+54	3+84	3+84	3+88	CS	
ST Simon CT	3+88	3+96				END

745

Start Point: Lambert Dr @ Ballenger Creek Pike

End Point: Edgeware CT

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF BOZ

Date: 3-18-14

- VC Vertical Clearance = 1/2" more
- PP Pinch Point = 3' or less
- PZ Passing Zone = 200'
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 0

Street Name:	From	To	Compliant	Non-Compliant	Code	Comments
Lambert Dr LT						
Ballenger Creek Pike	0+00	0+42	0+42	0+42	VC	
	0+42	2+50				
Sutherland Dr	0+00	0+08	0+08	0+36	CS	@ School Crosswalk Ramp
	0+36	1+09	1+09	1+09	VC	
	1+09	2+27	2+27	2+46	CS	
	2+46	2+60	2+60	2+60	VC	
	2+60	2+86				
Caverness CT	0+00	0+31	0+31	0+31	VC	
			0+31	0+66	CS	
	0+66	0+82	0+82	0+96	CS	No PZ's
	0+96	2+45	2+45	2+54	CS	
	2+54	3+49	3+49	3+82	CS	No PZ's
	3+82	4+10	4+10	4+54	CS	
	4+54	6+90				END

2-F2
73sb

Sidewalk Inventory
Start Point: Lambert Dr @ Edge Lane CT

End Point: Meridan Way

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: RF B OZ
Date: 3-18-14

VC Vertical Clearance = $\frac{1}{2}$ " more
PP Pinch Point = 3' or less
PZ Passing Zone = 200'
PO Protruding Object
DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 0

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Lambert Dr LT Edge Lane CT	0+00	0+24	0+24	0+36	CS	
	0+36	2+32				No PZ's
St. Simon CT	0+00	2+38				No PZ's
Groydon CT	0+00	2+26				No PZ's
Reigate CT	0+00	2+58				No PZ's
Dartmoor CT			0+00	0+04	CS	
	0+04	2+48	2+48	2+48	VC	No PZ's
	2+48	2+78				
Charlington CT	0+00	0+62	0+62	0+92	CS	
	0+92	3+00				No PZ's
Tiverton CT	0+00	2+84				No PZ's
Boscombe CT	0+00	3+27				No PZ's

73sb

Start Point: Tennison Dr @ English Muffin Way
 End Point: STA# 1+31 Tennison Dr

1 of 2
725a

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF 302
 Date: 3-18-14

VC Vertical Clearance = 1/2" more
 PP Pinch Point = 3' or less
 PZ Passing Zone = 200'
 PO Protruding Object
 DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

Total Number of Driveways: 4

Street Name: <u>Tennison Dr</u> <u>LT</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
English Muffin Way	0+00	0+44				
			0+44	0+44	VC	
	0+44	0+74				
			0+74	0+74	VC	
	0+74	1+64				
Meridian CT	0+00	1+54	0+54	1+54	VC	
	1+54	4+04	6+15	4+04	DS	
	4+04	6+86				
Mc Lauren CT	0+00	0+18	0+18	0+26	VC/CS	(* 2 VC's at STA# 0+18 & 0+26)
	0+26	1+20	1+20	1+67	CS	
	1+67	3+20				
Marsden CT	0+00	2+76				
Clarendon Dr.			0+00	0+04	CS	
	0+04	1+31	1+31	1+31	VC	Storm Drain W/H

725a

Start Point: Tennison Dr @ 1+31 Sidewalk Inventory

End Point: Lambert DR

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF #02
Date: 3-18-14

VC Vertical Clearance = $\frac{1}{2}$ ^{more}
 PP Pinch Point = 3' ^{or less}
 PZ Passing Zone = 200'
 PO Protruding Object

DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

Total Number of Driveways:

Street Name: Tennison Dr LT

[illegible]

7256

End Point: Mendian Way

Direction of Increasing Station: _____

Inspector Name: S.C.

Date: _____

Reason Codes for NON-COMPLIANCE:

PO Protruding Object

WP Width of Panel

Total Number of Driveways: 0

Street Name: Lambert From Compliant

Compliant	Non-Compliant	Total Number of Driveways.
1	1	2

Non-Compliant

From	To	From	To	Code	Comments
------	----	------	----	------	----------

To	From	To	Code	Comments
----	------	----	------	----------

From	To	Code	Comments
------	----	------	----------

To	Code	Comments
----	------	----------

Code	Comments
------	----------

Comments

[illegible]

105

Sidewalk Inventory

Start Point: Lambert Dr at Ballinger Ct Pike (Right)

End Point: Edge Wave Terrace

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: SC/RH
Date: March 18, 2014

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 0

Street Name: <u>Lambert Dr</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Bal. Ct Pike	0+00	0+36	0+36	0+36	VC	
	0+36	1+52	1+52	1+52	VC	
	1+52	2+11				No Passing Zone
School Parking lot	0+00	0+16	0+16	0+37	CS	School Cross walk
	0+37	2+18	2+18	2+18	VC	No Passing Zone
	2+18	2+30	2+30	2+30	VC	
	2+30	3+61	3+61	3+61	VC	
	3+61	4+50	4+50	4+50	VC	No Passing Zones
	4+50	5+66				
Tennison	0+00	1+78	1+78	1+78	VC	3/4"
	1+78	2+16				No Passing Zone.
Barclay Terr	0+00	1+62	1+62	1+62	VC	
	1+62	1+69				end at Edge Wave

105

GAS

Sidewalk Inventory

Start Point: Lambert Dr at Edgewater turn Right

End Point: Mc Lauren La

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: SC/EL
Date: March 19, 2014

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 0

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Edgewater turn.	0+00	0+04	0+04	0+04	VC	
	0+04	0+69	0+69	0+69	VC	
	0+69	1+73	1+73	2+19	CS	
			2+19	2+19	VC	
			2+19	2+23	CS	No Passing Zone
			2+23	2+23	VC	
St. Simon	0+00	2+07	2+07	2+07	VC	No passing zone
	2+07	2+15				
Croydon	0+00	0+29	0+29	0+29	VC	
	0+		0+29	0+16	CS	
	0+76	4+99				ends at Dartmoor Pl.
Dartmoor	0+00	1+04	1+04	1+04	VC	
	1+04	2+64				

695

Start Point: Sutherland Dr ^{Sidewalk Inventory} at Lambert Dr. Right (685)
 End Point: Sutherland Dr. at St. Simon Ct. Right

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: SC/RL
 Date: March 19, 2014

VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object

DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

Total Number of Driveways: 16 Right

Compliant		Non-Compliant				Comments
Street Name:	From	To	From	To	Code	
Lambert	0+00	7+98 ⁸⁺¹³	7+98 ⁸⁺¹³	8+13	DS	MB 4919
Right	8+13	10+96 ¹¹⁺¹⁵	10+96 ¹¹⁺¹⁵	11+15	DS	MB 4925
	11+15	11+99 ¹²⁺⁰⁸	11+99 ¹²⁺⁰⁸	12+08	DS	MB 4927
	12+08		12+08	12+08	VC	
	12+08	12+ 89 ₁₀	12+ 89 ₁₀	12+90	DS	MB 4929
	12+90	14+00	14+00	14+00	VC	
St. Simon	14+00	15+08				end

[COS]

Sidewalk Inventory

Start Point: Tennison Dr at English Muffin Right

End Point: Marden Pl

Direction of Increasing Station: _____

Inspector Name: S.C./R.H.
 Date: March 18, 2014

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object

DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel


Total Number of Driveways: 0

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
English Muffin way	0+00	0+400	0+400	0+90	PO	tree limbs
	0+90	1+28 ²⁸	1+28 ²⁸	1+28	PO	tree limbs
	1+28	1+41	1+41	1+41	VC	
Marden way	1+41	1+49				
Marden Way	0+00	0+09	0+09	0+09	VC	1 1/2"
	0+09	2+00	2+00	2+00	PZ	
	2+00	4+00	4+00	4+00	PZ	
	4+00	5+30	5+30	5+30	VC	Gas Valve box 1/4
	5+30	6+00	6+00	6+00	PZ	
	6+00	6+77				
McLaren Lane	0+00	1+36	1+36	1+36	PO	Gas Valve box in sidewalk
	1+36	2+00	2+00	2+00	PZ	
	2+00	3+36				

[illegible]

1 inch = 0.1 miles

**BE ADVISED THE USE OF THE CONTENT
IN THIS MAP IN ANY FORM OTHER THAN
AS PRESENTED HERE, MAY CONSTITUTE
A MISINTERPRETATION OF THE MAP'S
ORIGINAL INTENT.**

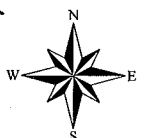

DISCLAIMERS

While efforts have been made to ensure the accuracy of this map, Frederick County accepts no liability or responsibility for errors, omissions, or positional inaccuracies in the content of this map. Reliance on this map is at the risk of the user. This map is for illustration purposes only and should not be used for surveying, engineering, or site-specific analysis. Modification to this product without prior consent is strictly prohibited.

183 Divide ways

$$\begin{array}{r}
 51 \\
 3 \overline{) 153} \\
 \underline{15} \\
 03 \\
 \underline{03} \\
 0
 \end{array}
 +
 \begin{array}{r}
 21 \\
 2 \overline{) 42} \\
 \underline{4} \\
 02 \\
 \underline{02} \\
 0
 \end{array}$$

Underwood, 15722
 Underwood 7

While efforts have been made to

Start Point: Ridge Field Ln. Rt.

Sidewalk Inventory

655

End Point: _____

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

DS Driveway Cross Slope

PP Pinch Point

CS Panel Cross Slope

PZ Passing Zone

WP Width of Panel

PO Protruding Object

Inspector Name: _____

Date: _____

Total Number of Driveways: _____

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Ridge Field ^{Cir}	0+00	0+31	0+00	0+31	CS	
	0+31	1+54				
			1+54	1+66	VC	1"
	1+66	1+83				
	1+83	2+23	2+41	2+41	VC	1" Joint Across Driveway
	2+41	2+41	2+41	2+41	VC	1" Joint
	2+41	3+99 ^{A+11}	3+99 ^{A+11}	4+11	VC	1"
	4+11	4+33				
Baldridge Dr.						

655

Start Point: Ridge Field Lane

Sidewalk Inventory

Baldridge L Rt

344
411
755

CAS

End Point: Ridge Field Cir

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Inspector Name:

Date:

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Ridge Field	0+00	0+42				
BALDRIDGE DR			0+42	1+14	CS	
	1+14	1+46				
			1+46	1+54	CS	
	1+54	1+98				
			1+98	2+14	CS	
	2+14	2+30				
			2+30	2+47	CS	
	2+47	3+18				
Ridge Field CIR.			3+18	3+28	CS	
" "			3+28	3+44	CS	Inv to Circle.

645

635

Sidewalk Inventory

Start Point: 0+00 Rt. Union Ridge Ct / ~~DECATUR DR.~~ IN wood Dr. 4+56 Rt.

End Point: ~~0+56~~ 4+56 IN wood Rt

Direction of Increasing Station: 0+00 to 4+56 Rt.

Inspector Name: Trant/wes/
French
 Date: 3/14/14

Reason Codes for NON-COMPLIANCE:

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 3

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
DECATUR <u>Union Ridge</u>			0+00	0+67	CS	
DECATUR <u>Dr.</u>	0+67	0+78				
	0+78	0+93				Driveway 1.7. 5905
	0+93	1+77				
	1+77	1+93				Driveway 1.1 5903
	1+93	2+76				
	2+76	2+90				Driveway 0.7 5901
<u>IN wood Dr.</u>	2+90	4+56				<u>Union Ridge Dr. & IN wood</u>

Start Point:

Haddington Dr

Sidewalk Inventory

Marland Dr. Rt.

625

End Point:

Union Ridge Dr.

Direction of Increasing Station:

0+00 to 13+79

Reason Codes for NON-COMPLIANCE:

Inspector Name:

Todd Terry/Dow

Date:

3-14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

11

Street Name:

Haddington Dr

Compliant

Non-Compliant

From

To

From

To

Code

Comments

<u>Marland Dr. North</u>	<u>0+00</u>	<u>1+15</u>	<u>1+15</u>	<u>1+50</u>	<u>CS</u>	
<u>Rt. side</u>	<u>1+50</u>	<u>5+07</u>	<u>5+07</u>	<u>5+07</u>	<u>VC</u>	
	<u>5+07</u>	<u>5+33</u>	<u>5+33</u>	<u>5+53</u>	<u>CS</u>	
	<u>5+53</u>	<u>5+63</u>	<u>5+63</u>	<u>5+63</u>	<u>VC</u>	<u>D/W</u>
	<u>5+63</u>	<u>8+55</u>	<u>8+55</u>	<u>8+90</u>	<u>CS</u>	
	<u>8+90</u>	<u>10+28</u>	<u>10+28</u>	<u>10+65</u>	<u>CS</u>	
	<u>10+65</u>	<u>10+89</u>	<u>10+89</u>	<u>10+89</u>	<u>VC</u>	
	<u>10+89</u>	<u>11+05</u>	<u>11+05</u>	<u>11+05</u>	<u>VC</u>	
	<u>11+05</u>	<u>12+41</u>	<u>12+41</u>	<u>12+78</u>	<u>CS</u>	
<u>Union Ridge Dr</u>	<u>12+78</u>	<u>13+79</u>	<u>13+79</u>	<u>13+79</u>	<u>VC</u>	<u>GAS VALVE</u>

625

Mar Lane Dr. North

Sidewalk Inventory

GIS

Start Point: Decatur Dr

End Point: Haddington Dr.

Direction of Increasing Station: 0+00 to 17+03

Reason Codes for NON-COMPLIANCE:

Inspector Name: Todd Kinsinger
Date: 3-19

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 17

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Decatur Dr. Marland Dr. N.	0+00	0+09	0+09	0+09	VC	
(rt. side)	0+09	1+27	1+27	1+75	CS	> 3%
	1+75	2+49	2+49	2+49	VC	
	2+49	3+64	3+64	4+07	CS	
	4+07	4+30	4+30	4+59	CS	
	4+59	4+87	4+87	4+87	VC	
	4+87	6+76	6+76	6+76	VC	
	6+76	7+57	7+57	7+57	VC	
	7+57	10+11	10+11	10+14	VC	
	10+14	12+22	12+22	12+22	VC	
Haddington Dr	12+22	17+03				

GIS

60s

Sidewalk Inventory

SAS

Start Point:

Aberdale Place

End Point:

Derfield Pl. no s/w

Direction of Increasing Station:

0+06 to 4+06

VC Vertical Clearance

Inspector Name:

Total Time Wages

Date:

3-14

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

2

Street Name: _____

Aberdele Sinner

Compliant

From

To

Non-Compliant

From

To

Code

Comments

Morland De. N.

0 f 60

0 + 0 0

0 + 17

CS

 $\sim 3\%$

(rt. side)

 $0+17$

3 + 84

3484

4 + 06

CS

73%

Dev field PL.

End Point: Goldenwood Place

Direction of Increasing Station: 0+00 to 5+70

Inspector Name: Todd / Tina / Wayne
Date: 3-14-14

WP Width of Panel

Total Number of Driveways:

Compliant		Non-Compliant		Code	Comments
Street Name:	To	From	To		
Union Ridge Dr					

[illegible]

Sidewalk Inventory

Start Point: Union Ridge Dr / Morland Dr. North.

End Point: Left side New Design RT

Direction of Increasing Station: 0+00 to 6+27 Left.

Reason Codes for NON-COMPLIANCE:

Inspector Name: Jim/ans/Dan
Date: 3/14/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object


DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 46

Morland Dr. North

Street Name:	Compliant		Non-Compliant		Code	Comments
From	To	From	To			
Union Ridge	0+00		0+00	0+78	CS	5.9
LEFT (N)	0+78 0+78	0+93				26 Driveways 5880
			0+93	1+51	CS	Driveway
			1+51	1+66	DS	Driveway 4.6 5878
			1+66	2+32	CS	Driveway Joint
			2+32	2+48	DS	Driveway 6.2
			2+48	3+17	CS	7.2
	3+17	3+32	3+32			Driveway 2.8
			3+32	4+11	CS	
	4+11	4+27				Driveway 1.7
			4+27	5+11	CS	Driveway 1.7
			5+11	5+27	DS	Driveway 4.2
New Design	5+27	6+27	6+27	6+27	VC	End of side walk drop off
						no ramp/

Union Ridge / Morland Dr.

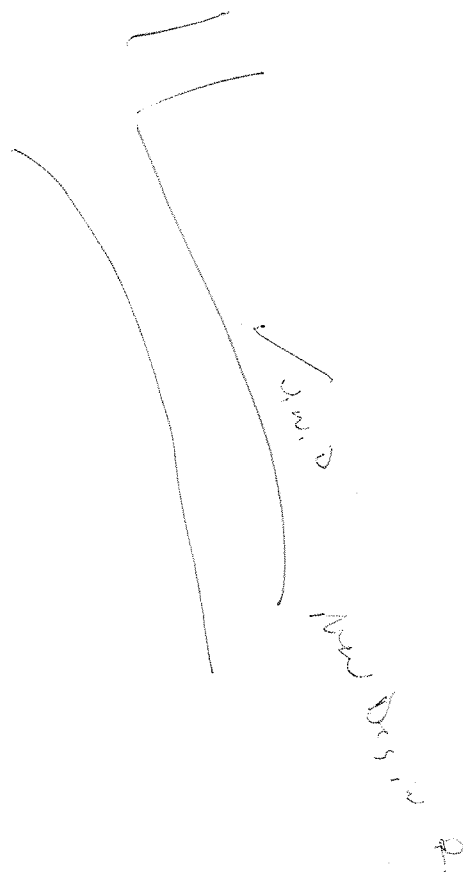

Morland Dr. South

Sidewalk Inventory

555

Start Point: Norwood Pl west

End Point: Inwood Dr.

Direction of Increasing Station: 0+00 to 16+27

Reason Codes for NON-COMPLIANCE:

Inspector Name: Todd / Dan / Jerry

Date: 3-14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

14

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Morland Dr. South	0+00	0+33	0+33	1+22	CS	
(r.t. side)	1+22	1+69	1+69	2+10	CS	
	2+10	2+95	2+95	3+43	CS	
	3+43	3+91	3+91	4+11	CS	
	4+11	11+62	11+62	11+70	CS	
	11+70	11+95	11+95	12+03	VC/CS	
	12+03	14+87	12+03 14+87	12+03 15+04	VC CS	
	15+04	15+53	15+53	15+65	CS	
	15+65	15+74	15+74	15+81	CS	
Inwood Dr.	15+81	16+27				

555

Marland Dr. San'

Start Point: Union Ridge Dr.

 $R +$

End Point: Norwood Pl. West

Direction of Increasing Station: 6+00 to 3+39

Reason Codes for NON-COMPLIANCE:

Inspector Name: Todd / Jerry / Don
Date: 3-14-14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 6

[illegible]

~~Inwood Dr.~~ Morland Dr. S Sidewalk Inventory

Underwood Lane

0+00 1/2 4+98

PO Protruding Object

[Handwritten signature]

4

Compliant

From

To

Non-Compliant

From

To

Code

Comments

[illegible]

Marland South

Sidewalk Inventory

525

Start Point:

Underwood Lane

End Point:

Norwood Pl East

Direction of Increasing Station:

0+00 to 11+96

Reason Codes for NON-COMPLIANCE:

Inspector Name:

Todd Paul Jeng

Date:

2-14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

9

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Underwood Lane	0+00	6+71	6+71	7+03	CS	
(rt. side)	7+03	7+46	7+03	7+93	CS	
	7+93	9+38	9+38	10+00	CS	
	10+00	10+40	10+40	10+44	CS	
Norwood Pl. W.	10+44	11+96				

525

End Point: Union Ridge Dr.

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 0

[illegible]

IN WOOD

Sidewalk Inventory

505

Start Point: Univ Ridge Dr / Long Field Pl. Rt.

End Point: _____

Direction of Increasing Station: 0+00 to 4+32 Marland Dr South Rt

Inspector Name: W.F.T.
Date: 3/14/14

Reason Codes for NON-COMPLIANCE:

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 3

Rt

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Long Field Pl.	0+00	1+76				
	1+76	1+92				Driveway 0.3 5335
	1+92	2+66				
	2+66	2+82				Driveway 2.7 5333
	2+82	3+63				
Marland Dr-S.	3+63	3+79				Driveway 1.7 5331
	3+79	4+32				

505

Sidewalk Inventory

495

Start Point: Union Ridge Dr. / Inwood Dr. RT 0+00

End Point:

Direction of Increasing Station: 0+00 to 5+78 RT Long Field Pl. (no sidewalk Long Field Pl.)

Reason Codes for NON-COMPLIANCE:

Inspector Name: T. F. W.
Date: 3/14/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 5

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
DeCATur Dr. RT Union Ridge Dr.	0+00	0+85				
	0+85	1+05				Driveway 1.3 5897
	1+05 1+05	1+35				
	1+35	2+00				Driveway 0.1 5895
	2+00	3+00				
	3+00	3+15				Driveway 0.9 5893
	3+15	3+85				
	3+85	4+02				Driveway 0.3 1" Lip 5891 both sides
	4+02	4+43				Bump side 1" (0.2 to 1.7)
	4+43	5+04				
	5+04	5+25				Driveway (1.3) 1" Lip tapered 5889
Inwood Dr.	5+25	5+78				

495

465

485

Mr. L. M. &
Dr.
South

New
Design

Sidewalk Inventory

Start Point: Lot 5+ Address 5461

End Point: John Mills RD Address 5431

Direction of Increasing Station:

Inspector Name: OZ & BF

Date: _____

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

[illegible]

Start Point: John Mills Rd Left Sidewalk Inventory

End Point: Bill Dorsey BLVD

Direction of Increasing Station: _____

Inspector Name: OZ B F
Date: 3/14/2014

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 9

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Adamstown Commons DR	0+00	4+96				
Adamstown Commons DR	0+00	3+54	3+54	3+75	CS	
	3+75	4+89	4+89	5+00	CS	
	5+00	5+52	5+52	5+78	CS	
	5+78	6+87				

Start Point: Young Family Trail East Sidewalk Inventory
 End Point: Mae Wade Ave

Direction of Increasing Station: _____

Inspector Name: OZ/BF
 Date: 3/14/2011

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object

DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

Total Number of Driveways: 6 on Right 3 on Left

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Start at Mae Wade Right side	0+00	1+55	1+55	1+69	CS	
	1+69	3+15	3+15	3+76	CS	
	3+76	4+59	4+59	4+75	CS	
	4+75	6+52	6+52	7+04	CS	
	7+04	8+95	8+95	9+47	CS	
	9+47	9+76	9+76	10+12	CS	
Start at dead end sidewalk left side	0+00	6+2	6+2	6+9	CS	
	6+9	10+16	10+16	11+92	CS	
	11+92	13+68	13+68	13+84	CS	
	13+84	14+04				End at Mae Wade Ave.

Direction of Increasing Station:

Inspector Name: OZ & DF
Date: 3/14/2014

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 0

445

Sidewalk Inventory

Start Point: Tracy Bruce DR (house address 2721)

End Point: Adams town Commons DR (house address 5530)

Direction of Increasing Station: Left

Reason Codes for NON-COMPLIANCE:

Inspector Name: OZBDF
Date: 3/14/2014

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 7

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
① Adams town Commons DR	0+00	1+78	1+78	2+54	CS	
① MAY WADE AVE	2+54	4+93				End at house address 5506
① MAY WADE AVE	0+00	1+71	1+71	1+86	CS	
	1+86	4+82	4+82	4+98	CS	
	4+98	6+04	6+04	6+26	CS	
	6+26	7+33	7+33	7+49	DS	
	7+49	8+85	8+85	9+70	CS	
	9+38	9+50	9+50	9+70	CS	
① Adams town Commons DR	9+70	10+04				End at house address 5530

Sidewalk Inventory

Start Point: Young Family Trail west at ~~the~~ end of back walk

End Point: MacWesde Ramp

Direction of Increasing Station:

Inspector Name:

Date:

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 1

Street Name:

Yours family ^{friend} **From**

From

Compliant

To

Non-Compliant

From

To

Code

Comments

at walk path

8 + 8 2

Right Side

End at ramp on the walk

425

Sidewalk Inventory

Start Point:

Sidewalk Inventory at Bill Dorsey Blvd

End Point:

Adamsown Comm'on Dr.

Direction of Increasing Station:

Right side

Inspector Name:

sc/rt

Date:

March 14, 2014

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

1 RT

Street Name:

From *Travis Brown*

From

Compliant

To

Non-Compliant

From

To

Code

Comments

[illegible]

CL et H

Start Point: Bill Dorsey Blvd. at Adams Farm Commons
 End Point: Dead-end 3+92 post John Mills Rd.
 Direction of Increasing Station: Left

Left

Inspector Name: SC/RH
 Date: March 14, 2014

Reason Codes for NON-COMPLIANCE:

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 0

Street Name: Bill Dorsey Blvd	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Bill Dorsey at Adams Farm Commons	0+00	1+27	1+27	1+27	PO	tree limbs at 5'6"
Left ramp	1+27	1+86	1+86	2+02	DS	Robert Cramer Rd
Bill Dorsey at Tracey Bruce intersection	2+02	3+79				Left end at John Mills
Bill Dorsey at John Mills	0+00	3+31				Begin at John Mills
	2+00	3+67	3+67	3+92	PO	tree limbs dead-end
		92	92			

Sidewalk Inventory (Right) at Adamstown Common.

Start Point: Mae Wade

End Point: Young family east at end of ramp

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: S.C. CM, RJI
 Date: March 13, 2014

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 2

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Mae Wade Right	0+00	0+16 79	0+16 79	0+79	VC	trip hazard at inlet
at	0+79	2+00	2+00	2+00	PZ	sidewalk dead end
	2+00	2+14				end sidewalk no DW's
Mae Wade HVE Right	0+00	0+4	0+4	0+16	CS	past young family
	0+16	2+00	2+00	2+00	PZ	3 DW's
	2+00	2+58	2+58	3+58	VC	
End	3+58	4+53				

Sidewalk Inventory

Start Point:

Maie Wade Ave

at Young family east

(right)

375

End Point:

Maie Wade Ave

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

DS Driveway Cross Slope

PP Pinch Point

CS Panel Cross Slope

PZ Passing Zone

WP Width of Panel

PO Protruding Object

Inspector Name:

SC/RH

Date:

March 14, 2014

Total Number of Driveways:

2

Street Name:

Maie Wade Ave

Compliant

Non-Compliant

From

To

From

To

Code

Comments

Maie Wade at V.F.	0 + 00	2 + 41				Right side

375

Sidewalk Inventory

Start Point: Map Wake Ave at Young Family trail east

End Point: _____

Direction of Increasing Station: _____

Inspector Name: SC/RA
Date: 11/2/2011

Reason Codes for NON-COMPLIANCE:

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: _____

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Map Wake (left)	0+00	0+04	0+04	0+04	PO	tree branch's
			0+04	0+55	CS	
	0+55	2+00	2+00	2+00	PZ	4 DWS
	2+00	2+04	2+04	2+12	CS	
left	2+12	3+14	3+14	3+38	CS	
	3+38	4+00	4+00	4+00	PZ	
left	4+00	4+03	4+03	4+12	CS	
Young Family trail east (end)	4+12	4+96				
Map Wake at Young Family	0+00	0+80	0+80	0+80	VC	1" - 2 DWS
End at Dots	0+80	2+39				

On Decatur Dr.

Sidewalk Inventory

Start Point:

End Point:

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name:

Date:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

Compliant		Non-Compliant		Code	Comments
From	To	From	To		
Street Name: <i>Cross St</i>					

[illegible]

Adams
Decker
Kushner

Sidewalk Inventory

Start Point:

John Mills Rd at Adamstown Community Rd

End Point:

John Mills Rd at Bill Dorsey Blvd

Direction of Increasing Station:

Rt.

Reason Codes for NON-COMPLIANCE:

Inspector Name:

SC/RH

Date:

March 14, 2014

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

0 Rt

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
John Mills Right Side			0+00	0+60	CS	
	0+60	2+23	2+23	2+39	CS	
Ramp at Lott St End	2+39	3+36				
Begin at Lott St	0		0+00	0+40	CS	
	0+40	1+42	1+42	1+68	CS	
Right end at Ramp Lott St	1+68	2+00	2+00	2+00	PZ	
	2+00	3+34				
Begin at Ramp at Lott St	0+00	4+15				
Right Side						

Start Point: Mermaid Dr. North / Decatur Union Ridge Ct. 355 Abbington Dr. (RT) Park
 End Point: North South

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: Jerry
 Date: 3/13/14

VC Vertical Clearance
 PP Pinch Point
 PZ Passing Zone
 PO Protruding Object


DS Driveway Cross Slope
 CS Panel Cross Slope
 WP Width of Panel

Total Number of Driveways: 5

Street Name: <u>Decatur Dr.</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Decatur	0+00	0+21				No Passing Zone
<u>Mermaid Dr. A</u>	5+21	0+46	0+21	0+46	CS	Cross slope 3% greater
	0+46	0+83				
			0+83	4+59	CS	C
<u>End: Union Ridge Dr.</u>	4+59	9+86				



3.13.14

Do D.V.S.
RIDGE

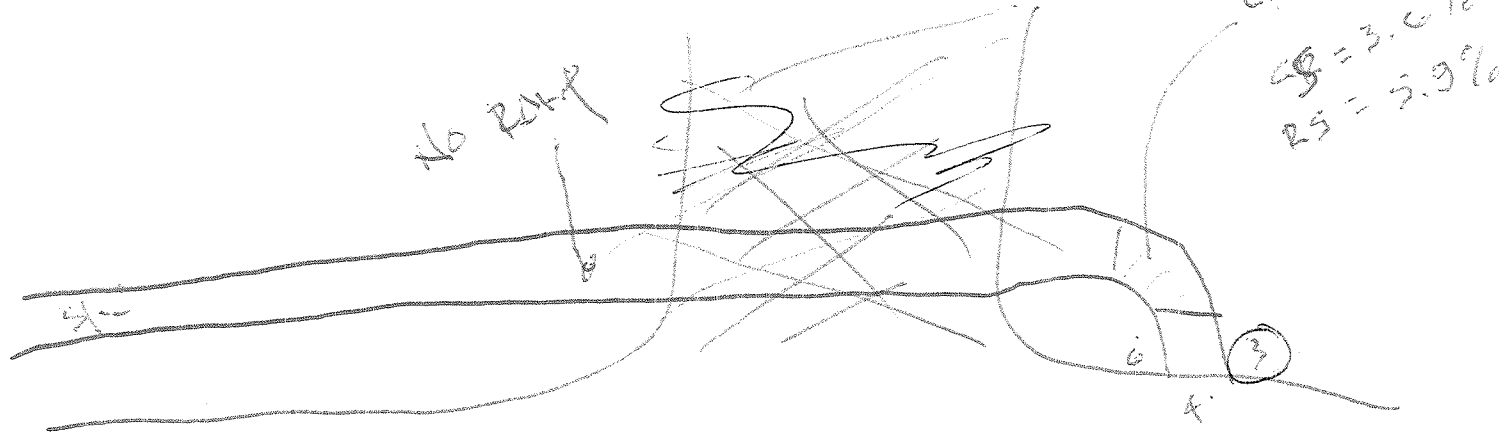

U+10J RIDGE
CT

U+10J
RIDGE
CT

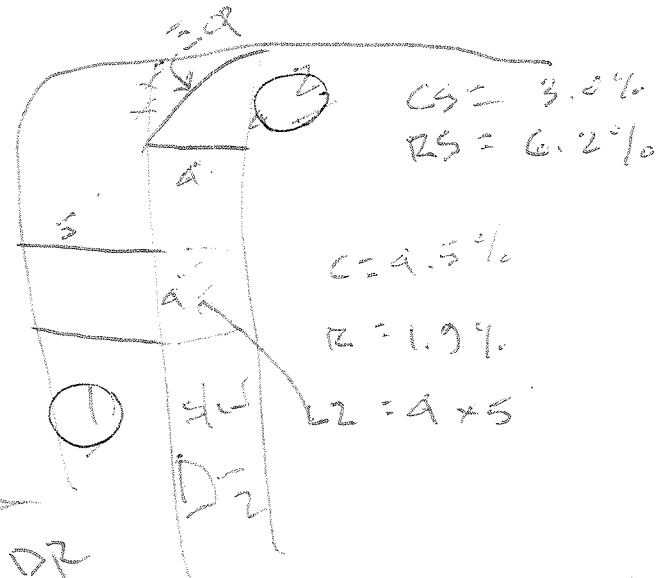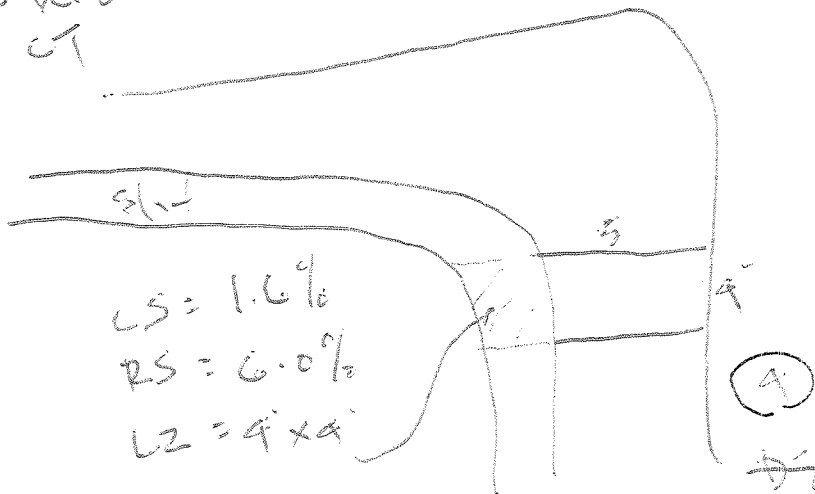

~~DECATUR~~
DECATUR DR

Start Point:

Young Family

Sidewalk Inventory

East at

Mae Wade Ave

End Point:

at Mae Wade Ave

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

DS Driveway Cross Slope

PP Pinch Point

CS Panel Cross Slope

PZ Passing Zone

WP Width of Panel

PO Protruding Object

Inspector Name:

S.C/RH

Date:

March 14, 2014

Total Number of Driveways:

16

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Young Family East LEFT	0+00	2+00	2+00	2+00	PZ	
	2+00	3+93	3+93	3+93	PO	6" pipe
	3+93	4+00	4+00	4+00	PZ	
	4+00	6+00	6+00	6+00	PZ	
	6+00	8+00	8+00	8+00	PZ	
End Ramp	8+00	9+71				Ramp to walk path at 5516
begin at 5516 end Young Family	0+00	2+00	2+00	2+00	PZ	begin at Ramp at 5516
LEFT	2+00	4+00	4+00	4+00	PZ	
	4+00	6+00	6+00	6+00	PZ	
	6+00	8+00	8+00	8+00	PZ	
	8+00	8+31				

Sidewalk Inventory

Start Point: Decatur @ Union Ridge Dr. / Drive Left. home side

End Point: Moreland N me side

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: _____
Date: 3/13/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 17

Street Name: Union Ridge Dr. Date		Compliant		Non-Compliant		Total Number of Driveways: 17
From	To	From	To	Code	Comments	
Decatur Union Ridge Dr.	0+00	0+13	0+13	0+22	CS	
	0+22	0+79	0+79	0+91	CS	
	0+91	3+51	3+51	3+64	CS	
	3+64	4+07	4+07	4+40	CS	
	4+40	7+42	7+42	7+42	VC	
	7+42	8+93	8+93	9+13	CS	
	9+13	9+49	9+49	9+61	CS	
	9+61	9+81	9+81	10+21	CS	
			10+21	10+21	Asphalt Joint 10+31	
	10+21	11+16	11+16	11+87 11+70	CS	
	11+36 11+37	12+34	11+36 12+34	12+64	CS	
	12+64	13+02	12+64 13+02	13+17	VC	
	13+17	13+39	13+39	13+66	CS	
	13+66	14+79	14+79	14+96	CS	
					13+02 Sidewalk 1" Joint hgt.	

End: Moreland North
Intersection

14+96

15+21

Wade Ave.
Sidewalk Inventory

Start Point: Mae Wade Ave. West Left Dead End

End Point: Adamstown Commons

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: SC/KH
Date: March 13, 2014

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: _____

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Mae Wade Ave. left	0+00	1+35				Dead End to Ramp at Fracie Bruce Dr.
Tracey Fracie Bruce Dr. (end)	1+35					Tracey
Mae Wade Ave. (left)	0+00	2+00	2+00	2+00	PZ	
	2+00	3+27				

A.C. → T.B. 3+27 1+35 325

Sidewalk Inventory

Start Point:

Mae Wade Ave - Dead End → Trace Bruce

End Point:

Trace Bruce Dr.
Tracey

Direction of Increasing Station:

Inspector Name:

E/RH

Date:

March 19, 2014

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: No Driveways.

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Mae Wade Right	0+0	1+31				dead end
	0+00	2+00	2+00	2+00	PZ	Trace Bruce Dr.
Mae Wade Right	2+00	2+76	2+76	2+88	CS	Tracey
Adamstown Comm on Dr.	2+88	3+61				End at Adamstown Comm on Dr.

305

South

Total Number of Driveways: 9 K.T.

305

Start Point: Riley's Ct North at Fletchers Dr.

End Point: _____

Direction of Increasing Station: West

Reason Codes for NON-COMPLIANCE:

Inspector Name: SC/RH

Date: March 13, 2014

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 14 RT

Street Name: <u>Riley's Ct. North Right</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>Riley Ct North right</u>	<u>0+00</u>	<u>0+60</u>	<u>0+60</u>	<u>0+87</u>	<u>CS</u>	
	<u>0+87</u>	<u>2+27</u>	<u>2+27</u>	<u>2+41</u>	<u>DS</u>	<u>MB 1805</u>
			<u>2+41</u>	<u>2+48</u>	<u>CS</u>	
	<u>2+48</u>	<u>5+18</u>	<u>5+18</u>	<u>5+29</u>	<u>DS</u>	<u>MB 1813</u>
	<u>5+29</u>	<u>6+54</u>	<u>6+54</u>	<u>6+95</u>	<u>CS</u>	
	<u>6+95</u>	<u>7+40</u>	<u>7+40</u>	<u>7+60</u>	<u>CS</u>	
	<u>7+60</u>	<u>7+88</u>	<u>7+88</u>	<u>7+95</u>	<u>CS</u>	
			<u>7+95</u>	<u>8+03</u>	<u>DS</u>	<u>MB 1804</u>
	<u>8+03</u>	<u>9+48</u>	<u>9+48</u>	<u>9+57</u>	<u>CS</u>	
<u>End</u>	<u>9+57</u>	<u>10+54</u>				<u>End at Fletcher Dr.</u>

Sidewalk Inventory

Start Point: Penny Fields Lock Ct. at Fletcher's Dr.

End Point:

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Inspector Name: SC/RH
Date: March 13, 2014

Total Number of Driveways: 11 Rt.

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Pennyfield Lock Ct	0+00	0+09	0+09	0+09	PO	Gas Valve lid
Right	0+09	3+51	3+51	3+51	PP	Fire hydrant
	3+51	9+60	9+60	9+60	PZ	NO Pass zone
	9+60	9+78	9+78	10+06	CS	
	10+06	10+14				Fletcher Dr. End

Sidewalk Inventory

Start Point: Paw Paw ~~Dr.~~ Circle

End Point:

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name: S.C. / R.H.

Date: March 13, 2014

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

6 Rt.

Street Name: Paw Paw Circle	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Paw Paw Circle			0+00	0+12	CS	Paw Paw Circle at Fletcher's Way
	0+22	0+82	0+12	0+88	CS	
	0+88	4+36				
Wet						

Sidewalk Inventory

Start Point: Lock Tender Ct at Fletcher's Way

End Point: _____

Direction of Increasing Station: _____

Inspector Name: SC RH

Date: March 13, 2014

Reason Codes for NON-COMPLIANCE:

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 6 RT.

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Lock tender Ct	0+00	4+66				
Right						

Sidewalk Inventory

Start Point: Adamstown Commons Dr @ John Mills Rd - ASPHALT PATH

End Point: Montville Rd. circle

Direction of Increasing Station: Bridge 3 ramp / Asphalt Path LT side of Adamstown Commons Dr

Reason Codes for NON-COMPLIANCE:

Inspector Name: BF 002
Date: 3-13-14

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 0 ✓

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
RA Adamstown Commons Dr	0+00	0+12				Path to sidewalk for Adamstown Commons Dr LT side
"	0+12	0+44				Bridge
"	0+44	0+52	2			End connector walk
"	0+00	0+51	0+51	0+91	CS	Asphalt 6' wide *Dead End
"	0+91	1+85	1+85	1+97	CS	
"	1+97	3+21	3+21	3+31	CS	
"	3+31	6+63	6+63	7+46	CS	
"	7+46	15+20				
"	15+20	15+76				Path Ramp Running slope 11.7%
"						stop @ Mae Wade Ave
Adamstown Commons Dr	0+00	0+69	0+69	1+27	CS	stop @ Mae Wade Ave *Asphalt path
"	1+27	6+39	6+39	7+16	CS	
"	7+16	7+59	7+59	9+93	CS	
"	9+93	10+55	10+55	11+12		End @ Dead End @ Montville Rd

Sidewalk Inventory

Sidewalk Inventory

Start Point: Adamstown Commons Dr (END) & John Mills Rd

End Point: Walkway Crossing

Direction of Increasing Station: to crossing

Inspector Name: BF 102

Date: 3-13-14

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

2

[illegible]

Sidewalk Inventory

Start Point:

Adamstown Commons Dr @ (circle) Mountville Rd

23Sa

End Point:

Direction of Increasing Station:

Adamstown Commons Dr Rt.

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

DS Driveway Cross Slope

PP Pinch Point

CS Panel Cross Slope

PZ Passing Zone

WP Width of Panel

PO Protruding Object

Inspector Name:

BF 02

Date:

3-13-14

Total Number of Driveways:

3

Street Name:	Compliant		Non-Compliant		Code	Comments
	To	From	To	From		
RT Mountville Rd	0+00		0+00	0+28	CS	Start @ circle Mountville Rd. Dead End RT side
"	0+28	1+14				
"			1+14	1+22	CS	
"	1+22	1+33				
"			1+33	1+37	CS	
"	1+37	2+00				
"			2+00	2+00	PZ	
"	2+00	4+00				
"			4+00	4+00	PZ	
"	4+00	4+50				RAMP @ Tracer Bruce Dr
RT Tracer Bruce Dr	0+00	1+31	1+31	1+34	CS	Start @ Tracer Bruce Dr RT
"	1+34	6+07				(Brick PZ's 3'x4') RAMP Mae Wade Ave
Mae Wade Ave	0+00		0+00	0+08	CS	Start @ Mae Wade Ave
"	0+08	3+82	3+82	4+02	CS	

23sa

Sidewalk Inventory

Start Point: Adamstown Commons Dr @ (CIRCLE) MOUNTVILLE Rd

End Point: End of sidewalk on LT side

Direction of Increasing Station: Adamstown Commons Dr RT & LT side

Reason Codes for NON-COMPLIANCE:

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object

- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Inspector Name: BF 602
Date: 3-13-14

Total Number of Driveways: 2

Street Name: <u>Adamstown Commons Dr</u>	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Adamstown Commons Dr	4+02	5+36				RAMPS Bill Dorsey Blvd.
BILL DORSEY	0+00	0+80				STORM (large median)
BILL DORSEY	0+00	3+48	3+48	3+60	CS	Start @ Bill Dorsey Blvd
"	3+60	4+84				RAMPS John Mills Rd
JOHN MILLS	0+00	0+04	0+04	0+36	CS	Start @ John Mills Rd
"	0+36	1+24	1+24	1+58	CS	
"	1+58	3+60				(NO PZ) MID STREET CROSSING
"	3+60	10+78	10+78	10+90	CS	
JOHN MILLS	10+90	10+98				END @ John Mills Rd
<u>RT & LT side</u>						
Adamstown Commons Dr	0+00	2+48	2+48	2+88	CS	Start @ John Mills Rd.
"	2+88	3+07	3+07	3+44	CS	PZ OK on LT side
"	3+44	3+73	3+73	4+14	CS	
"	4+14	8+34				End @ Crossing

⊗ on New Sheet

225

Start Point: FLETCHER'S Way / FLETCHER'S DR

End Point: " " FLETCHER'S CT

Direction of Increasing Station: RT

Reason Codes for NON-COMPLIANCE:

Inspector Name: CH / ME
Date: 3/11/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 5

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
FLETCHER DR	0+00	2+54	2+54	2+58	CS	
LOCK TENDER CT	2+58	2+58				
LOCK TENDER CT	0+00	1+52	1+52	1+60	CS	
PAW PAW CT	1+60	2+44				
PAW PAW CT	0+00	2+36				
Conrad Ferry DR						
Conrad Ferry DR	0+00	2+29				
Villot Lock CT						
Villot Lock CT	0+00	3+94				
FLETCHER'S CT						

225

Start Point: Violet's Look Ct CRD (ENTIRE COURT)

End Point: 9646

Direction of Increasing Station: 4

Reason Codes for NON-COMPLIANCE:

Inspector Name:

Date: 3/12/14

VC Vertical Clearance = $\frac{1}{2}$ ^{note} DS Driveway Cross Slope

PP Pinch Point = 3' or less CS Panel Cross Slope

PZ Passing Zone = 200' WP Width of Panel

PO Protruding Object

Total Number of Driveways: 5

Street Name:

From

Compliant

To

Non-Compliant

From

To

Code

Comments

[illegible]

Sidewalk Inventory

Start Point: Fletchers Dr. at Lockhouse Dr.

End Point: _____

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: S.C.
Date: March 12, 2014

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 20

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Fletchers Dr. (H)	0+00	0+27	0+27	0+48	CS	Ramp 3, 16, 2
Left.	0+48	2+00	2+00	2+00	PZ	
	2+00	4+00	4+00	4+00	PZ	
	4+00	4+48				Look From Lockhouse Dr to Lockhouse Dr
Fletchers (L) at Riley St	0+00	3+82	3+82	3+91	DS	Riley's Ct. N MB 1731
			3+91	4+03	CS	
	4+03	13+25	13+25	13+40	CS	
End Ramp 1 Fletchers Way	13+40	15+90				Intersection w Fletchers Way
Ramp 2 Fletchers Dr at Fletchers Way	0+00	0+08	0+08	0+08	PP	Fletchers Way Ramp (2) MH Ring 1/2" high
Left 5	0+08	0+34	0+34	0+54	DS	MB 1703
			0+54	0+69	CS	
	0+69	2+55	2+55	2+83	CS	Sidewalk ends at 2+94 ft

Sidewalk Inventory

Start Point: Fletcher Way Left / Fletcher Ct.

End Point: Mailbox 1601 17+79

Direction of Increasing Station: _____

Inspector Name: 03
Date: 3/12/14

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: (13) ^{Fletcher Way left} 19

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Fletcher Way (L)	0.0	13+34	13+34	13+42	CS	
	13+42	16+94	16+94	17+11	DS	
	17+11	17+19	17+19	17+28	CS	@ address 1601 Fletcher Way
(4) Fletcher Way	0+00	12+60				
1601 Fletcher Ct.	12+60	13+34	13+34	13+42	CS	
Left.	13+42	16+94	16+94	17+11	DS	MB 1601 Fletcher Ct (6)
End	17+11	17+19	17+19	17+20	CS	1600 End

Sidewalk Inventory

Start Point: FLECHTERS DR / @ Lockhouse

End Point: FLECHTER DR / @ Lockhouse

Direction of Increasing Station: RT

Inspector Name: RHH/W

Date: 3/11/14

Reason Codes for NON-COMPLIANCE:

- VC Vertical Clearance
- PP Pinch Point
- PZ Passing Zone
- PO Protruding Object
- DS Driveway Cross Slope
- CS Panel Cross Slope
- WP Width of Panel

Total Number of Driveways: 18

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
LOCKHOUSE DR	0+00	4+26				
RILEY CT South						
RILEY ^{SCT} CT South	0+00	2+73	2+73	2+73 ⁷	CS	
	2+73	4+49	4+49	4+49 ⁵³	CS	
PENNYFIELDS LCK CT	4+49 ⁵³	6+05				
PENNYFIELDS LCK CT	0+00	6+11	6+11	6+23	CS	
	6+23	6+43				

Start Point: Ramp (4) at Fletcher / Lockhouse Dr.

End Point: Sidewalk (R) Fletchers Drive

Direction of Increasing Station: East

Reason Codes for NON-COMPLIANCE:

Inspector Name: S.C. / R.H.
Date: March 16, 2014

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: 0 none

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Ramp (4) at Fletcher / Lockhouse Dr.	0+00	0+20	0+20	0+33	CS	Asphalt Path Right
	0+33	1+93	1+93	2+13	CS	
	2+13	5+54	5+54	6+07	CS	
	6+07	6+30	6+30	7+03	CS	
	7+03	8+00	8+00	8+15	CS	
Sidewalk at Fletchers Dr. Right (End)	8+15	9+25				End at sidewalk
Lockhouse Dr. across from Fletcher Dr.			0+00	0+15	CS	Asphalt walk path
	0+15	1+08	1+08	1+15	CS	Left
	1+15	1+20	1+20	1+36	CS	
	1+36	2+08	2+08	2+26	CS	
Carroll Manor fire dept. parking lot (End)	2+26	2+93				End at sidewalk

165

Start Point: Lockhouse

End Point:

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name:

Date:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

Street Name:

Conrads Ferry From

~~Compliant~~

From

To

Non-Compliant

From

To

Code

Comments

Kam. p (4)
Conrad at parking lot

07 00

3473

3 drive ways

End

3473

 $3 + 58$

Fletcher's way - Conrads Ferry Inter
Section

Ramp (B)
Convad Ferry at Lockhouse Pt.

 $0 + 00$

4 drive ways


Ramp (2)
Fletcher's way / Conrad

 $3 + 58$

Fletcher's Way - Conrad Ferry Intersection

165

165

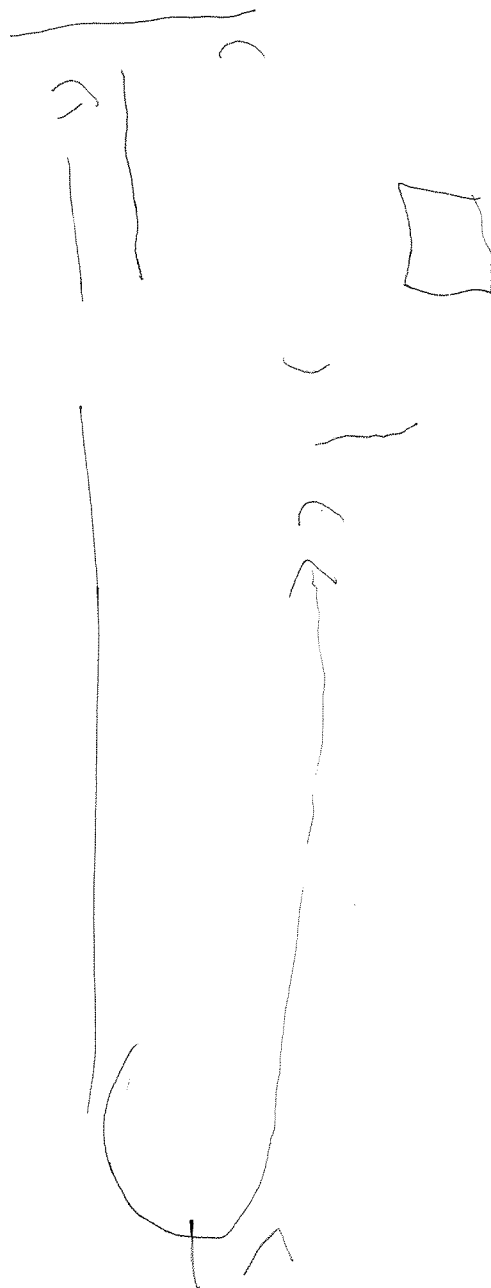

Start Point: Conrad's Ferry Dr. at Canal Run

End Point: _____

Direction of Increasing Station: _____

Reason Codes for NON-COMPLIANCE:

Inspector Name: S.C./R.H.

Date: Nov 11, 2014

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: _____

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
Canal Ramp 2 at Run Dr.	0+00	5+40				Driveways 5 on Right
Conrad's Ferry Ramp 1 End						Ramp at parking lot -
Conrad's Ferry at Lockhouse Ramp 2.	0+00	0+27	0+27	0+39	CS	Asphalt path -
Right	0+39	0+75	0+75	1+64	CS	
	1+64	2+56	2+56	2+95	CS	
	2+95	3+99	3+99	3+99	VC	- Asphalt Joint.
	3+99	4+95	4+95	10+29	CS	- Some areas C.S. excess 10%.
	10+29	10+67	10+67	11+57	CS	
	11+57	11+88	11+88	11+95	CS	
End at Concrete Sidewalk MB 1721	11+95					Conrad's Ferry House 1721 Concrete Sidewalks

Start Point: GREYSAN'S FERRY CT Sidewalk Inventory

End Point:

Direction of Increasing Station: LT

Inspector Name: R.H.S.C.

Date: 3/10

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
canal Run Dr.	0+00	1+00	1+00	1+31	CS	
↳ Loop	1+31	5+40	5+40	5+60	CS/PZ	NO PASSING ZONE
	5+60	5+76	5+76	5+91	CS	↓
	5+91	11+17	11+17	11+40	CS	where? need to
	11+40	11+52	11+52	11+52	VC	specify
canal Run Dr.	11+52	12+61				15 D.W. I put from at 5+55 to 5+60
↳ Loop						

Sidewalk Inventory

Start Point: Calico Arch

End Point: Calico Arch

Direction of Increasing Station:

Inspector Name:

Date: _____

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

[illegible]

Sidewalk Inventory

Start Point: Four Locks Circle

End Point:

Direction of Increasing Station: *RT*

Inspector Name: RA/S.C.
Date: 3/10/14

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

[illegible]

Start Point: BOATMAN'S Circle

End Point: (Ramp D) → Please write intersection name

Direction of Increasing Station: ET

Inspector Name: RH/S.L.

Date: 31/01/14

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways: 0

[illegible]

Start Point: FERRY HILL CTRamp Inventory Corresponding to Start: #2Direction of Increasing Station: RTRight or Left Side of Road: RT / LTInspector Name: R/S.C.Date: 3/10/14

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

Reason Codes for NON-COMPLIANCE:

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Street Name:	Compliant			Non-Compliant			Code	Comments
	From	To	Distance	From	To	Distance		
Ferry Hill CT ^{RT}	0+00	0+09		0+09	0+09		CS	SD, W RT
at canal Run Dr.	0+09	4+36			1A			
	1A							
Ferry Hill CT ^{LT}	0+00	0+17		0+17	0+17		VC	SD, W LT
at canal Run Dr.	0+17	3+78		3+78	3+86		CS	
	3+78	5+04						

Sidewalk Inventory

Start Point: Misty Hollow

End Point:

Direction of Increasing Station:

Reason Codes for NON-COMPLIANCE:

Inspector Name:

Date:

VC Vertical Clearance

PP Pinch Point

PZ Passing Zone

PO Protruding Object

DS Driveway Cross Slope

CS Panel Cross Slope

WP Width of Panel

Total Number of Driveways:

[illegible]

Start Point: Canada Ferry Rd Sidewalk Inventory

End Point: _____

Direction of Increasing Station: RT

Inspector Name: RH/S.L

Date: 3/10/14

Reason Codes for NON-COMPLIANCE:

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Total Number of Driveways: _____

Street Name:	Compliant		Non-Compliant		Code	Comments
	From	To	From	To		
<u>3/ Canal Run Dr.</u>	0+00	2+20	2+20	2+28	CS	
	2+28	3+58	3+58	3+98	CS, VC	
<u>BOATMAN'S Circle</u>			3+98			
<u>BOATMAN'S Circle</u>	0+00	1+72				
<u>Fairlocks Circle</u>						
<u>Fairlocks Circle</u>	0+00	2+03	2+03	2+13	CS	DO TO ASPHALT WALKING PATH
<u>Calico Circle</u>	2+13	3+50				
<u>Calico Circle</u>	0+00	1+18	1+18	1+18	VC	
	1+18	2+03		2+03	PZ	NO PASSING ZONE
						(S.D.W.)

Start Point: Canal Run Dr / Brookshire

Ramp Inventory Corresponding to Start:

Direction of Increasing Station: RT

Right or Left Side of Road: RT

Inspector Name: RJH / SC

Date: 2/26/14

VC Vertical Clearance
PP Pinch Point
PZ Passing Zone
PO Protruding Object

Reason Codes for NON-COMPLIANCE:

DS Driveway Cross Slope
CS Panel Cross Slope
WP Width of Panel

Street Name:	Compliant			Non-Compliant			Code	Comments
	From	To	Distance	From	To	Distance		
CLDR @ Brookshire	0+00	0+34		0+34	0+34		VC	
	0+34	1+92		1+92	2+05		PZ CS	40 DRIVEWAYS DRIVEWAY 4RT 9LT
	2+05	2+14		2+14	2+13		CS	
	2+23	2+ ⁷³ 69		2+ ⁷³ 69	2+73		VC	
	2+73	5+80		5+80	6+06		CS	
	6+06	8+12		8+12	8+30		CS	
	8+30	8+45						
" " " @ FERRY CT	0+00	0+89		0+89	1+00		PZ CS	10 DRIVEWAYS RT
	1+00	1+12		1+12	1+61		CS	
	1+61	1+77		1+77	1+81		CS	
	1+81	1+85		1+85	1+89		CS	
	1+89	2+58						
" " " @ MISTY HOLLOW	0+00	2+54					✓	0 DRIVEWAYS
" " " @ Canal Run CT	0+00	6+10					✓	3 RT RT

Start Point:	Corporate / Kingsbrook Dr.
Ramp Inventory Corresponding to Start:	Ramp 1
Direction of Increasing Station:	West
Right or Left Side of Road:	Left
End Point:	Corporate / Kingsbrook Dr.
Ramp Inventory Corresponding to End:	
Total Distance from Start to End:	

Note about ramps: At each ramp, begin another "Sidewalk Segment #" spreadsheet - Please be sure to include a reference to which "Ramp Inventory" spreadsheet contains the information about the ramp referenced as the "End Point" for this spreadsheet

Be sure to use corresponding PMP Stationing

[illegible]

Note about ramps: At each ramp, begin another "Sidewalk Segment #" spreadsheet - Please be sure to include a reference to which "Ramp Inventory" spreadsheet contains the information about the ramp referenced as the "End Point" for this spreadsheet.

Note about ramps: At each ramp, begin another "Sidewalk Segment #" spreadsheet - Please be sure to include a reference to which "Ramp Inventory" spreadsheet contains the information about the ramp referenced as the "End Point" for this spreadsheet

[illegible]

Brookshire Run at Canal Dr.
Brookshire Run Dr. at Canal Run Dr.

Brookshire Run Dr. 97 Can Run Dr.

South

Both

Canal Run @ Brookshire Run

Canal Run @ 4/20/11

400 ft.

Note about ramps: At each ramp, begin another "Sidewalk_Segment #" spreadsheet - Please be sure to include a reference to which "Ramp Inventory" spreadsheet contains the information about the ramp referenced as the "End Point" for this spreadsheet

Be sure to use corresponding PMP Stationing

2

Ramp
↑
Ramp